

08/11/13 wef

ASS. REC. BY:

REF:

CS/CT121012445/R1943

9994

## ASSIGNMENT

From:

Date:

Estimated Cost:

OB / TP / WS / TP RES / OD RES / EVA / INV / MV

To Inspect Vehicle No: XE 5385X

at Workshop m/s AUTO INSURE

of No. 8 MARILYN DR

Insured:

CTI

Policy No.

Claims No. SNM21D206560/C01

Sum Insured:

Excess:


2500

(Client's Record)

Make of Veh:

(Policy Condition)

Remark: The veh had commenced its repair at the time of inspection.

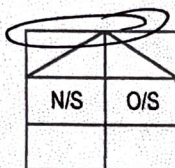

Bal. or Market Value:

150k

IDAC Accident Rpt:

Consistent? : Yes or No

GIA / PR Seen:

Consistent? : Yes or No

Est. Repairs:

days

Res.: Yes or No

Lum Sum:

%

3 Val.: Yes or No

CA / REV / REP. / 24 HRS

Date:

Person Contacted:

Vehicle: IN / OUT

Veh No:

XE 5385X

Yr Regn:

2019 / NOV

Type: M.Car / M.Cycle / Bus / Van / Lorry / Taxi / Prime Mover /

Truck / Trailer or

Make:

MERCEDES BENZ AROCS S-CAR c.c 10677

Colour

WHITE

A/C:

Insured / Std / NI / NA

Sp. Reading

101622

T/Radio:

Insured / Std / NI / NA

Eng/No:

C/No:

WDB96421620288765

Gen. Cond: Good / Fair / Poor / Burnt

Steering: Inorder / Jammed / Leaked / Burnt or

Brake: Inorder / Jammed / Leaked / Burnt or

Modi: Nil / S/Rim / STD A/Rim or

Tyre Size:

F:

315/80R22-5

R:

BS / DUN / EXNOVA / GY / FS / LIZA / MIC / OHTSU / PIR / SUMI /

TOYO / YOKO or

HILPERZEN

Front

Rear

R/Bal.

8

mm

R/Bal.

8/8

mm

L/Bal.

8

mm

L/Bal.

8/8

mm

D.O.A.

13/11/21

D.O.I.

09/12/21

Survey held at

AUTO INSURE

Des. of Damages: Frt / Rear / O/S / N/S / U/C / Rooftop or

The U/C / Chassis frame / Body Structure affected due to collision.

Date / Time

Action / Instruction

REPAIR LIMIT - 129k

10/12/21@11.49am revert to Pauline Tham via Merimen.

14/12/21@3.47pm Pauline Tham informed C/A via Merimen.

15/12/21@5.11pm Informed wksp C/A &amp; ex:\$2500 by email.

Date/Time, File Pass to?



Prel. Report

1)



Final Report

Date/Time, File Return to?

2)

Days Of Repair:

Resurvey No. of Trip:

Add Fee:



Site Insp (\$



Interview (\$



Tech. Invs (\$



Weekend (\$

Survey Fee:

Transportation:

S + RS, SI

Photos

Others

TOTAL

Report Format :

Lump Sum / I.B.I. (\$



**Auto Insure Pte. Ltd**  
**6 Marsiling Lane**  
**739145**



**Insurer Reference: XE5385X**  
**Repairer Reference: M3547 / XE5385X**  
**Date calculated: 08/12/2021 12:05 PM**

**Full Report**  
**Registration: XE5385X**  
**Printed: 08/12/2021 12:05 PM**

### Summary Information

#### Claim

Location:	Singapore (SG)	Work Provider:	China Taiping Insurance (Singapore) Pte Ltd
Printed by:	Siew Meng Hui	Currency:	SGD
Claim Reference:	XE5385X	Date of Incident:	13/11/21
Estimated Repair Time:	14	Hire Car Start:	
Actual Repair Days:	14	Hire Car End:	

### Vehicle Details

#### Vehicle

Manufacturer:	MERCEDES-BENZ
Model:	WDB 964216 6X4
Sub Model:	TYP 3336
Model Sheet Number:	03 9B 38
Registration:	XE5385X
VIN number:	WDB96421620288765
Odometer:	101622

#### Model Specs

PROT PLATE ST/STEEL	CAB LONG CLASS SPACE	CAB ATT HEIGHT 600MM	MOVABLE STEP BOARDS
REAR SCREEN	GEARBOX G280/231	FRONT MIRROR	SWING SEAT
FUNCTIONAL SEAT EXT	AIR CONDITIONING	CONSTRUC SIDE FILTER	RR CAB SUSPENS REINF
OUTER SUNBLIND	ROOF LID	OM 470	OUTER PLANETARY AXLE
PWR STRG PUMP	HYDR PUMP DRIVE	RADIO	ENGINE 220KW-425KW
MATCHED BATTERIES	CB RADIO	R/R OUT EXH SYS TUBE	WHEELS 9.00 X 22.5
COMPR AIR RESERV ALU	PARABOL SPRING 7.5 T	ERH PERFORMANCE RAD	DUST PROTECT PLATE
VEHICLE CLASS N3G	FRONT AXLE 9.0T	REAR CAB AIR SUCTION	CYCLONE FILTER
CENTRAL PTO	RIGHT HAND DRIVE	RAISED FLOOR HEIGHT	TWO PACK STRT COLOUR
GEARBOX OIL COOLER	FRT/REAR DRUM BRAKE		

## Vehicle Condition


### Vehicle Status

Pre-Accident Damage:

Date of Inspection:

### Damage Areas

All ☐  
Underbody ☐

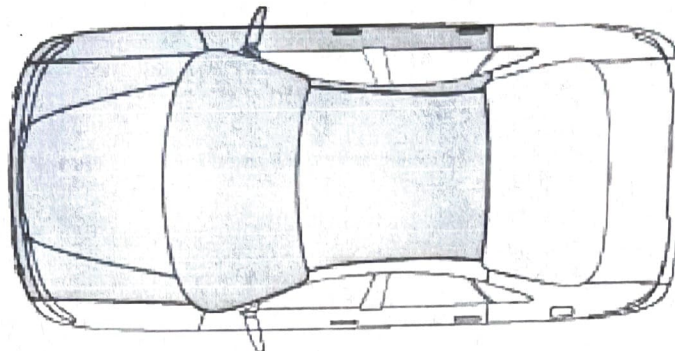

### Tyres Condition

Tyre Brand	Tread (Left Middle), mm	Tread (Left Outer), mm	Tread (Left Inner), mm	Tread (Right Inner), mm	Tread (Right Outer), mm	Tread (Right Middle), mm	Condition
------------	----------------------------	---------------------------	---------------------------	----------------------------	----------------------------	-----------------------------	-----------

Spare Tyre Brand	Tread (Spare), mm
------------------	-------------------

### Labour

Code	Description	Time Base 10 WU/h	Price = 42.00 SGD/h	
			WU	Price SGD
67-1600 01	R + R WINDSCREEN (FOR BODY SHELL REPAIR) INCLUDES: FRONT FLAP, WIPER ARMS, BOTH HANDLES, COVER WINDOW- WIPER LINKAGE, FRONT MIRROR AND BOTH A-PILLR COVERS REMOVE AND REFIT		38.0	159.60
82-6300 01)	R + R WIPER SYSTEM (WIPER SYSTEM COVER REMOVED) INCLUDES: WIPER MOTOR REMOVE AND REFIT, AFTER CHECK RENEW		7.0	29.40
88-2902 ZAX	FRONT END COVER REPLACE (REMOVED) INCLUDES: FRONT COVER, FRONT AIR GRILLE, BOTH WIND DEFLECTOR AND SUPPORT REMOVE AND REFIT		12.0	50.40
68-4605 01	INSTRUMENT PANEL R + R INCLUDES: INSTRUMENT PANEL UPPER COVER, LOWER INSTRUMENT PANEL COVER, COVER FOR COMBI-INSTRUMENT AND COMBI-		31.0	130.20



Code	Description	WU	Price SGD
	INSTRUMENT, SWITCH MODULE, CONT PANEL, DRIVER AND PASSENGER TRIMS REMOVE AND REFIT		
68-4669 01	ADD TO INSTRUMENT PANEL R + R, VEHICLE WITH 170 MM ENGINE TUNNEL INCLUDES: R AND R CENTRE MODULE	3.0	12.60
72-1085 01	R + R R/REVOLVING DOOR (1ST DOOR) INCLUDES: ADJUST DOOR	9.0	37.80
72-2125 01	CONVERT ALL PARTS OF THE R/REVOLVING DOOR (1ST DOOR)	14.0	58.80
88-3220 ZAX	RENEW R/DOOR MIRROR (REMOVED)	3.0	12.60
68-1572 01	R + R ALL SIDE-/ AND REAR CAB PANEL TRIMS, RENEW IF NECESSARY INCLUDES: R + R BOTH SIDE TRIMS AND REAR CAB PANEL STORAGE BOXES	20.0	84.00
68-1533 ZAX	ADDITION TO R + R REAR PANEL TRIM (VEHICLE WITH REAR PANEL WINDOW) INCLUDES: R + R REAR PANEL WINDOW	5.0	21.00
77-8320 ZAX	R + R OUTER SUNBLIND AND BRACKET, RENEW IF NECESSARY	15.0	63.00
82-5203 ZAX	R + R BOTH FRONT UPPER POSITION LAMPS, RENEW IF NECESSARY	4.0	16.80
NO NUMBER	ROOF PANEL FRONT PART ON CABIN REPLACE (ROOF PANEL SIDE REMOVED)	41.0	172.20
65-5601 ZAX	ATTACHED PARTS FOR RENEWAL OF ROOF COVER PANEL ON CAB REMOVE AND REFIT (HATRACK TRIM REMOVED) INCLUDES: HEADLINING AND ROOF LID REMOVE AND REFIT	32.0	134.40
65-5650 ZAX	ELECTRIC WORK FOR R + R ATTACHED PARTS OF WORK POSITION 65-5601	8.0	33.60
82-8010 ZAX	R + R RADIO ROOF AERIAL	3.0	12.60
82-9351 )ZAX	R + R CB RADIO SET	3.0	12.60
91-3605 01	R + R PASSENGER SEAT, RENEW IF NECESSARY (FUNCTIONAL SEAT)	7.0	29.40
91-3588 01	R + R DRIVER'S SEAT AND SEAT FRAME, RENEW IF NECESSARY (AIR SUSPENDED)	11.0	46.20
88-3679 01	FRONT WING (R/F PARTIAL) REMOVE AND REFIT INCLUDES: FRONT INN WHEEL ARCH TRIM REMOVE AND REFIT	9.0	37.80
88-3620 01	RENEW R/F WING (FRONT SECTION) (REMOVED)	3.0	12.60
88-4402 ZAX	FRONT BRACKET FOR FRONT WING (R/F PARTIAL) REMOVE AND REFIT (WING REMOVED)	2.0	8.40
88-3703 01)	FRONT WING (R/R UPP PARTIAL) REMOVE AND REFIT FRONT WING FRONT PART PIECE REMOVED	3.0	12.60
88-3644 01	RENEW R/F WING (REAR UPPER SECTION) (REMOVED)	2.0	8.40
NO NUMBER	REPLACE R/F INN WHEELHOUSE TRIM (REMOVED) INCLUDES: REPLACE SINGLE PARTS	1.0	4.20



Code	Description	WU	Price SGD
88-1051 01	R + R FRONT NUMBER PLATE	2.0	8.40
88-1128 01	RIGHT SIDE PART FOR FRONT BUMPER REMOVE AND REFIT (VEHICLE WITH CODE F7B) INCLUDES: BUMPER CENTRE PART FRONT UPP AND LWR, HEADLAMP UNIT REMOVE AND REFIT, ADJUST, R/MOVEABLE STEP BELOW THE SILL PARTIAL REMOVE AND REFIT	20.0	84.00
88-1136 01)	R/SIDE PANEL FOR FRONT BUMPER REPLACE (REMOVED) VEHICLE WITH CODE F7B INCLUDES: FRONT SPOILER, HINGE FOR HEADLAMP AND BUMPER BRACKET REMOVE AND REFIT	6.0	25.20
88-1120 01	ADD TO FRT LWR BUMPER CENTRE PART R + R (VEHICLE WITH PROT PART)	2.0	8.40
NO NUMBER	FRT AIR GRILLE ON UPP BUMPER CTR PART REMOVE AND REFIT, AFTER RESULTS REPLACE (BUMPER CENTRE PART REMOVED)	1.0	4.20
NO NUMBER	CROSSMEMBER FOR BUMPER CENTRE PART UPPER REMOVE AND REFIT (BUMPER CENTRE PART REMOVED)	2.0	8.40
88-5437 ZAX	BOTH STEPS (FOLDABLE) BUMPER CENTRE PART FRONT REMOVE AND REFIT	3.0	12.60
88-5436 ZAX	FOLDING STEP UNDER BUMPER CENTRE PART REMOVE AND REFIT (BUMPER CENTRE PART FRONT LOWER REMOVED)	3.0	12.60
88-1858 ZAX	RENEW FRONT BUMPER BRACKET (BUMPER REMOVED)	3.0	12.60
88-4901 01	R + R R/SILL INCLUDES: STEP REMOVE AND REFIT	4.0	16.80
88-4908 01	RENEW R/SILL (REMOVED)	1.0	4.20
88-5434 01)	R/MOVEABLE STEP BELOW THE SILL REMOVE AND REFIT (R/SIDE PANEL FOR BUMPER REMOVED)	2.0	8.40
88-5273 ZAX	R + R R/F SILL BRACKET (SILL REMOVED)	3.0	12.60
88-5277 ZAX	R + R R/R SILL BRACKET (SILL REMOVED)	3.0	12.60
88-4662 ZAX	R + R R/PARTITION, RENEW IF NECESSARY	3.0	12.60
46-3400 01)	R + R POWER STEERING (CAB TILTED, SILL REMOVED) INCLUDES: STEERING RACK W/STEERING MOUNT R + R, DRAG LINK, LWR STRG SPINDLE SILL R + R, BLEED POWER STEERING	28.0	117.60
46-3612 ZAX	RENEW POWER STEERING (REMOVED) INCLUDES: CONVERT STEERING SUPPORT AND STEERING LEVER	6.0	25.20
46-5600 ZAX	RENEW POWER STEERING HYDRAULIC PIPE (PIPE D 2)	3.0	12.60
60-6446 01	R + R R/R CAB SPRING STRUT, RENEW IF NECESSARY	5.0	21.00
88-2101 01)	R + R LOWER RADIATOR PROTECTIVE GRILLE	3.0	12.60
83-6543 ZAX	CONDENSER ON THE AIR CONDITIONING	6.0	25.20



Code	Description	WU	Price SGD
	REMOVE AND REFIT, AFTER RESULTS REPLACE (BUMPER CENTRE PART REMOVED)		
54-1015 ZAX	SECURITY MEASURES BEFORE ELECTRIC WELDING (DURING REPAIR)	3.0	12.60
0905	OUTER ENG FIREWALL REPAIR	20.0*	84.00
1118	R/CORNER PANELLING REPAIR	20.0*	84.00
1122	R/F CORNER PANELLING REPAIR	20 30.0*	126.00
2102	R/SIDE PANEL CPL REPAIR	20 30.0*	126.00
<b>Labour Cost</b>		<b>Hrs</b>	<b>WU</b>
<b>Panel / Mechanical Labour</b>		49.80	498.0
<b>Total of Labour</b>			2,091.60

## Paint

Paint Work		Time Basis 10 WU/h	
Code	Description - TWO PACK STRT COLOUR	WU	Price SGD
98-3032 01	CENTRE FRONT LID NEW PRT PAINT STGE 2	5.0	21.00
98-3142 01)	R/F AIR GUIDE PART NEW PRT PAINT STGE 2	3.0	12.60
98-4101 01	R/1 DOOR PAINTING STAGE I-M	15.0	63.00
KN	R/R UPPER COVER NEW PRT PAINT STGE 2	3.0	12.60
98-6060 01	ROOF FRONT SECTION PAINTING STAGE I-E	22.0	92.40
98-3353 01	R/CORNER PANELLING PAINTING STAGE III	8.0	33.60
98-4713 01	R/SIDE PANEL CPL PAINTING STAGE III	15.0	63.00
98-3611 01	FIREWALL CPL PAINTING STAGE I-J	11.0	46.20
98-1345 01	PREPARATORY WORK SINGLE COAT PAINTING OF BUILT BODY PARTS INCLUDES: PREPARATION TIME EQUIPPED BODY PARTS, TINT WITH MIXING PLANT OUT MIXING	12.0	50.40
<b>Total Paint</b>		<b>Hrs</b> 9.40	<b>WU</b> 94.0
			<b>Price SGD</b> 394.80

## Spare Parts

				prices as at 2015-06-01
Code	Description	Part Number	Part Source	Price SGD
0491	<i>CRA</i> BONNET AIR GRILLE	960 750 0418 7G99	Original	650.00
0411	<i>CRA</i> BONNET AIR GUIDE	960 751 0625	Original	75.00
1214	<i>new</i> BRACKET SPACER SET	000 671 0069	Original	30.00
0360	<i>X</i> BUMP/ATTACHED PARTS	SUPPLIED GREY	Original	0.00
0406	<i>CRA</i> CENTRE FRONT LID	960 750 0309	Original	850.00
2017	<i>bt</i> CONDENSER - photo?	960 500 1554	Original	780.00
0487	<i>me</i> EMBLEM "AROCS"	960 817 1920	Original	35.00
0410	<i>?</i> FRONT BUMPER	960 750 1467	Original	600.00
	CARRIER			
0508	<i>rec</i> FRONT STAR EMBLEM	960 817 0016	Original	90.00
0333	<i>CRA</i> FRT AIR GRILLE SUPP	960 885 0754	Original	160.00
0335	<i>CRA</i> FRT AIR GRILLE SUPP	960 880 7385	Original	28.00
0302	<i>CRA</i> FRT C-MEMB R/LWR BRK	960 885 4145	Original	58.00



Code	Description	Part Number	Part Source	Price SGD
0334	<i>crn</i> FRT CTR AIR GRILLE	960 885 6653	Original	55.00
		7G99		
0282	<i>crn</i> FRT CTR BUMPER	960 880 2291	Original	700.00
		7G99		
0509	<i>new</i> GRILLE BADGE	960 751 1618	Original	35.00
6754	<i>bt</i> INSECT MESH	961 500 0117	Original	500.00
0375	<i>X</i> L/BRACKET	960 885 1151	Original	35.00
0377	<i>X</i> L/BRACKET	960 885 1151	Original	35.00
0337	<i>X</i> L/CTR AIR GRILLE APP	960 885 4184	Original	58.00
		7G99		
0371	<i>X</i> L/F CENTRE STEP	960 883 4401	Original	260.00
0347	<i>bt</i> LOWER SHIELD	960 317 0031	Original	500.00
0431	<i>rec</i> MANUFACTURER BADGE	673 810 0018	Original	70.00
0287	<i>cut</i> NO PLATE COVER CAP	960 880 3805	Original	170.00
1482	<i>bt</i> R/1 DOOR	960 720 2203	Original	2,250.00
0262	? R/BRACKET	960 880 9665	Original	55.00
0264	? R/BRACKET	960 880 0865	Original	40.00
0376	? R/BRACKET	960 885 1051	Original	35.00
0378	? R/BRACKET	960 885 1051	Original	35.00
0322	? R/BUMPER BRACKET	960 885 1245	Original	120.00
2308	? R/CENTRE BRACKET	960 666 5215	Original	28.00
0338	<i>crn</i> R/CTR AIR GRILLE APP	960 885 4284	Original	58.00
		7G99		
1732	<i>crn</i> R/DOOR MIRROR	960 810 2119	Original	1,050.00
0294	<i>de</i> R/END TRIM	960 885 2274	Original	45.00
		7G99		
0912	<i>de</i> R/F AIR GUIDE PART	960 751 0530	Original	250.00
2214	? R/F BRACKET	960 660 7541	Original	160.00
0372	<i>crn</i> R/F CENTRE STEP	960 883 4501	Original	260.00
0374	<i>crn</i> R/F CTR STEP BRKT	960 885 8940	Original	120.00
0402	<i>sch</i> R/F HANDLE	960 880 1920	Original	200.00
0748	<i>MIS</i> R/F LOWER WING	960 881 7603	Original	45.00
0354	<i>crn</i> R/F LW SIDE PART CVR	960 885 8774	Original	18.00
1536	<i>rec</i> R/F OUT WINDOW SEAL	960 725 1666	Original	68.00
1454	<i>bt</i> R/FR WIPER ARM	960 820 1344	Original	90.00
0742	? R/F SILL PARTITION	960 881 2303	Original	90.00
0276	<i>de</i> R/F SPOILER	960 885 7025	Original	80.00
		7G99		
0750	<i>crn</i> R/F UPPER WING	960 881 4603	Original	120.00
0292	<i>de</i> R/F UPP S-PNL BUMPER	960 880 6672 7277	Original	550.00
0668	? R/F WASHER JET	960 869 0047	Original	20.00
2086	<i>crn</i> R/F WING	961 666 5301 7277	Original	650.00
2092	? R/F WING BRACKET FRT	960 660 4141	Original	38.00
2262	? R/F WING FRT CONSOLE	961 660 0114	Original	68.00
2146	? R/F WING UPP RR SECT	960 884 8776 7277	Original	420.00
1458	<i>rec</i> R/F WIPER BLADE	SEE GUIDE NO.	Original	70.00
		1459		
0580	<i>crn</i> R/HEADLAMP FRAME	960 826 0159	Original	155.00
		7G99		
0312	<i>crn</i> R/HEADLIGHT HINGE	960 826 0317	Original	45.00
0370	<i>crn</i> R/LOWER COVER	960 885 7353	Original	25.00
1758	<i>crn</i> R/LOWER COVER	960 811 2307	Original	32.00
2292	<i>bt</i> R/LOWER STEP	960 660 3328	Original	600.00
	MOVABLE			
0894	<i>crn</i> R/OUT AIR DEFL TRIM	960 751 1130	Original	250.00
0708	? R/POS LAMP WHITE	960 820 3456	Original	55.00



Code	Description	Part Number	Part Source	Price SGD
2218	? R/R BRACKET	960 660 2441	Original	190.00
2772	? R/R SPRING LEG	961 310 0555	Original	650.00
2144	? <del>cm</del> R/R UPPER COVER	961 884 3474 9135	Original	180.00
2286	<del>cm</del> R/UPPER STEP	960 666 2228	Original	32.00
2302	<del>cm</del> R/UPP SUN VISOR BRKT	960 811 1214	Original	22.00
0622	? R/WIRING	960 820 0604	Original	60.00
2304	<del>cm</del> R CTR UPP SUNVSR BKT	960 811 1014	Original	20.00
0562	<del>br</del> RIGHT HEADLAMP ASSY	961 820 8161	Original	720.00
2206	<del>cm</del> RIGHT SILL	961 666 6701 7277	Original	450.00
2193	? <del>br</del> ROOF FRONT SECTION	960 650 0409	Original	900.00
2250	X SILLS/WINGS	SUPPLIED GREY	Original	X 0.00
6000	? STEERING CARRIER	960 461 2840 7390	Original	900.00
9060	<del>ne</del> { STEERING CARR	N000000 005728	Original	6.00
	SCREWS			
9061	<del>ne</del> { STEERING CARR	N000000 007443	Original	9.00
	SCREWS			
7300	? STEERING GEAR	961 460 1400	Original	7,000.00
9062	<del>ne</del> { STEERING GEAR	N000000 005489	Original	4.50
	SCREWS			
9063	<del>ne</del> { STEERING GEAR	N000000 005490	Original	4.50
	SCREWS			
9065	<del>ne</del> STEERING LEVER NUT	005 990 8450	Original	12.00
0283	<del>bt</del> STEP BOW	960 880 6701	Original	980.00
9064	<del>ne</del> STRG CARR NUTS	002 990 7950	Original	6.00
6038	<del>br</del> STRG PRESSURE LINE	960 460 4543	Original	85.00
2300	<del>cm</del> SUN VISOR	960 811 2510	Original	550.00
1412	<del>ne</del> TOWING EYE DECAL	945 584 3240	Original	28.00
0331	<del>cm</del> UPP BUMP AIR GRILLE	960 885 7053	Original	220.00
		7G99		
0251	? UPPER CROSS STRUT	960 880 2803	Original	250.00
2593	? UPP INSTR PANEL TRIM	960 680 6281 9051	Original	620.00
1401	<del>cm</del> WINDSCREEN	960 671 0810	Original	600.00
1411	<del>ne</del> WINDSCREEN REP KIT	973 670 0093	Original	150.00
1449	X WINDSCREEN WIPER	960 820 2581	Original	750.00
1463	<del>de</del> WIPER LINKAGE COVER	960 820 0312	Original	600.00

f: OEM Parts  
n: Non-OEM Parts  
u: Used parts

**Savings**  
**Subtotal**

0.00  
29,968.00

**Total**

29,968.00

### Extras

Code	Description	Price SGD
1000	PAS OIL FRONT	60 80.00*
1001	NO PLATE WITH HOLDER FRONT	50.00*
1002	AIR CON GAS FRONT	120 150.00*
1003	BUMPER SCREWS & NUTS FRONT	80 60.00*
	<b>Total Extras</b>	<b>340.00</b>



## Final Calculation

	SGD	SGD
<b>Parts</b>	29,968.00	
<b>Total Parts</b>		<b>29,968.00</b>
<b>Labour Time Base 10 WU/h</b>		
Total 498.0 WU X 42.00 SGD/h	2,091.60	
<b>Total of Labour</b>		<b>2,091.60</b>
<b>Total Of Extras</b>		<b>340.00</b>
<b>Paint Work Time Base 10 WU/h</b>		
Labour Cost 94.0 WU X 42.00 SGD/h	394.80	
<b>Total Paint Including Material</b>		<b>394.80</b>
<b>Repair Cost Excludes GST</b>		<b>32,794.40</b>
GST (+7.00%)		<b>2,295.61</b>
<b>Repair Cost Included GST</b>		<b>35,090.01</b>

### Comments

- \* - USER SUPPLIED DATA
- NN - NO MANUFACTURERS CODE EXISTS
- ) - WU PARTIAL INCL IN OTHER POSITIONS

### Assessment Note

No assessment notes entered.

LKK Auto Consultants hence notify the Repairer of the following:

- To resurvey before/after spray painting
- To display damaged part(s) during resurvey
- Parts prices are subject to confirmation
- Third party survey is on a "Without Prejudice" basis
- No illegal modification(s) is allowed
- Supplementary item(s) must be resurveyed and is subject to final approval from Insurance Company

Acknowledged by Repairer

Signature:

Date:

Resul  
Hp 90010068  
10 days  
P/P  
09/12/21 @ 1210  
EXCESS: 2500  
Reset  
Resurvey before  
paint



# SINGAPORE ACCIDENT STATEMENT

## IMPORTANT NOTICE

1. Please report correctly the details of the accident to speed up the claims process.
2. This Form must be completed by the Policyholder and/or the Authorised Driver
3. Information provided must be as truthful and accurate as possible. Any wilful misrepresentation or withholding of material facts may allow insurance companies to repudiate policy liability.
4. The issue and acceptance of this Form by insurance companies is not an admission of policy liability on the part of the insurance companies.
5. Any false reporting may be referred to the Police for investigation.
6. This report will be forwarded by the insurers of the GIA Records Management Centre established by the General Insurance Association of Singapore (GIA) for archiving and that copies of this report will, for a fee, be made available upon application by interested parties.
7. By the lodgement of this report to the insurers, you hereby consent to the archiving of this report at the centre and to copies of the report being made available aforesaid.

## ACCIDENT STATEMENT

Date of Submission ..... 15/11/2021 13:30 (SGT)  
Date of Accident ..... 13/11/2021 11:30 (SGT)  
Exact Location of Accident ..... KPE, Singapore  
Additional Location Information ..... -  
Country/State of Loss ..... Singapore

## DETAILS OF OWN VEHICLE

Vehicle Registration Number ..... XE5385X

### INSURED/POLICYHOLDER

Is company? ..... Yes  
Name Of Registered Owner ..... HIAP TAT HOLDING PTE LTD  
Company Reg No ..... 201600999H  
Email Address ..... ivykua@hiaptat.com.sg  
Mobile Phone No ..... (Phone) +65-62891456  
Alternative Phone No ..... (Office) +65-62891456

### VEHICLE PARTICULARS

Manufacturer ..... Mercedes  
Model ..... AROCS  
Variant ..... AROCS 3336K 6X4 3300 S-CAB (AUTO, ABS)  
Exact purpose for which vehicle was being used at time of accident ..... Employment  
Are you claiming under your own insurance policy for repair to your vehicle? ..... Yes  
Vehicle Category ..... Commercial vehicle  
Transmission ..... Auto  
CC ..... 10677

### INSURANCE COMPANY

Name of Insurance Company ..... China Taiping Insurance (Singapore) Pte. Ltd.  
Type of Coverage ..... Comprehensive  
Fleet Policy ..... No  
Policy Number ..... DMCVSNW00118352000  
Cover Note Number ..... -

### DRIVER

Name of Driver ..... ZHANG AIGUO  
Work Permit No ..... G5064978X



Date Of Birth	05/10/1977
Occupation	Outdoor
Date Of Driving Pass	11/01/2011
Driving experience	10 YEARS AND 10 MONTHS
Gender	Male
Mobile Number	(Phone) +65-83166000
Alt. Phone Number	-
Email Address	ivykua@hiaptat.com.sg
Address	BLK 313A SUMANG LINK #03-109
Address complement	-
Postcode	821313
Is the driver the policyholder?	No
If No, Relationship of the Driver with the Insured	Employee
Does Driver Own Other Vehicles?	No
Vehicle Registration Number of Other Vehicle Owned by Driver	-
Insurance Company of Other Vehicle Owned by Driver	-

#### GENERAL INFORMATION OF THE ACCIDENT

Type of Accident	Chain Collision
Weather Conditions	Clear
Road Surface	Dry

#### OTHER INFORMATION

Was any foreign vehicle involved in the accident?	No
Number of vehicles involved in the accident	4
Was anybody injured in the Accident?	Yes
Was any injured conveyed to hospital by ambulance?	Yes
Was any other vehicle or property damaged?	Yes
Number of Passengers (Including Driver)	1
Has the driver been approached by unknown person(s) soliciting/offering accident claims assistance?	No

#### DETAILS OF POLICE ACTION

Was the accident reported to the police?	Yes
Police Station Name	Hougang Neighbourhood Police Centre
Police Station Phone No	(Phone) +65-18004890999
Alt. Police Station Phone No	(Fax) +65-63128989
Police Station Address	60 Hougang Ave 9 Singapore 538775
Was notice of intended Prosecution given?	No
If yes, against whom?	-

#### CIRCUMSTANCES OF ACCIDENT

PLEASE REFER TO POLICE REPORT

#### ATTACHMENT(S)

Are accident photos available for attachment?	Yes
Was there any video captured by Car Camera?	No
Was there any audio recorded?	No

#### DETAILS OF OTHER VEHICLE PROPERTY 1

Vehicle Registration Number	YP7473S
Vehicle Manufacturer	Hino
Vehicle Model	-
Vehicle Variant	-
Vehicle Colour	-
Vehicle Category	Commercial vehicle



Name of Driver ..... -  
 Contact Number ..... -  
 Address ..... -  
 Address complement ..... -  
 Postcode ..... -  
 Insurance Company Name ..... -  
 Nature Of Damage ..... -  
 Details of property damaged in accident ..... -  
 No. Of Passenger (Including Driver) ..... -

#### DETAILS OF OTHER VEHICLE PROPERTY 2

Vehicle Registration Number ..... SMH5722X  
 Vehicle Manufacturer ..... Hyundai  
 Vehicle Model ..... -  
 Vehicle Variant ..... -  
 Vehicle Colour ..... Red  
 Vehicle Category ..... Private car  
 Name of Driver ..... -  
 Contact Number ..... -  
 Address ..... -  
 Address complement ..... -  
 Postcode ..... -  
 Insurance Company Name ..... -  
 Nature Of Damage ..... -  
 Details of property damaged in accident ..... -  
 No. Of Passenger (Including Driver) ..... -

#### DETAILS OF OTHER VEHICLE PROPERTY 3

Vehicle Registration Number ..... SMM6406B  
 Vehicle Manufacturer ..... Hyundai  
 Vehicle Model ..... -  
 Vehicle Variant ..... -  
 Vehicle Colour ..... Gray  
 Vehicle Category ..... Private car  
 Name of Driver ..... -  
 Contact Number ..... -  
 Address ..... -  
 Address complement ..... -  
 Postcode ..... -  
 Insurance Company Name ..... -  
 Nature Of Damage ..... -  
 Details of property damaged in accident ..... -  
 No. Of Passenger (Including Driver) ..... -

#### INJURED PERSONS DETAILS

##### INJURED 1

Name of injured person ..... YP7473S DRIVER  
 Gender ..... -  
 Phone No ..... -  
 Address ..... -  
 Address Complement ..... -  
 Post Code ..... -  
 Approximate Age Years Old ..... -  
 Injuries Sustained ..... -  
 Injured person in which vehicle? ..... YP7473S  
 Were seat belts worn? ..... Yes  
 Was this injured conveyed to hospital by ambulance? ..... Yes



**Describe Circumstances of the Accident**

Please Refer To Police Report Ref No: T/2011114/2020.

**Declaration**

We declare the foregoing particulars are true in every respect.



Zhang Hong

Policyholder's Signature / Date & Time

Driver's Signature (if driver is not the policyholder) / Date & Time

[Signature]



Witnessed by Reporting Centre Personnel 15/4/2021



## SKETCH PLAN

### IMPORTANT NOTICE

1. Please report correctly the details of the accident to speed up the claims process.
2. This Form must be completed by the Policyholder and/or the Authorised Driver.
3. Information provided must be as truthful and accurate as possible. Any willful misrepresentation or withholding of material facts may allow insurance companies to repudiate policy liability.
4. The issue and acceptance of this Form by insurance companies is not an admission of policy liability on the part of the insurance companies.
5. Any false reporting may be referred to the Police for investigation.
6. The report will be forwarded by the insurers of the GIA Records Management Centre established by the General Insurance Association of Singapore (GIA) for archiving and that copies of this report will for a fee be made available upon application by interested parties.
7. By the lodgement of this report to the insurers, you hereby consent to the archiving of this report at the centre and to copies of the report being made available aforesaid.
8. Consent under the Personal Data Protection Act (PDPA)

I understand, acknowledge, agree and consent that:

(a) My insurer, my workshop and the General Insurance Association of Singapore ("GIA") may/are permitted to collect, use, disclose and/or process my personal data/personal information set out in this [form] and any other personal information provided by me or possessed by my insurer (collectively the "Personal Information") and disclose and transfer such Personal Information to all insurer(s) who have insured vehicle(s) involved in this accident (all insurer(s) who have insured vehicle(s) involved in this accident shall be collectively referred to as the "Insurers"), the Insurers' lawyers/law firms, the Monetary Authority of Singapore and any relevant government agency/authority (such as the police), for the purpose(s) of:

(i) processing, handling and/or dealing with my claims including the settlement of the claims and any necessary investigations relating to the claims;

(ii) investigating the accident and/or my claims;

(iii) carrying out and/or dealing with my instructions or responding to any enquiries by me;

(iv) administering my claims (including the mailing of correspondence, statements, invoices, reports or notices to me, which could involve disclosure of certain personal data about me to bring about delivery of the same as well as on the external cover of envelopes/mail packages); and/or

(v) complying with applicable law in administering, processing, handling and/or dealing with my claims.  
(collectively the "Purposes")

(b) all insurer(s) who have insured vehicle(s) involved in this accident and the Insurers' lawyers/law firms, may/are permitted to collect, use, disclose and/or process my Personal Information for one or more of the above Purposes; and

(c) my Personal Information may/can be disclosed by any of the Insurers and/or GIA to their third party service providers or agents (including their lawyers/law firms), which may be sited outside of Singapore, for one or more of the above Purposes.



Zhang Biao

Zhang Biao



Policyholder's Signature / Date & Time

15/4/2021


Driver's Signature (If driver is not the policyholder) / Date & Time

12:00pm

Witnessed by Reporting Centre Personnel

15/4/2021

Sketch Plan

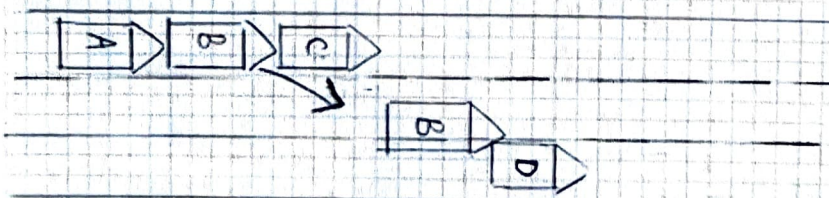

A : XE5385X

B : YP7473S

C : SMH 5722X

D : SMH 6406B





# SINGAPORE POLICE FORCE



T/20211114/2020

1 of 3

Police Station Of Origin:  
Hougang N.P.C  
60 Hougang Avenue 9 SINGAPORE 538775  
Tel No: 1800-4890999

Report No. T/20211114/2020

## REPORT OF A TRAFFIC ACCIDENT

Date/Time Report Made: 14/11/2021 10:44		Vide Report No.: G/20211113/0134		Station Diary No.: 22	
<b>Informant's Particulars</b>					
Name of Informant: ZHANG AIGUO			Address: APT BLK 313A SUMANG LINK #03-109 PUNGGOL PARCVISTA SINGAPORE 821313		
ID Type / ID No.: FIN NO / G5064978X			Contact No.: Home/Office: Mobile: 83166000		
Nationality: CHINESE			Email:		
Sex: Male	Age: 44	Date of Birth: 05/10/1977	Type of Informant: Driver		
Race: Chinese			Language:		Institution / School Name:
Occupation: Lorry driver			Driving Licence Information: Class: 3,4		Date of Expiry:


<b>General Information of the Accident</b>				
Type of Accident:	Injury Attended by Police	Drink Drive: No	Date/Time of Accident: 13/11/2021 11:30	Type of Location: EXPRESSWAY
Location:  KALLANG PAYA LEBAR EXPRESSWAY				
Weather: Clear		Road Surface: Dry	Road Speed Limit:	
Traffic Flow:		Traffic Control:	Traffic Volume:	
Type of Collision:			Anyone conveyed by ambulance: No	

<b>Details of Vehicle Involved</b>						
Vehicle No.	Type	Make	Model	Color	Condition	No of Passenger
XE5385X	Lorry				Slightly Damaged	0





**SINGAPORE  
POLICE FORCE**



T/20211114/2020

Police Station Of Origin:  
Hougang N.P.C  
60 Hougang Avenue 9 SINGAPORE 538775  
Tel No: 1800-4890999

2 of 3

Report No. T/20211114/2020

**CONTINUATION OF REPORT**

**Brief Details.**

On 13/11/2021 at about 1130hrs, I was driving my vehicle with vehicle no along KPE. While driving, I was about to drive in to the tunnel, I hit the lorry in front of me with vehicle no. YP 7473S as the said lorry suddenly brake and stop. Prior to that, the lorry went from 2nd lane then change to 1st lane and subsequently brake. As such, the lorry hit the vehicle in front of them. After which, all of us went out from the vehicle and called for Ambulance and Police. I noticed that the lorry driver was injured as he informed that his back aching.

I wish to state that I did not have any in-car camera installed inside the lorry. I did exchanged particulars with the lorry driver. The particulars as follow unknown name ( Hp: 82333385). The lorry driver was conveyed to Hospital. I am not injured. There was damages on my lorry which the front bumper was damaged. Traffic Police came down to speak to me and required me to lodge a Traffic Police accident report.





**SINGAPORE  
POLICE FORCE**



T/20211114/2020

Police Station Of Origin:  
Hougang N.P.C  
60 Hougang Avenue 9 SINGAPORE 538775  
Tel No: 1800-4890999

3 of 3

Report No. T/20211114/2020

**CONTINUATION OF REPORT**

**Sketch Plan**

Informant is not able to provide sketch plan

**IMPORTANT:** Please attach a copy of your vehicle's Insurance Certificate to this report. If you don't have the certificate with you now, please fax a copy to 65474885 stating the report number as reference.

Signature of Officer Recording The Report  
F /

Sgt 3 NUR KHAIRIAH BINTE  
KHAIRIL ANWAR

Signature Of Informant:

Signature Of Interpreter:  
Not applicable

Date/Time:  
14/11/2021 10:44

Officer In Charge Of Case:  
TP / GIT /  
Staff Sgt MOHAMED SUFIAN BIN MOHAMED  
JUNID  
Contact No.: 65476247

Classification Of Case:



> Back to OneMotoring

## Enquire PARF/COE Rebate for Registered Vehicle

<b>Vehicle Owner Particulars</b>	
Owner ID Type:	Company
Owner ID:	999H
<b>Vehicle Details</b>	
Vehicle No.:	XE5385X
Vehicle to be Exported:	No
Intended Deregistration Date:	27 Nov 2021
Vehicle Make:	MERCEDES BENZ
Vehicle Model:	AROCS 3336K 6X4 3300 S-CAB (AUTO, ABS)
Primary Colour:	White
Manufacturing Year:	2018
Engine No.:	470913C0425725
Chassis No.:	WDB96421620288765
Maximum Power Output:	-
Open Market Value:	\$105,574.00
Original Registration Date:	28 Nov 2019
First Registration Date:	28 Nov 2019
Transfer Count:	0
Actual ARF Paid:	\$5,279.00
<b>Intended PARF Rebate Details</b>	
PARF Eligibility:	No
PARF Eligibility Expiry Date:	-
PARF Rebate Amount:	\$0.00
<b>Intended COE Rebate Details</b>	
COE Expiry Date:	27 Nov 2029
COE Category:	C - Goods Vehicle & Bus
COE Period(Years):	10
QP Paid:	\$25,392.00
COE Rebate Amount:	\$20,334.00
<b>Total Rebate Amount:</b>	<b>\$20,334.00</b>

The information contained herein is correct as at 27 Nov 2021

OK