

ASS. REC. BY:

REF: MSG / 22000871kvf3

Kenneth

ASSIGNMENT

From:

Date:

Estimated Cost:

OD / TP / WS / TP RES / OD RES / EVA / INV / MV

To Inspect Vehicle No:

at Workshop m/s

of

Insured: SJN 8778U

Policy No. 1001471870

Claims No. 267709

Sum Insured:

Excess:

(Client's Record)

Make of Veh:

(Policy Condition)

Remark: The veh had commenced its repair at the time of inspection.

Bal. or Market Value:

IDAC Accident Rpt:

GIA / PR Seen:

Est. Repairs:

Lum Sum:

Consistent? : Yes or No

Consistent? : Yes or No

Res.: Yes or No

3 Val.: Yes or No

CA / REV / REP. / 24 HRS

Date:

Person Contacted:

Vehicle: IN / OUT

Date / Time

Action / Instruction

20/1/22 Kenneth informed LS \$6500 (Red 12512, 65%)

Time, File Pass to?

☐

: Prel. Report

☐

: Final Report

Time, File Return to?

20/1/22-typist

rt Format: Merimen

Sum / I.B.I: (\$ LS \$6500

Days Of Repair: 5

Resurvey No. of Trip: 2

Add Fee:

☐

: Site Insp (\$

☐

: Interview (\$

☐

Tech Invs (\$

☐

Weekend (\$

Survey Fee:

Transportation:

S + RS. SI

Fees

Others

TOTAL

Veh No:

SCH 2388J

Yr Regn:

03, 13

Type: M.Car / M.Cycle / Bus / Van / Lorry / Taxi / Prime Mover /

Truck / Trailer or

Make:

Mc E 200

c.c.

1796

Colour

Black

A/C:

Insured / Std / NI / NA

Sp. Reading

239089

T/Radio:

Insured / Std / NI / NA

Eng/No:

C/No:

WDD 2120 482 A 717 886

Gen. Cond: Good / Fair / Poor / Burnt

Steering: In order / Jammed / Leaked / Burnt or

Brake: In order / Jammed / Leaked / Burnt or

Mod: Nil / S/Rim / STD A/Rim or

Tyre Size:

F:

R:

245/35 ZR19

BS / BUN / EXNOVA / GY / FS / LIZA / MIC / OHTSU / PIR / SUMI /

TOYO / YOKO or

Front

Rear

R/Bal.

7

mm

R/Bal.

7

mm

L/Bal.

7

mm

L/Bal.

7

mm

D.O.A.

31/10/21

D.O.I.

3/1/2022

Survey held at

Des. of Damages: Frt / Rear / O/S / N/S / UIC / Rooftop or

The UIC / Chassis frame / Body Structure affected due to collision.

RIVERVIEW AUTO SERVICES PTE LTD

10 ANG MO KIO INDUSTRIAL PARK 2A

#04-07/#04-16 AMK AUTOPOINT

SINGAPORE 568047

Tel: 6481 2025 / 6481 5797 Fax: 6481 8715

Email: service@riverviewauto.com.sg

Website: www.riverviewauto.com.sg

Co.Reg No: 200800062E GST.Reg No: 200800062E

Lump Sum
Repair
less 25%

Not Authorised
11 Sep @
Penny After Paying
for 6 days

SLH 2388J

Mercedes E200

List Price \$

Mers less 10%

Paints

Bootlid

B1 2950 ✓

Bootlid Mers badge

M 135 ✓

Bootlid "E200" emblem

M 115 ✓

Bootlid lock

M 325 ✓

Rear Bumper

Bu 1840 ✓

Rear Bumper PDC reverse sensor @ \$316 x 4pc

1264 ✓

Rear Bumper reverse sensor wire harness

280 ✓

Rear Bumper Lower spoiler

M 668 ✓

Rear Bumper Centre brackets @ \$29 x 2pc

58 ✓

Rear Bumper side retainers @ \$71 x 2pc

M 154 X

tail lamps @ \$875 x 2pc

M 1750 X

tail lamp lower bracket @ \$90 x 2pc

M 180 ✓

Exhaust chrome end pipe @ \$375 x 2pc

M 750 X

Exhaust chrome end pipe bracket @ \$88 x 2pc

M 176 X

Head rest @ \$980 x 2pc

M 1960 X

Boot weatherstrip

220 ✓

Rear end panel top garnish

222 ✓

Rear Bumper centre trim

215 ✓

Rear Bumper reinforcement beam

865 ✓

Rear end panel

108

1330 ✓

Special Nett items

Nett Price \$

Bootlid "C&C" badge

M 85 ✓

Bootlid reverse camera

M 480 X

Rear end panel top garnish clips

\$30 ✓

Exhaust chrome end pipe bracket rivets @ \$20 x 4pc

\$80 X

End panel sealant

\$80 ✓

16,212

781

RIVERVIEW AUTO SERVICES PTE LTD

10 ANG MO KIO INDUSTRIAL PARK 2A

#04-07/#04-16 AMK AUTOPOINT

SINGAPORE 568047

Tel: 6481 2025 / 6481 5797 Fax: 6481 8715

Email: service@riverviewauto.com.sg

Website: www.riverviewauto.com.sg

Co.Reg No: 200800062E GST.Reg No: 200800062E

Lump Sum
Repair
less 20%

SH 2388J

Mercedes E200

Labour charges

Cost \$

- | | | |
|--|------|------|
| 1) To Renew damaged parts & repair the accident area. | 1200 | ? |
| 2) To Repair & reset headrest. | 250 | X |
| 3) To install reverse camera & check for proper function. | 80 | 501 |
| 4) To spray paint bootlid, Rear Bumper & rear end panel | 900 | 6601 |
| 5) To check with Mers star diagnosis Computer & clear all fault code | 250 | ? |
| 6) To carry out anti-rust treatment at the accident area | 120 | ? |
| | 2800 | |

19,012

LKK Auto Consultants hence notify the Repairer of the following:

- To resurvey before/after spray painting
- To display damaged part(s) during resurvey
- Parts prices are subject to confirmation
- Third party survey is on a "Without Prejudice" basis
- No illegal modification(s) is allowed
- Supplementary item(s) must be resurveyed and is subject to final approval from Insurance Company

Acknowledged by Repairer

Signature:

Date:

SA192213000H / AH LIM MOTOR COMPANY (MAIN)
ENTRY DATE & TIME: 03/01/2022 17:49 (SGT)
SUBMITTED BY: EILEEN CHUA
VERSION: 1 (03/01/2022 17:49 (SGT))

SINGAPORE ACCIDENT STATEMENT

IMPORTANT NOTICE

1. Please report correctly the details of the accident to speed up the claims process.
2. This Form must be completed by the Policyholder and/or the Authorised Driver.
3. Information provided must be as truthful and accurate as possible. Any wilful misrepresentation or withholding of material facts may allow insurance companies to repudiate policy liability.
4. The issue and acceptance of this Form by insurance companies is not an admission of policy liability on the part of the insurance companies.
5. **Any false reporting may be referred to the Police for investigation.**
6. This report will be forwarded by the insurers of the GIA Records Management Centre established by the General Insurance Association of Singapore (GIA) for archiving and that copies of this report will, for a fee, be made available upon application by interested parties.
7. By the lodgement of this report to the insurers, you hereby consent to the archiving of this report at the centre and to copies of the report being made available aforesaid.

ACCIDENT STATEMENT

Date of Submission	03/01/2022 17:49 (SGT)
Date of Accident	31/12/2021 12:30 (SGT)
Exact Location of Accident	Singapore
Additional Location Information	ALONG PIE TOA PAYOH TOWARDS CHANGI
Country/State of Loss	Singapore

DETAILS OF OWN VEHICLE

Vehicle Registration Number	SLH2388J
INSURED/POLICYHOLDER	
Is company?	No
Name Of Registered Owner	YONG KEE LING
NRIC No	SXXXX978F
Email Address	YONG.RIC@GMAIL.COM
Mobile Phone No	(Phone) +65-98484841
Alternative Phone No	+65-98484841

VEHICLE PARTICULARS

Manufacturer	Mercedes
Model	BENZ E 200 BLUEEFFICIENCY
Variant	-
Exact purpose for which vehicle was being used at time of accident	Private use
Are you claiming under your own insurance policy for repair to your vehicle?	No - Claiming third party
Vehicle Category	Private car
Transmission	Auto
CC	1796

INSURANCE COMPANY


Name of Insurance Company	HL Assurance Pte Ltd
Type of Coverage	Comprehensive
Fleet Policy	No
Policy Number	MP309681
Cover Note Number	27/03/2021 - 26/03/2022

DRIVER

Name of Driver	YONG KEE LING
RIC No	SXXXX978F

Date of accident: 31.12.21 Time: 1230pm Location: Along PZE toa Payoh towards Changi
 My Vehicle A: SLH 2388J Vehicle B: SJN 8778W Vehicle C: SFW 8836K

SKETCH PLAN

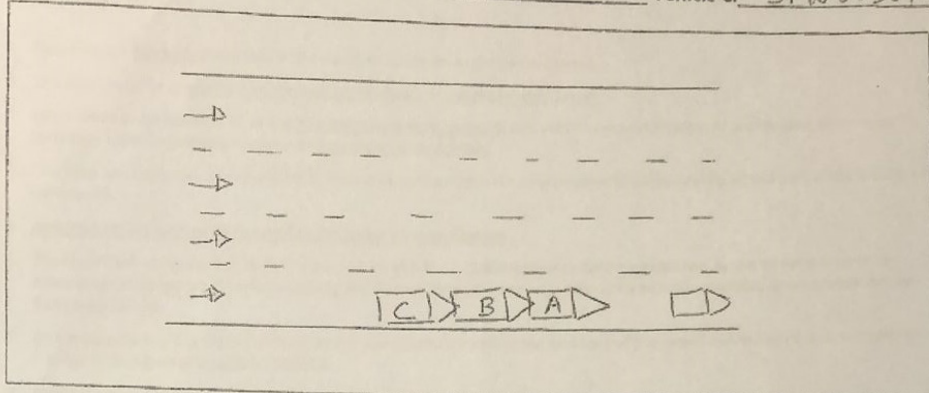

DESCRIBE CIRCUMSTANCES OF THE ACCIDENT

On the 31.12.21 at about 1230pm, I was driving along PZE toa payoh towards Changi. I was driving straight in my own lane at a safe speed. The front car slowed down and I slowed down as well. Suddenly, vehicle SJN 8778W came from behind and hit my car in the rear, damaging my vehicle. I came out and saw that there was another car SFW 8836K involved in this 3 car collision. There were no passengers in my car at the time of the accident.

veh B: Ng Kim Hwa Joseph / 801466027

veh C: To Hui Yang Marcus / 897168021

☐ Claim OD/TP at Ah Lim Motor ☒ Claim OD/TP at other workshop ☐ Reporting Only

Remarks: Please forward a copy of my efile accident report to:

My workshop: Riverview Auto Services Pte Ltd

Email address:

& myself

Email address: Email: Service@riverviewauto.com.sg

Note: Please take note that your insurer have 14 days timeframe for you to submit own damage claim under your own policy. Kindly check with your own insurer for more information.

DECLARATION

I/We declare the foregoing particulars are true in every respect.

Policyholder's Signature
Date & Time:

Driver's Signature
(If driver is not the policyholder)
Date & Time:

Reporting Centre Personnel's Signature
Name:
USIC/EN No.: