

ASS. REC. BY:

REF: C12/

CS/CTI22000721/Kqy3

Kenneth

ASSIGNMENT

From: _____ Date: _____

Estimated Cost: _____

OD / WS / TP RES / OD RES / EVA / INV / MV

To inspect Vehicle No: _____

at Workshop m/s NBM

of _____

Insured: _____

Policy No. _____

Claims No. SNM22D200469/C01Sum Insured: _____ Excess: 4K

(Client's Record)

Make of Veh: _____

(Policy Condition)

Remark: The veh had commenced its
repair at the time of inspection.

<input checked="" type="checkbox"/>	<input type="checkbox"/>
N/S	O/S
<input type="checkbox"/>	<input type="checkbox"/>

Bal. or Market Value: 8440K

IDAC Accident Rpt: _____ Consistent? : Yes or No

GIA / PR Seen: _____ Consistent? : Yes or No

Est. Repairs: 07 days Res.: Yes or NoLum Sum: 1.3.1 % 3 Val.: Yes or NoCA / REV / REP. / 24 HRS

Date: _____ Person Contacted: _____ Vehicle: IN / OUT

Date / Time Action / Instruction

1 May have Supplementar.

20/01/22@12.44pm revert to Adeline Chng via Merimen.

27/01/22@11.59am Pauline Tham informed C/A via Merimen.

28/01/22@1.15pm Informed wksp C/A & ex:\$4000 by email.

Veh No: STS 7M Yr Regn: 04, 21

Type: M.Car / M.Cycle / Bus / Van / Lorry / Taxi / Prime Mover /

Truck / Trailer or

Make: Porsche Cayenne c.c. 2995Colour: Black A/C: Insured / Std / NI / NASp. Reading: 10682 T/Radio: Insured / Std / NI / NA

Eng/No: _____

C/No: WP1 222 9Y 2MDA 01037Gen. Cond: Good / Fair / Poor / BurntSteering: Inorder / Jammed / Leaked / Burnt orBrake: Inorder / Jammed / Leaked / Burnt orModl: NI / S/Rlm / STD / A/Rlm orTyre Size: F: 275/45ZR20R: 305/40ZR20BS / DUN / EXNOVA / GY / FS / LIZA / MIC / OHTSU / PIR / SUMI /

TOYO / YOKO or

Front 9 mm Rear 9 mmR/Bal. 9 mmL/Bal. 9 mmD.O.A. 15/1/2 D.O.I. 20/1/2022

Survey held at _____

Des. of Damages: Frt / Rear / O/S / N/S / U/C / Rooftop or

Rear N/S & U/C

The U/C / Chassis frame / Body Structure affected due to collision.

Date/Time, File Pass to?

☐ : Prell. Report☐ : Final Report

1)

Date/Time, File Return to?

2)

Days Of Repair: _____

Resurvey No. of Trip: _____

Add Fee: ☐ : Site Insp (\$☐ : Interview (\$☐ : Tech Invs (\$☐ : Weekend (\$

Survey Fee:

Transportation:

S + RS. \$

Fees

Others

TOTAL

Report Format :

Lump Sum / I.B.I: (\$

MBM WHEELPOWER PTE LTD



Your Ref:

Our Ref: SJS7M

To: CHINA TAIPING

CC

Fax

Not Authentic
Running B4 paint
Ex @ 4000h
7 days

Date: 19/1/2022
From: Danny
Fax: 64525333
Contact: 93288668
Make / Model: PORSCHE CAYENNE 3.0
Chassis No.: WP1ZZZ9YZMDA01037
Engine No.: DCB310245
Year of Make: 2020
Accident Date: 15 January 2022

ESTIMATE FOR VEHICLE NO.: SJS7M

DESCRIPTION	QTY		List Price	
HEAD LAMP LH	1	\$	<i>CRA</i> 7,020.00	✓
FRONT BUMPER	1	\$	<i>Bul / M</i> 3,200.00	✓
FRONT BUMPER LH GUIDE	1	\$	145.00	?
FRONT BUMPER LH GRILLE DISK	1	\$	<i>nd</i> 250.00	✓
FRONT BUMPER LH GRILLE STRIP TOP	1	\$	<i>nd</i> 140.00	✓
FRONT BUMPER LH GRILLE CHROME TOP	1	\$	<i>nd</i> 180.00	✓
FRONT BUMPER LH GRILLE STRIP LOWER	1	\$	140.00	?
FRONT BUMPER LH GRILLE CHROME LOWER	1	\$	180.00	?
FRONT BUMPER LH GRILLE BASE	1	\$	280.00	?
FRONT BUMPER LOWER GRILLE LH	1	\$	<i>Sm</i> 229.00	X
FRONT BUMPER LOWER SPOILER	1	\$	<i>nd</i> 1,447.00	✓
BUMPER RIVETS/CLIPS @ \$9 EACH	20	\$	<i>nd</i> 180.00	✓
DISTANCE SENSOR	1	\$	<i>Sm</i> 250.00	X
FRONT LH FENDER	1	\$	<i>K</i> 2,160.00	X
FRONT LH FENDER BRACKET	1	\$	<i>K</i> 87.50	X
FRONT LH FENDER INNER SHIELD	1	\$	<i>nd</i> 712.80	✓
FRONT LH FENDER INNER SHIELD CLIPS	10	\$	<i>nd</i> 90.00	✓
FRONT LH WHEEL ARCH COVER	1	\$	<i>nd / M</i> 495.20	✓
FRONT CROSSMEMBER	1	\$	5,400.00	?
FRONT LH TRACK CONTROL ARM	1	\$	842.40	?
FRONT LH GUIDE ROD <i>(lower arm)</i>	1	\$	<i>B</i> 1,490.40	✓
FRONT LH UPPER WISHBONE	1	\$	<i>nd</i> 604.80	✓
FRONT LH WISHBONE	1	\$	<i>nd</i> 604.80	✓
FRONT LH KNUCKLE ARM	1	\$	<i>B</i> 2,052.00	✓
FORNT LH KNUCKLE ARM BEARING	1	\$	<i>nd</i> 561.60	✓

FRONT LH DRIVE SHAFT
FRONT LH SHOCK ABSORBER
FRONT LH STABILIZER LINK
FRONT LH TIE ROD END
FRONT LH TIE ROD
FRONT LH RIM

1	\$	<i>R</i>	3,434.40	<i>X</i>
1	\$	<i>B</i>	5,724.00	<i>✓</i>
1	\$		112.30	<i>?</i>
1	\$		864.00	<i>?</i>
1	\$		259.20	<i>?</i>
1	\$	<i>Net</i>	3,870.00	<i>✓</i>
Total:		\$	43,006.40	
LESS 10%:		\$	(4,300.64)	
Parts Total:		\$	38,705.76	

LABOUR

TO REMOVE, REFIT & REPAIR AFFECTED DAMAGED PARTS. INCLUDING TO KNOCK-OUT, WELD & STRAIGHTEN ON THE AFFECTED PARTS.
TO CONDUCT ALL WHEEL COMPUTERISED ALIGNMENT
TO REMOVE & REPLACE FRONT LH UNDERCARRIAGE
TO RESET ENGINE WARNING LIGHT (ABS, SRS, ECU MEMORY & ETC)
TO APPLY ANTI RUST COATING
TO REMOVE, REFIT & UPHOLSTERY TO FACILITATE REPAIRS
TO REMOVE & REPLACE BUMPER SENSORS
TO CHECK & RECONNECT ALL NECESSARY WIRING
TO SPRAY PAINT ON THE AFFECTED AREAS

	\$		1,400.00	
	\$		100.00	<i>60%</i>
	\$	<i>30%</i>	350.00	
	\$	<i>18%</i>	300.00	
	\$	<i>22%</i>	150.00	<i>X</i>
	\$	<i>22%</i>	150.00	<i>X</i>
	\$		60.00	<i>✓</i>
	\$	<i>30%</i>	80.00	
	\$	<i>90%</i>	1,400.00	
Total:		\$	42,695.76	
7% GST:		\$	2,988.70	
Grand Total:		\$	45,684.46	

LKK Auto Consultants hence notify the Repairer of the following:

- To resurvey before/after spray painting
- To display damaged part(s) during resurvey
- Parts prices are subject to confirmation
- Third party survey is on a "Without Prejudice" basis
- No illegal modification is allowed
- Supplementary item(s) must be resurveyed and is subject to final approval from Insurance Company

Acknowledged by Repairer

Signature:

Date:

Mbm wheelpower pte ltd

160 SIN MING DRIVE

#06-02

SIN MING AUTOCITY

t 62628888 f 64525333

Company Registration Number : 200204110W

SINGAPORE ACCIDENT STATEMENT

IMPORTANT NOTICE

1. Please report correctly the details of the accident to speed up the claims process.
2. This Form must be completed by the Policyholder and/or the Authorised Driver
3. Information provided must be as truthful and accurate as possible. Any wilful misrepresentation or withholding of material facts may allow insurance companies to repudiate policy liability.
4. The issue and acceptance of this Form by insurance companies is not an admission of policy liability on the part of the insurance companies.
5. Any false reporting may be referred to the Police for investigation.
6. This report will be forwarded by the insurers of the GIA Records Management Centre established by the General Insurance Association of Singapore (GIA) for archiving and that copies of this report will, for a fee, be made available upon application by interested parties.
7. By the lodgement of this report to the insurers, you hereby consent to the archiving of this report at the centre and to copies of the report being made available aforesaid.

ACCIDENT STATEMENT

Date of Submission	18/01/2022 17:08 (SGT)
Date of Accident	15/01/2022 00:00 (SGT)
Exact Location of Accident	Jln Kampong Chantek, Singapore
Additional Location Information	-
Country/State of Loss	Singapore

DETAILS OF OWN VEHICLE

Vehicle Registration Number	SJS7M
-----------------------------	-------

INSURED/POLICYHOLDER

Is company?	No
Name Of Registered Owner	Huang Mei Hwei
NRIC No	S8028062I
Email Address	lim33cb@yahoo.com.sg
Mobile Phone No	(Phone) +65-97421177
Alternative Phone No	+65-96655011

VEHICLE PARTICULARS

Manufacturer	Porsche
Model	Cayenne
Variant	-
Exact purpose for which vehicle was being used at time of accident	Private use
Are you claiming under your own insurance policy for repair to your vehicle?	Yes
Vehicle Category	Private car
Transmission	Auto
CC	3000

INSURANCE COMPANY

Name of Insurance Company	China Taiping Insurance (Singapore) Pte. Ltd.
Type of Coverage	Comprehensive
Fleet Policy	No
Policy Number	DMPCSNW00074102100
Cover Note Number	-

DRIVER

Name of Driver	Lim Chang Bin
NRIC No	S6921305G

SKETCH PLAN

IMPORTANT NOTICE


1. Please report correctly the details of the accident to speed up the claims process.
2. This Form must be completed by the Policyholder and/or the Authorised Driver.
3. Information provided must be as truthful and accurate as possible. Any wilful misrepresentation or withholding of material facts may allow insurance companies to repudiate policy liability.
4. The issue and acceptance of this Form by insurance companies is not an admission of policy liability on the part of the insurance companies.
5. Any false reporting may be referred to the Police for investigation.
6. The report will be forwarded by the insurers of the GIA Records Management Centre established by the General Insurance Association of Singapore (GIA) for archiving and that copies of this report will for a fee be made available upon application by interested parties.
7. By the lodgement of this report to the insurers, you hereby consent to the archiving of this report at the centre and to copies of the report being made available aforesaid.
8. **Consent under the Personal Data Protection Act (PDPA)**
I understand, acknowledge, agree and consent that :
(a) My insurer, my workshop and the General Insurance Association of Singapore ("GIA") may/are permitted to collect, use, disclose and/or process my personal data/personal information set out in this [form] and any other personal information provided by me or possessed by my insurer (collectively the "Personal Information") and disclose and transfer such Personal Information to all insurer(s) who have insured vehicle(s) involved in this accident (all insurer(s) who have insured vehicle(s) involved in this accident shall be collectively referred to as the "Insurers"), the Insurers' lawyers/law firms, the Monetary Authority of Singapore and any relevant government agency/authority (such as the police), for the purpose(s) of :
(i) processing, handling and/or dealing with my claims including the settlement of the claims and any necessary investigations relating to the claims;
(ii) investigating the accident and/or my claims;
(iii) carrying out and/or dealing with my instructions or responding to any enquiries by me;
(iv) administering my claims (including the mailing of correspondence, statements, invoices, reports or notices to me, which could involve disclosure of certain personal data about me to bring about delivery of the same as well as on the external cover of envelopes/mail packages); and/or
(v) complying with applicable law in administering, processing, handling and/or dealing with my claims.
(collectively the "Purposes")
(b) all insurer(s) who have insured vehicle(s) involved in this accident and the Insurers' lawyers/law firms, may/are permitted to collect, use, disclose and/or process my Personal Information for one or more of the above Purposes; and
(c) my Personal Information may/can be disclosed by any of the Insurers and/or GIA to their third party service providers or agents (including their lawyers/law firms), which may be sited outside of Singapore, for one or more of the above Purposes.

x Sandy
Policyholder's Signature / Date & Time
18 JAN 2022

Imi Chay
Driver's Signature (If driver is not the policyholder) / Date & Time
18 JAN 2022

Angie Soh
Witnessed by Reporting Centre Personnel
Angie Soh

Sketch Plan

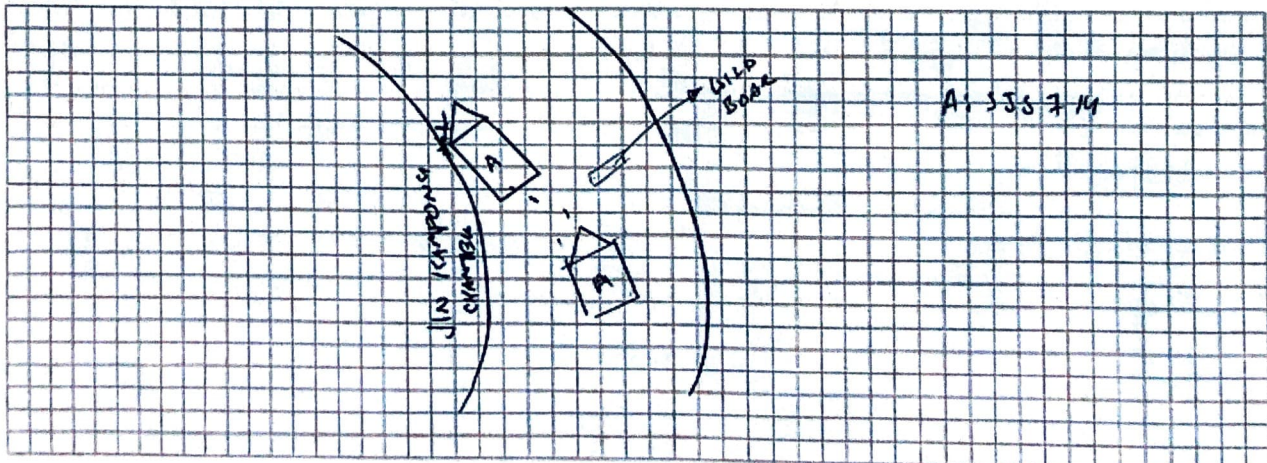

> Back to OneMotoring

Enquire PARF/COE Rebate for Registered Vehicle

Vehicle Owner Particulars	
Owner ID Type:	Singapore NRIC
Owner ID:	062I
Vehicle Details	
Vehicle No.:	SJS7M
Vehicle to be Exported:	No
Intended Deregistration Date:	17 Jan 2022
Vehicle Make:	PORSCHE
Vehicle Model:	CAYENNE 3.0 A
Primary Colour:	Black
Manufacturing Year:	2020
Engine No.:	DCB310245
Chassis No.:	WP1ZZZ9YZMDA01037
Maximum Power Output:	250.0 kW (335 bhp)
Open Market Value:	\$92,761.00
Original Registration Date:	13 Apr 2021
First Registration Date:	13 Apr 2021
Transfer Count:	0
Actual ARF Paid:	\$138,970.00
Intended PARF Rebate Details	
PARF Eligibility:	Yes
PARF Eligibility Expiry Date:	12 Apr 2031
PARF Rebate Amount:	\$104,227.00
Intended COE Rebate Details	
COE Expiry Date:	12 Apr 2031
COE Category:	B - Car above 1600cc or 97kW (130bhp)
COE Period(Years):	10
QP Paid:	\$47,001.00
COE Rebate Amount:	\$43,417.00
Total Rebate Amount:	\$147,644.00

The information contained herein is correct as at 17 Jan 2022

OK