

ASS. REC. BY:

REF: MSG/ 22001422/Kg3

Kenneth

ASSIGNMENT

From: _____ Date: _____

Estimated Cost: _____

OD / TP / WS / TP RES / OD RES / EVA / INV / MV

To Inspect Vehicle No: _____

at Workshop m/s _____ Ready

of _____

Insured: _____ 3480

Policy No. _____

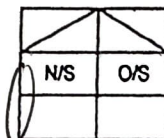
Claims No. 269437

Sum Insured: _____ Excess: _____

(Client's Record)

Make of Veh: _____

(Policy Condition)

Remark: The veh had commenced its
repair at the time of inspection.

Bal. or Market Value: \$ 48K

IDAC Accident Report: _____ Consistent?: Yes or No

GIA / PR Seen: _____ Consistent?: Yes or No

Est. Repairs: 07 days Res.: Yes or No

Lum Sum: 20 % 3 Val.: Yes or No

CA / REV / REP. / 24 HRS

Date: _____ Person Contacted: _____

Vehicle: IN / OUT

Veh No: SKL 9097T Yr Regn: 01, 14

Type: M.Cat / M.Cycle / Bus / Van / Lorry / Taxi / Prime Mover /

Truck / Trailer or A

Make: Mr CLA 200 c.c. 1595

Colour: M. Grey A/C: Insured / Std / NI / NA

Sp. Reading: 90409 T/Radio: Insured / Std / NI / NA

Eng/No: _____

C/No: WDD1173432N 040586

Gen. Cond: Good / Fair / Poor / Burnt

Steering: Inorder / Jammed / Leaked / Burnt or

Brake: Inorder / Jammed / Leaked / Burnt or

Modl: NII / S/Rim / STD / Rm or

Tyre Size: F: 225/40R18

R: _____

BS / DUN / EXNOVA / GY / FS / LIZA / MIC / OHTSU / PIR / SUMI /

TOYO / YOKO or Continental

Front Rear

R/Bal. 7 mm R/Bal. 7 mm

L/Bal. 7 mm L/Bal. 7 mm

D.O.A. 4/2/22 D.O.I. 15/2/2022

Survey held at ✓

Des. of Damages: Frt / Rear / O/S / N/S / UIC / Rooftop or

N/S Rear body

The UIC / Chassis frame / Body Structure affected due to collision.

Date / Time Action / Instruction

04/03/22@2.29pm revised & email Christina Wong to seek mandate at LS \$5550, 7 days.

07/03/22@10.02am Christina Wong informed proceed maNdate by email.

Kenneth finalised LS \$5550, 7 days (Red \$5692.53, 51%)

Date/Time, File Pass to?

☐: Prell. Report

1) 07/03 Typist

☐: Final Report

Date/Time, File Return to?

2)

Days Of Repair: 7

Resurvey No. of Trip: _____

Survey Fee:

Transportation:

S + RS. SI

Fees

Others

TOTAL

Report Format: MER-TP

Lump Sum / L.B.I. (\$) 5550

Add Fee: ☐: Site Insp (\$)☐: Interview (\$)☐: Tech Invs (\$)☐: Weekend (\$)

Ready Auto Care Pte Ltd - We Care For All Your Car Needs

Blk 10 # 03-06 AMK Auto Point, Ang Mo Kio Ind Park 2A, Ang Mo Kio Ave 5. Singapore 568047
Tel : 64810304 Fax : 64815587 Reg No : 200600989K GST No : 200600989k

MSIG

Motorcar Claim Department
Attn Claim Officer

Estimate Repair

Date : 14/02/2022

Accident Involving SKL9097T & SGM1611D On 04/02/2022 At Open Carpark

SKL9097T

Mercedes CLA200

Item	Descriptions	Amount
1	Rear Left Door	\$ 1,714.00 ✓
2	Rear Left Door Lock	\$ 315.65 X
3	Rear Left Door Glass Chrome	\$ 200.09 X
4	Rear Left Door Wheather Strips	\$ 265.36 ✓
5	Rear Left Fender	\$ 2,889.00 ✓
6	Rear Left Outer Parking Sensor	\$ 202.23 ?
7	Rear Left Wheel Hup Bearing	\$ 354.17 ?
8	Rear Left Knuckle Arm	\$ 1,425.24 ?
9	Rear Left Upper Arm	\$ 163.71 X
10	Rear Left Lower Arm	\$ 154.08 X

Total For Parts (Less 10%) \$ 7,683.53

- S/N Item (s)**
- 1 RL Sport Rim
 - 2 Bumper Clips - 1 Set

\$ 954.00 ✓
\$ 35.00 ✓

Total For S/N \$ 989.00

- Labour & Misc**
- 1 To Remove All Damaged Parts, Knock Out Dents, Jack Out Damaged Panel
 - 2 Panel, Adjust, Replace, Reshape, Cut, Weld, Refix & Realign Body Structure
 - 3 Spray Painting For New And Repair Parts Including Supply Of Paints Materials
 - 4 Remove & Refix RR Undercarriage Parts To Check
 - 5 Computerise 4 Wheels Alignment
 - 6 To Remove & Refix Floor & Roof Rining, Seat etc To Facilitate Repair
 - 7 Computerise Reprogramming Parking Sensor & Rear Left Door False Memory
 - 8 Check Wiring, Lighting System For Proper Function
 - 8 Cavity Preservation On All Affected Areas

800l
\$ 1,500.00
\$ 1,200.00 750l
\$ 260.00 ?
\$ 60.00 ✓
\$ 250.00 100l
\$ 150.00 60l
\$ 50.00 20l
\$ 100.00 60l

\$ 3,570.00

Total For Parts & Labour \$ 12,242.53

Ready Auto Care Pte Ltd

Sulynn - 96606551

No Of Days For Repair 8 Days

7 days

LKK Auto Consultants hence notify the Repairer of the following:

- To resurvey before/after spray painting
- To display damaged part(s) during resurvey
- Parts prices are subject to confirmation
- Third party survey is on a "Without Prejudice" basis
- No illegal modification(s) is allowed
- Supplementary item(s) must be resurveyed and is subject to final approval from Insurance Company

Acknowledged by Repairer

Signature:

Date: