

ASS. REC. BY:

REF:

C72/22001706/kg3

Kenneth

ASSIGNMENT

From:

Date:

Estimated Cost:

OD/TP/WS/TP RES/OD RES/EVA/INV/MV

To inspect Vehicle No:

at Workshop m/s

of

Insured:

Policy No.

Claims No.

SNM22D201078/C01

Sum Insured:

Excess:

(Client's Record)

Make of Veh:

(Policy Condition)

Remark: The veh had commenced its repair at the time of inspection.

☒	☒
N/S	O/S

Bal. or Market Value:

IDAC Accident Rpt:

Consistent?: Yes or No

GIA / PR Seen:

Consistent?: Yes or No

Est. Repairs:

30 days

Res.: Yes or No

Lum Sum:

%

3 Val.: Yes or No

CA / REV / REP. / 24 HRS

Date:

Person Contacted:

Vehicle: IN / OUT

Date / Time

Action / Instruction

22/2

Recommend 716ers, likely to have a lot of supplementary.

23/02/22 @ 11.18am revert to CTT via Merimen. (beyond economical for repair due to repairer declare that SMQ 626B is beyond economical for repair due to forseen further supplementary or serious damages.)

14/04/22 Submit Total Loss Report as mentioned by officer.

Date/Time, File Pass to?

☐

: Prell. Report

1) 14/04 Typist

☐

: Final Report

Date/Time, File Return to?

2)

Days Of Repair:

Resurvey No. of Trip:

Survey Fee:

Transportation:

S + RS. SI

Fees

Others

TOTAL

Add Fee:

☐

Site Insp (\$

☐

Interview (\$

☐

Tech Invs (\$

☐

Weekend (\$

Report Format: MER-OD-T/L

Lump Sum / I.B.I. (\$

Date of Accident: 27.12.2021
Make & Model: VOLKSWAGEN CADDY
Chassis No: WV1ZZZ2KZLX024273

Ding Auto Pte Ltd (Co.Reg.No:201311788Z)176 Sin Ming Drive #04-06, Sin Ming Autocare
Singapore 575721

Tel: 64521208 Fax: 64520614 Email: ding@dingauto.sg;kenneth.ding@dingauto.sg

INSURER: **China Taiping Insurance (Singapore) Pte. Ltd. (HQ)****PARTICULARS OF CLAIM**

Claim Type:	OD (Own Damage)	Ref. No:	
Policy No:	DMHCSNW00002272101	Date of Loss:	10/02/2021
Vehicle Reg. No.:	SMQ626B	Driveable?	
Driver Age/Info:	/ MALE	Party At Fault:	UNKNOWN
TP Injury Involved?	NO	Third Party Involved?	YES
Insured/Claimant:	VIDA & PARTNER PTE LTD		
Driver:	CHIA SWEE HUAT		
Make/Model:	MERCEDES-BENZ E220D SE, 2.0 (A)	Vehicle Reg. Date:	29/10/2019
Vehicle Colour:	Black		
Engine No:	65492080381198	Chassis No:	WDD2130042A620808
Odometer:	0 KM		
Paint Type:			
Total Loss?	YES		
Est. Duration of Repair (day)	21		
Present Location:	DING AUTO PTE LTD (HQ)		

Not Archived
11 Rep &
Repair After Paint
Ex 812501

COST OF CLAIMS**Amount**

Parts	79,573.00
Miscellaneous Items	0.00
Labour	3,166.80
Paintwork Labour	403.54
Towing	0.00

Gross Total (\$\$)	83,143.34
+ GST 7.00% (\$\$)	5,820.03
Nett Amount (\$\$)	88,963.37

This claim is handled by: DING SING HUI, KENNETHGenerated using **Merimen e-Claims Internet Estimation & Adjusting System**

LKK Auto Consultants hence notify
the Repairer of the following:

- To resurvey before/after spray painting
- To display damaged part(s) during resurvey
- Parts prices are subject to confirmation
- Third party survey is on a "Without Prejudice" basis
- No illegal modification(s) is allowed
- Supplementary item(s) must be resurveyed and is subject to final approval from Insurance Company

Acknowledged by Repairer

Signature:

Date:

Vehicle Condition


Vehicle Status

Pre-Accident Damage:

Date of Inspection:

Damage Areas

All ☐
Underbody ☐

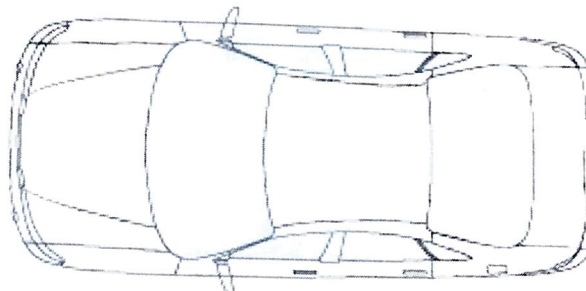

Tyres Condition

Tyre Brand	Tread (Left Middle), mm	Tread (Left Outer), mm	Tread (Left Inner), mm	Tread (Right Inner), mm	Tread (Right Outer), mm	Tread (Right Middle), mm	Condition
------------	----------------------------	---------------------------	---------------------------	----------------------------	----------------------------	-----------------------------	-----------

Spare Tyre Brand	Tread (Spare), mm
------------------	-------------------

Labour

Code	Description	Time Base 10 WU/h	Price = 42.00 SGD/h	
			WU	Price SGD
54-1011 01	SHORT TEST INCLUDES: CONNECT + DISCONNECT STAR DIAGNOSIS, PRINT DATA, DELETE ERROR MEMORY		3.0	12.60
54-7989 01	R + R BATTERY EARTH CABLE (WHEN DISCONNECTING ELECTRIC PLUG AND SOCKET CONNECTIONS)		3.0	12.60
54-0650 01	MAIN BOARD MAINTAINED (FOR CHECK AND DIAGNOSIS WORK)		1.0	4.20
61-1079 01	RENEW COMPL LWR ENGINE COMPARTMENT COVER		6.0	25.20
60-1240 02	R + R ENGINE, G-BOX, FRT AXLE, RR AXLE, PARTS AS PRESCRIBED IN INCLUDING TEXT		115.0	483.00
88-1105 01	DIS + ASS FRONT BUMPER (BUMPER REMOVED)		4.0	16.80
82-4810 01	AFTER CHECK: RENEW PARTS IF NECESSARY RENEW BOTH HEADLAMPS INCLUDES: FRONT BUMPER REMOVE AND REFIT		11.0	46.20

Code	Description	WU	Price SGD
88-2503 01	NOT INCLUDED: ADJUST HEADLAMP		
88-2508 01	R + R BONNET		
60-1332 01	RENEW BONNET (REMOVED)	9.0	37.80
	ATTACHED PARTS IN ENGINE BAY TO RENEW	6.0	25.20
62-1320 01	THE FRONT CENTRE STIFFENING R + R	7.0	29.40
NO NUMBER	R + R FRONT MODULE		
62-1605 01	R + R FIRE WALL INSULATION	11.0	46.20
	RENEW L/FRONT WALL HALF	9.0	37.80
62-1606 01	(WHEELHOUSE AND A-PILLAR REMOVED)	96.0	403.20
	RENEW R/FRONT WALL HALF		
	(WHEELHOUSE AND A-PILLAR REMOVED)	79.0	331.80
67-1700 01	RENEW FRONT SCREEN		
68-4605 01	R + R INSTRUMENT PANEL	26.0	109.20
68-4635 01	RENEW INSTRUMENT PANEL (REMOVED)	27.0	113.40
27-2110 01	DETACH + REFIT GEARBOX	4.0	16.80
	(ENGINE AND GEARBOX REMOVED)	12.0	50.40
01-4270 02	MOUNT REMOVED ENGINE IN ASSEMBLY STAND		
	(DRIVE END STRIPPED)	4.0	16.80
NO NUMBER	DIS-/ASSEMBLE ENGINE (CYL HEAD REMOVED)		
5765 02	R + R CYLINDER HEAD	45.0	189.00
20-3865 01)	R + R RADIATOR	83.0	348.60
09-6935 01)	R + R LOW-TEMPERATURE COOLER (ADD)	7.0	29.40
27-4020 01	DIS/ASS AUTOMATIC GEARBOX	2.0	8.40
	(GEARBOX REMOVED)	82.0	344.40
33-1050 01	R + R FRONT AXLE CARRIER	40.0	168.00
33-1252 ZAX	RENEW FRONT AXLE SUPPORT (REMOVED)	1.0	4.20
32-1955 01)	R + R L/F STRUT	6.0	25.20
32-1960 01)	R + R R/F STRUT	6.0	25.20
32-1908 01)	DISS/ASS L/F SUSPENSION STRUT REMOVED	3.0	12.60
32-1914 01)	DISS/ASS R/F SUSPENSION STRUT	3.0	12.60
32-1920 01)	DIS + ASS FRONT SPRING STRUT/S (REMOVED)	2.0	8.40
20-1190 01	ADDITION TO COOLING SYSTEM DRAIN /REFILL	3.0	12.60
	(VEHICLE WITH SEPARATE LOW TEMPERATURE-WATER CYCLE)		
83-1762 01	AIR-CONDITIONING SYSTEM DRAIN FLUID, EXHAUST, REFILL, PRESSURE TEST (FOR ALL WORK ON THE SYSTEM)	6.0	25.20
83-0640 01	CHECK AIR COND	1.0	4.20
1110 01	ADJUST HEADLAMPS	3.0	12.60
40-6500 01	ALIGN VEHICLE	8.0	33.60
	INCLUDES: ALIGN FRONT AND REAR TOE AND CAMBER,		
	CHECK FRONT AND REAR VEHICLE LEVEL		
9831	ENGINE CHECK	10.0*	42.00
9835	GEARBOX CHECK	10.0*	42.00
Labour Cost		Hrs	WU
Panel / Mechanical Labour		74.60	746.0
Alignment			
Measuring Work		0.80	8.0
Total of Labour			3,166.80

Paint

Paint Work

Code**Description - MF**

Time Basis 10 WU/h

		WU	Price SGD
98-1731 01	FRONT BUMPER TRIM PAINTING	8.0	33.60
98-2805 01	BONNET PAINTING STAGE I-M	26.0	109.20
LE 1321	L/FIREWALL PAINTING STAGE I-J	4.0	16.80
LE 1322	R/FIREWALL PAINTING STAGE I-J	4.0	16.80
98-1340 01	PREPARATION WORK FOR TWO COAT PAINTING OF FITTED BODY PARTS	14.0	58.80

Total Paint

Hrs 5.60 WU 56.0 Price SGD 235.20

Material Cost - Paint

Inner Part Painting

Price SGD

New Part Painting (Bold)

22.00

Material-constant Metal

132.87

Total

13.47

168.34

Spare Parts*'B' Part*

Code	Description	Part Number	Part Source	prices as at 2015-06-01	Price SGD
0471	BONNET	213 880 0357	Original	B	2,015.00
0481	CTR BONNET INSULAT	213 682 0026	Original	✓	190.00
8780	CTR LWR ENGINE CVR	213 520 0800	Original	✓	350.00
7920	ENGINE BLOCK	654 010 7410	Original	✓	30,000.00
1000	ENGINE ECU	ENGINE ECU	Original	✓	2,500.00
1341	ENGINE FIREW INSULAT	213 682 8301	Original	✓	2,400.00
1001	ENGINE WIRING HARNE	ENGINEWIRE HARN	Original	✓	4,000.00
7789	FAN UNIT	099 906 1800	Original	✓	1,465.00
7011	FRONT AXLE SUPPORT	205 628 0057	Original	✓	765.00
0283	FRONT BUMPER TRIM	213 885 0038	9999 Original	✓	1,125.00
0930	FRONT MODULE CPL	213 620 6300	Original	✓	1,090.00
57	FRONT NUMBER PLATE	KNPL3	Original	✓	35.00
0349	FRT/CTR IMPACT DAMP	213 885 0237	Original	✓	65.00
0335	FRT CTR BUMPER CARR	213 885 1265	Original	✓	65.00
8779	FRT ENGINE COVER	213 520 0200	Original	✓	250.00
0260	FRT NO PLATE BRKT	213 880 0044	Original	✓	50.00
0258	FRT NO PLATE REINF	KNPL0	Original	✓	35.00
1413	FRT SCREEN MNTG KIT	USE SINGLE PARTS			
8863	GEARBOX HOUSING	725 271 7600	Original		18,000.00
0405	GRILLE	213 880 8602	Original	✓	168.00
1002	HEADLAM MODU LH	HEADLAM MODU	Original	✓	590.00
		LH			
1003	HEADLAM MODU RH	HEADLAM MODU	Original	✓	590.00
		RH			
4331	INSTRUMENT PANEL	213 680 9504	Original		3,690.00
		9K00			
1113	L/2-COMPONENT GLUE	012 989 1771 09			0.00
1321	L/FIREWALL	205 620 0501	Original		1,200.00

Code	Description	Part Number	Part Source	Price SGD	
7087	L/FR SHOCK ABSORBER	213 320 3530	Original	330.00	✓
0561	LEFT HEADLAMP ASSY	213 820 2361	Original	1,250.00	✓
7762	LOW TEMP RADIATOR	099 500 2003	Original	1,090.00	✓
8782	LWR RR ENGINE COVER	213 520 1600	Original	290.00	✓
1114	R/2-COMPONENT GLUE	012 989 1771 09		0.00	
1322	R/FIREWALL	205 620 0601	Original	1,200.00	✓
7088	R/FR SHOCK ABSORBER	213 320 3530	Original	330.00	✓
7761	RADIATOR	099 500 7303	Original	1,050.00	✓
7753	RADIATOR AIR GUIDE	213 505 0030	Original	845.00	✓
0562	RIGHT HEADLAMP ASSY	213 820 2461	Original	1,250.00	✓
1441	WASHER JET COVERS	205 869 0007	Original	400.00	✓
1401	WINDSCREEN	213 670 0702	Original	900.00	✓
1411	WINDSCREEN REP KIT	000 989 4905	Original	0.00	✓
1416	WINDSCREEN SEAL	000 987 4866	Original	0.00	✓
f: OEM Parts				0.00	
n: Non-OEM Parts				79,573.00	
u: Used parts					
Savings					
Subtotal					
Total				79,573.00	

Final Calculation

	SGD	SGD
Parts		
Total Parts	79,573.00	79,573.00
Labour Time Base 10 WU/h		
Total 746.0 WU X 42.00 SGD/h	3,133.20	
Alignment		
Measuring Work	33.60	
Total of Labour		3,166.80
Paint Work Time Base 10 WU/h		
Labour Cost 56.0 WU X 42.00 SGD/h	235.20	
Material Cost	168.34	
Total Paint Including Material		403.54
Repair Cost Excludes GST		83,143.34
GST (+7.0%)		5,820.03
Repair Cost Included GST		88,963.37

Comments

* - USER SUPPLIED DATA
 NN - NO MANUFACTURERS CODE EXISTS
) - WU PARTIAL INCL IN OTHER POSITIONS

Assessment Note

No assessment notes entered.

SINGAPORE ACCIDENT STATEMENT

IMPORTANT NOTICE

1. Please report correctly the details of the accident to speed up the claims process.
2. This Form must be completed by the Policyholder and/or the Authorised Driver.
3. Information provided must be as truthful and accurate as possible. Any wilful misrepresentation or withholding of material facts may allow insurance companies to repudiate policy liability.
4. The issue and acceptance of this Form by insurance companies is not an admission of policy liability on the part of the insurance companies.
5. Any false reporting may be referred to the Police for investigation.
6. This report will be forwarded by the insurers of the GIA Records Management Centre established by the General Insurance Association of Singapore (GIA) for archiving and that copies of this report will, for a fee, be made available upon application by interested parties.
7. By the lodgement of this report to the insurers, you hereby consent to the archiving of this report at the centre and to copies of the report being made available aforesaid.

ACCIDENT STATEMENT

Date of Submission 11/02/2022 15:21 (SGT)
Date of Accident 10/02/2022 14:25 (SGT)
Exact Location of Accident N Canal Rd, Singapore
Additional Location Information 39 NORTH CANAL NORTH ROAD TOWARD SOUTH CANAL ROAD
Country, State of Loss Singapore

DETAILS OF OWN VEHICLE

Vehicle Registration Number SMQ626B

INSURED POLICYHOLDER

Is company? Yes
Name Of Registered Owner VIDA & PARTNER PTE LTD
Company Reg No 2XXXX475W
Email Address VIDAPARTNERS.SG@GMAIL.COM
Mobile Phone No (Phone) +65-93366492
Alternative Phone No (Home) +65-90040848

VEHICLE PARTICULARS

Manufacturer Mercedes
Model E220d
Variant E220 DIESEL
Exact purpose for which vehicle was being used at time of accident Private use
Are you claiming under your own insurance policy for repair to your vehicle? Yes
Vehicle Category Private car
Transmission Auto
CC 2200

INSURANCE COMPANY

Name of Insurance Company China Taiping Insurance (Singapore) Pte. Ltd.
Type of Coverage Comprehensive
Fleet Policy No
Policy Number DMHCSNW00002272101
Cover Note Number DMHCSNW00002272101

> Back to OneMotoring

Enquire PARF/COE Rebate for Registered Vehicle

Owner ID Type:	Company
Owner ID:	751W
Vehicle No.:	SMQ626B
Vehicle to be Exported:	Yes
Intended Deregistration Date:	11 Feb 2022
Vehicle Make:	MERCEDES BENZ
Vehicle Model:	E220D SE AUTO
Primary Colour:	Black
Secondary Colour:	Grey
Manufacturing Year:	2019
Engine No.:	65492080381198
Chassis No.:	WDD2130042A620808
Maximum Power Output:	143.0 kW (191 bhp)
Open Market Value:	\$53,449.00
Original Registration Date:	29 Oct 2019
First Registration Date:	29 Oct 2019
Transfer Count:	0
Actual ARF Paid:	\$68,209.00
PARF Eligibility:	Yes
PARF Eligibility Expiry Date:	28 Oct 2029
PARF Rebate Amount:	\$51,156.00
COE Expiry Date:	28 Oct 2029
COE Category:	B - Car above 1600cc or 97kW (130bhp)
COE Period(Years):	10
QP Paid:	\$41,361.00
COE Rebate Amount:	\$31,899.00
Total Rebate Amount:	\$83,055.00

The information contained herein is correct as at 11 Feb 2022

OK