

(08/11/13) wef

ASS. REC. BY: Marcus

REF:

CS/SM022001707/4vf3**ASSIGNMENT**

From: _____ Date: _____

Estimated Cost: _____

OD / TP / WS / TP RES / OD RES / EVA / INV / MV

To Inspect Vehicle No: SJH/9688Xat Workshop m/s RE

of _____

Insured: XEBSU

Policy No. _____

Claims No. CMTD2200681/SYH

Sum Insured: _____

Excess: _____

(Client's Record)

Make of Veh: _____

(Policy Condition)

Remark: The veh had commenced its repair at the time of inspection.

N/S	O/S

Bal. or Market Value: 55k.

IDAC Accident Rpt: _____ Consistent?: Yes or No

GIA / PR Seen: _____ Consistent?: Yes or No

Est. Repairs: 6 days Res.: Yes or NoLum Sum: 20 % 3 Val.: Yes or No

CA / REV / REP. / 24 HRS

Vehicle: IN / OUTDate: _____ Person Contacted: LTAS36740Date / Time Action / Instruction Rep 17k.
MTM \$ 18260inner from board \$1675.20
hy bearing \$ 1277.2021/3/22 1/5 \$ 13,500 informed Alen. (red 19,744.05, 59%)Veh No: SJH/9688X Yr Regn: 07/02/14Type: M. Car / M. Cycle / Bus / Van / Lorry / Taxi / Prime Mover /Truck / Trailer or CAMake: Lexus ES300h c.c. 2494Colour: Brown A/C: Insured / Std / NI / NASp. Reading: 120749 T/Radio: Insured / Std / NI / NA

Eng/No: _____

C/No: JTHBW166X02053162Gen. Cond: Good / Fair / Poor / BurntSteering: In order / Jammed / Leaked / Burnt orBrake: In order / Jammed / Leaked / Burnt orModi: Nil / S/Rim / STD A/Rim orTyre Size: F:R: 215/55-R17

BS / DUN / EXNOVA / GY / FS / LIZA / MIC / OHTSU / PIR / SUMI /

TOYO / YOKO or habilead

Front

Rear

R/Bal. 7 mm R/Bal. 7 mmL/Bal. 7 mm L/Bal. 7 mmD.O.A. 22/2/22 D.O.I. 22/2/22

Survey held at _____

Des. of Damages: Frt / Rear / O/S / N/S / U/C / Rooftop orThe U/C / Chassis frame / Body Structure affected due to collision.

Date/Time, File Pass to?

☐ : Preli. ReportDays Of Repair: 6

1)

☐ : Final ReportResurvey No. of Trip: 2

Date/Time, File Return to?

Survey Fee:

2) 22/3/22-typist

Add Fee:

☐ : Site Insp (\$) S + RS \$☐ : Interview (\$) Photos☐ : Tech. Invs (\$) Others☐ : Weekend (\$)Report Format: TPLump Sum / L.B. (\$ 13,500)

TOTAL

> Back to OneMotoring

Enquire PARF/COE Rebate for Registered Vehicle

Vehicle Owner Particulars	
Owner ID Type:	Singapore NRIC
Owner ID:	581Z
Vehicle Details	
Vehicle No.:	SJH9688X
Vehicle to be Exported:	No
Intended Deregistration Date:	22 Feb 2022
Vehicle Make:	TOYOTA
Vehicle Model:	LEXUS ES300H CVT
Primary Colour:	Brown
Manufacturing Year:	2014
Engine No.:	2AR1028959
Chassis No.:	JTHBW1GGX02053162
Maximum Power Output:	151.0 kW (202 bhp)
Open Market Value:	\$42,006.00
Original Registration Date:	07 Feb 2014
First Registration Date:	07 Feb 2014
Transfer Count:	2
Actual ARF Paid:	\$40,809.00 <i>20404</i>
Intended PARF Rebate Details	
PARF Eligibility:	Yes
PARF Eligibility Expiry Date:	06 Feb 2024
PARF Rebate Amount:	\$22,444.00
Intended COE Rebate Details	
COE Expiry Date:	06 Feb 2024
COE Category:	B - Car (1601cc & above)
COE Period(Years):	10
QP Paid:	\$73,010.00
COE Rebate Amount:	\$14,296.00
Total Rebate Amount:	\$36,740.00

The information contained herein is correct as at 22 Feb 2022

OK

Car Accessories & Products

Pimping up your ride? Browse thousands of car products for even more choices!
Read honest reviews by our trusted consumers before you make a purchase.

Post an Advertisement
Sell it yourself! Advertise it at just
\$68 until it's SOLD!

[Post an Ad](#) [Advertiser Login](#) [Ways of Selling](#)

Toyota Land Cruiser Prado LC90 3.4 8 Seater (LC95)



Full Spec, Sunroof, 3 Row
Aircon, V6 Engine, Low Annual
Mileage, Rare Model.
Direct Owner StarAd

Lake View Credit Pte Ltd

view our cars

- > Low prices guaranteed
- > Specialist in Japanese cars
- > Easy loan approval
- > All terms are negotiable

Browse by Category

Sort by Date Posted 20 results/page

3 vehicles



Lexus ES300

Advanced Search Search

	Make	Model	Price	Depreciation	Reg Date	Eng Cap	Mileage	Veh Type	Status
Search Selection	Lexus ES300		Any	Any	2014	Any	Any	Any	Available
	Lexus ES Hybrid ES300h Luxury		\$69,500	\$18,120 /yr	26-Sep-2014	2,494 cc	166,000 km	Luxury	Available
	Fuel Type: Petrol-Electric Driven By A Family Man, Intend To Get An SUV. View By Appointment. Cash Deal Preferred.								DIRECT OWNER
	Posted: 19-Feb-2022 Tags: 2014 Lexus ES, Lexus ES, Lexus, ES								
	Lexus ES Hybrid ES300h		\$57,888	\$17,910 /yr	28-Mar-2014	2,494 cc	123,500 km	Luxury	Available
	Fuel Type: Petrol-Electric Full Agent Maintained From Day 1, Hybrid Battery Replace On 2020. Upgraded 18 " Sports Rim, Original Paintwork, 100% Accident Free,...								DIRECT OWNER
	Posted: 19-Feb-2022 Tags: 2014 Lexus ES, Lexus ES, Lexus, ES								
	Lexus ES Hybrid ES300h Luxury		\$68,800	\$18,740 /yr	12-Aug-2014	2,494 cc	128,000 km	Luxury	Available
	Fuel Type: Petrol-Electric Latest Arrival! Agent Serviced By Careful Owner With Records! Hybrid Battery Replaced On 27/03/2020. Luxury Model, Huge Petrol Savin...								
	Thong Lee Trading Pte Ltd								
	Posted: 17-Feb-2022 Tags: 2014 Lexus ES, Lexus ES, Lexus, ES								

Save this search criteria, to get email alerts whenever a match is found.

Make Model Price Depreciation Reg Date Eng Cap Mileage Veh Type Status

For old advertisements, view [Expired ads](#)

20 results/page

Buy / Rent Cars

[New Cars For Sale](#)
[Used Cars For Sale](#)
[Cars For Rent](#)

Sell Your Car

[Post an Ad](#)
[Sell by Bidding](#)
[Sell by Consignment](#)

Aftermarket

[Workshop Directory](#)
[Aftermarket Products](#)

Articles

[Car Reviews](#)
[Car Advice](#)
[Car News](#)
[Car Features](#)

General

[About Us](#)
[Contact Us](#)
[Careers](#)
[Site Map](#)

Resources

[COE Prices](#)
[Car Loan Calculators](#)
[Car Forum](#)
[Car Insurance](#)
[Car Valuation](#)
[COE Renewal](#)

[Used Car Warranty](#)
[Bidded Carplates](#)
[Carpark Rates](#)

Follow sgCarMart.com



[Compare](#)

SINGAPORE ACCIDENT STATEMENT

IMPORTANT NOTICE

1. Please report correctly the details of the accident to speed up the claims process.
2. This Form must be completed by the Policyholder and/or the Authorised Driver
3. Information provided must be as truthful and accurate as possible. Any wilful misrepresentation or withholding of material facts may allow insurance companies to repudiate policy liability.
4. The issue and acceptance of this Form by insurance companies is not an admission of policy liability on the part of the insurance companies.
5. Any false reporting may be referred to the Police for investigation.
6. This report will be forwarded by the insurers of the GIA Records Management Centre established by the General Insurance Association of Singapore (GIA) for archiving and that copies of this report will, for a fee, be made available upon application by interested parties.
7. By the lodgement of this report to the insurers, you hereby consent to the archiving of this report at the centre and to copies of the report being made available aforesaid.

ACCIDENT STATEMENT

Date of Submission	22/02/2022 15:50 (SGT)
Date of Accident	22/02/2022 11:38 (SGT)
Exact Location of Accident	Singapore
Additional Location Information	UPP PAYA LEBAR RD TWDS BARTLEY RD
Country/State of Loss	Singapore

DETAILS OF OWN VEHICLE

Vehicle Registration Number	SJH9688X
-----------------------------	----------

INSURED/POLICYHOLDER

Is company?	No
Name Of Registered Owner	WEE TIA SEN
NRIC No	SXXXX581Z
Email Address	LILYDUAN@GMAIL.COM
Mobile Phone No	(Phone) +65-91399685
Alternative Phone No	(Home) +65-91399685

VEHICLE PARTICULARS

Manufacturer	Lexus
Model	Es300h
Variant	-
Exact purpose for which vehicle was being used at time of accident	Private use
Are you claiming under your own insurance policy for repair to your vehicle?	No - Claiming third party
Vehicle Category	Private car
Transmission	Auto
CC	2500

INSURANCE COMPANY

Name of Insurance Company	NTUC Income Insurance Co-operative Ltd
Type of Coverage	Comprehensive
Fleet Policy	No
Policy Number	5095693338-04
Cover Note Number	-

DRIVER

Name of Driver	DUAN LIFANG LILY
NRIC No	SXXXX705C

Date Of Birth	05/08/1974
Occupation	Indoor
Date Of Driving Pass	08/12/2000
Driving experience	21 YEARS AND 2 MONTHS
Gender	Female
Mobile Number	(Phone) +65-91399685
Alt. Phone Number	-
Email Address	LILYDUAN@GMAIL.COM
Address	51 WARINGIN PARK
Address complement	-
Postcode	416356
Is the driver the policyholder?	No
If No, Relationship of the Driver with the Insured	Spouse
Does Driver Own Other Vehicles?	No
Vehicle Registration Number of Other Vehicle Owned by Driver	-
Insurance Company of Other Vehicle Owned by Driver	-

GENERAL INFORMATION OF THE ACCIDENT

Type of Accident	Collision - Change/cross lane
Weather Conditions	Clear
Road Surface	Dry

OTHER INFORMATION

Was any foreign vehicle involved in the accident?	No
Number of vehicles involved in the accident	2
Was anybody injured in the Accident?	Yes
Was any injured conveyed to hospital by ambulance?	No
Was any other vehicle or property damaged?	Yes
Number of Passengers (Including Driver)	1
Has the driver been approached by unknown person(s) soliciting/offering accident claims assistance?	No

DETAILS OF POLICE ACTION

Was the accident reported to the police?	No
Was notice of intended Prosecution given?	No
If yes, against whom?	-

CIRCUMSTANCES OF ACCIDENT

REFER TO ATTACHED

ATTACHMENT(S)

Are accident photos available for attachment?	Yes
Was there any video captured by Car Camera?	No
Was there any audio recorded?	No

DETAILS OF OTHER VEHICLE PROPERTY 1

Vehicle Registration Number	XE85U
Vehicle Manufacturer	-
Vehicle Model	-
Vehicle Variant	-
Vehicle Colour	-
Vehicle Category	Commercial vehicle
Name of Driver	-
Contact Number	-
Address	-
Address complement	-

Postcode -
Insurance Company Name -
Nature Of Damage -
Details of property damaged in accident -
No. Of Passenger (Including Driver) -

INJURED PERSONS DETAILS

INJURED 1

Name of injured person	DUAN LIFANG LILY
Gender	Female
Phone No	-
Address	-
Address Complement	-
Post Code	-
Approximate Age Years Old	-
Injuries Sustained	-
Injured person in which vehicle?	SJH9688X
Were seat belts worn?	Yes
Was this injured conveyed to hospital by ambulance?	No

SKETCH PLAN

IMPORTANT NOTICE

1. Please report correctly the details of the accident to speed up the claims process.
2. This Form must be completed by the Policyholder and/or the Authorised Driver.
3. Information provided must be as truthful and accurate as possible. Any willful misrepresentation or withholding of material facts may allow insurance companies to repudiate policy liability.
4. The issue and acceptance of this Form by insurance companies is not an admission of policy liability on the part of the insurance companies.
5. Any false reporting may be referred to the Police for investigation.
6. The report will be forwarded by the insurers of the GIA Records Management Centre established by the General Insurance Association of Singapore (GIA) for archiving and that copies of this report will for a fee be made available upon application by interested parties.
7. By the lodgement of this report to the insurers, you hereby consent to the archiving of this report at the centre and to copies of the report being made available aforesaid.
8. **Consent under the Personal Data Protection Act (PDPA)**
I understand, acknowledge, agree and consent that:
(a) My insurer, my workshop and the General Insurance Association of Singapore ("GIA") may/are permitted to collect, use, disclose and/or process my personal data/personal information set out in this form and any other personal information provided by me or possessed by my insurer (collectively the "Personal Information") and disclose and transfer such Personal Information to all insurer(s) who have insured vehicle(s) involved in this accident (all insurer(s) who have insured vehicle(s) involved in this accident shall be collectively referred to as the "Insurers"), the Insurers' lawyers/law firms, the Monetary Authority of Singapore and any relevant government agency/authority (such as the police), for the purpose(s) of:
(i) processing, handling and/or dealing with my claims including the settlement of the claims and any necessary investigations relating to the claims;
(ii) investigating the accident and/or my claims;
(iii) carrying out and/or dealing with my instructions or responding to any enquiries by me;
(iv) administering my claims (including the mailing of correspondence, statements, invoices, reports or notices to me, which could involve disclosure of certain personal data about me to bring about delivery of the same as well as on the external cover of envelopes/mail packages); and/or
(v) complying with applicable law in administering, processing, handling and/or dealing with my claims.
(collectively the "Purposes")
(b) all insurer(s) who have insured vehicle(s) involved in this accident and the Insurers' lawyers/law firms, may/are permitted to collect, use, disclose and/or process my Personal Information for one or more of the above Purposes; and
(c) my Personal Information may/can be disclosed by any of the Insurers and/or GIA to their third party service providers or agents (including their lawyers/law firms), which may be sited outside of Singapore, for one or more of the above Purposes.


SHUYI

Policyholder's Signature / Date & Time

Driver's Signature (If driver is not the policyholder) / Date & Time

Witnessed by Reporting Centre Personnel

Sketch Plan

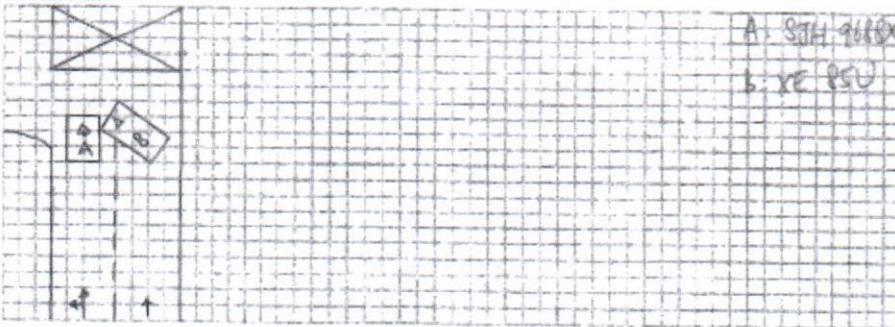

Describe Circumstances of the Accident

On 22/02/2022 at about 11:38AM I was travelling along Upper
Mays Lobar Rd towards Bartley Rd. I was travelling straight.
Suddenly, vehicle B turned left and hit the right ^{hand} portion of my
vehicle.

Declaration

We declare the foregoing particulars are true in every respect.

SHUYI

Policyholder's Signature / Date & Time

Driver's Signature (If driver is not the policyholder) / Date & Time

Witnessed by Reporting Centre
Personnel

MotorMed Pte Ltd

8 Kaki Bukit Ave 4 #02-14/44

Premier @ Kaki Bukit

Singapore 415875

Phone Number: 69777077

Fax Number: 69777080

Customer:			Date: 25/2/2022 4:55 PM			
Company: KIM CHWEE			VIN: SJH9688X			
License NO:			Technician:			
Odometer:			Order NO:			
VEHICLE ALIGNMENT REPORT LEXUS, ES300h All Models, 13-18 (Customized)						
Primary Angles			Initial	Specifications Min. Max.		Final
Front	Caster	Left	----	2°10'	3°40'	----
		Right	----	2°10'	3°40'	----
	Camber	Left	-1°00'	-1°20'	0°10'	-1°00'
		Right	-1°00'	-1°20'	0°10'	-1°00'
	Toe	Left	0°06'	-0°05'	0°05'	0°03'
		Right	0°00'	-0°05'	0°05'	0°03'
Total		0°06'	-0°10'	0°10'	0°06'	
Rear	Camber	Left	-1°48'	-1°55'	-0°25'	-1°42'
		Right	-1°18'	-1°55'	-0°25'	-1°18'
	Toe	Left	-0°03'	0°02'	0°12'	0°03'
		Right	0°06'	0°02'	0°12'	0°06'
		Total	0°03'	0°03'	0°23'	0°09'
	Thrust Angle		0°05'	----		0°02'
Secondary Angles			Initial	Specifications Min. Max.		Final
SAI	Left	----	12°10'	12°10'	----	
	Right	----	12°10'	12°10'	----	
Included Angle	Left	----	----	----	----	
	Right	----	----	----	----	
Toe Out On Turns	Left	----	----	----	----	
	Right	----	----	----	----	
Max Turn Inside	Left	----	35°22'	39°22'	----	
	Right	----	35°22'	39°22'	----	
Toe Curve Change	Left	----	----	----	----	
	Right	----	----	----	----	
Setback	Front	-0.1"	----	----	-0.1"	
	Rear	-0.2"	----	----	-0.2"	
Track Width Diff.		0.8"			0.8"	
Wheel Base Diff.		0.2"			0.2"	
Front Ride Height	Left	----	4.8"	4.8"	----	
	Right	----	4.8"	4.8"	----	
Rear Ride Height	Left	----	1.8"	1.8"	----	
	Right	----	1.8"	1.8"	----	
Frame Angle						

X

MotorMed Pte Ltd

8 Kaki Bukit Ave 4 #02-14/44

Premier @ Kaki Bukit

Singapore 415875

Phone Number: 69777077

Fax Number: 69777080

Customer:			Date: 22/2/2022 3:46 PM			
Company: KIM CHWEE			VIN SJH9688X			
License NO:			Technician:			
Odometer:			Order NO:			
VEHICLE ALIGNMENT REPORT LEXUS, ES300h All Models, 13-18 (Customized)						
Primary Angles			Initial	Specifications Min. Max.		Final
Front	Caster	Left	----	2°10'	3°40'	----
		Right	----	2°10'	3°40'	----
	Camber	Left	-0°48'	-1°20'	0°10'	-0°48'
		Right	-0°36'	-1°20'	0°10'	-0°36'
	Toe	Left	-0°51'	-0°05'	0°05'	-0°51'
		Right	1°24'	-0°05'	0°05'	1°24'
Total		0°33'	-0°10'	0°10'	0°33'	
Rear	Camber	Left	-1°18'	-1°55'	-0°25'	-1°18'
		Right	-2°00'	-1°55'	-0°25'	-2°00'
	Toe	Left	0°00'	0°02'	0°12'	0°00'
		Right	-2°15'	0°02'	0°12'	-2°15'
		Total	-2°15'	0°03'	0°23'	-2°15'
	Thrust Angle		-1°07'	----		-1°07'
Secondary Angles			Initial	Specifications Min. Max.		Final
SAI	Left	----	12°10'	12°10'	----	
	Right	----	12°10'	12°10'	----	
Included Angle	Left	----	----	----	----	
	Right	----	----	----	----	
Toe Out On Turns	Left	----	----	----	----	
	Right	----	----	----	----	
Max Turn Inside	Left	----	35°22'	39°22'	----	
	Right	----	35°22'	39°22'	----	
Toe Curve Change	Left	----	----	----	----	
	Right	----	----	----	----	
Setback	Front	-0.0"	----	----	-0.0"	
	Rear	-0.1"	----	----	-0.1"	
Track Width Diff. Wheel Base Diff.		-1.4"			-1.4"	
		0.1"			0.1"	
Front Ride Height	Left	----	4.8"	4.8"	----	
	Right	----	4.8"	4.8"	----	
Rear Ride Height	Left	----	1.8"	1.8"	----	
	Right	----	1.8"	1.8"	----	
Frame Angle						----

Submit to us

Not Authorized
here
22/2/22
2/5 # 13,500 /
telephone After repair
6 days.

FASTECH AUTO PTE LTD

1 Kaki Bukit Ave 6 #01-48 Autobay

Singapore 417883

Tel No: 67452063/ 67467158 Fax No: 67458520

Tax Reg No : 200006262D

VEHICLE No: SJH 9688X

NETT ITEM

1PC	FRONT DOOR O/S	in/warp	1496.00	\$2,866.30	✓
1PC	FRONT DOOR OUTER HANDLE O/S	cut	290.00	\$325.50	✓
1PC	FRONT DOOR OUTER HANDLE INNER BRACKET O/S	n1		\$165.80	X
1PC	FRONT DOOR OUTER HANDLE KNOCK END O/S	cut	50.00	\$80.00	✓
1PC	FRONT DOOR INNER LOCK O/S	shorted / damaged	544.10	\$699.50	✓
1PC	FRONT DOOR INNER RUBBER O/S	ner	305.00	\$388.00	✓
1PC	FRONT DOOR FRAME BLACK GARNISH O/S	ner	115.00	\$128.00	✓
1PC	FRONT DOOR GLASS OUTER CHROME MOULDING O/S	ner	180.00	\$194.00	✓
1PC	FRONT DOOR GLASS REGULATOR O/S	n1		\$385.00	X
1PC	REAR DOOR O/S	3.05m	1273.50	\$2,845.20	✓
1PC	REAR DOOR OUTER HANDLE O/S	cut	290.00	\$325.50	✓
1PC	REAR DOOR OUTER HANDLE INNER BRACKET O/S	n1		\$165.80	X
1PC	REAR DOOR INNER LOCK O/S	shorted / damaged	544.10	\$699.50	✓
2PCS	REAR DOOR HINGES O/S @\$145.00	n1		\$290.00	X
1PC	REAR DOOR CHECKER O/S	n1		\$221.00	X
1PC	REAR DOOR GLASS OUTER CHROME MOULDING O/S	ner	180.00	\$194.00	✓
1PC	REAR DOOR GLASS REGULATOR O/S	cut	269.10	\$385.00	✓
1PC	REAR DOOR GLASS REGULATOR MOTOR O/S	SM/shorted		\$720.15	✓
1PC	REAR DOOR INNER RUBBER O/S	ner	305.00	\$388.00	✓
1PC	REAR DOOR INNER TRIM BOARD O/S	be torn		\$1,045.20	✓
1SET	REAR DOOR INNER TRIM BOARD CLIPS O/S	ner		\$60.00	✓
1PC	REAR DOOR FRAME BLACK GARNISH O/S	ner	115.00	\$128.00	✓
1PC	REAR DOOR 'HYBRID' EMBLEM O/S	ner	95.00	\$105.00	✓
1PC	CENTRE PILLAR O/S	R		\$845.00	X
1PC	ROCKER PANEL GARNISH O/S	warp / torn	945.00	\$1,050.00	✓
1SET	ROCKER PANEL GARNISH CLIPS O/S	ner		\$50.00	✓
1PC	ROCKER PANEL O/S	R		\$981.10	X
1PC	REAR FENDER O/S	3.05m	1608.60	\$2,215.30	✓
1PC	REAR FENDER UNDER COVER CLOTH O/S	torn	385.10	\$488.20	✓
1SET	REAR FENDER UNDER COVER CLOTH CLIPS O/S	ner		\$50.00	✓
1PC	REAR WINDSCREEN MOULDING	ner	148.50	\$198.10	✓
1PC	REAR BUMPER	0.15 / torn	1057.50	\$1,655.10	✓
1PC	REAR BUMPER SIDE RETAINER O/S	one	168.20	\$192.30	✓
1SET	REAR BUMPER CLIPS	ner		\$50.00	✓
1PC	TAILLAMP O/S	n1		\$945.20	X
1PC	REAR SHOCK ABSORBER O/S	cut	545.20	\$688.30	✓
1PC	REAR WHEEL HUB BEARING O/S	damaged		\$750.50	✓
1PC	REAR LOWER ARM O/S	n1		\$455.10	X
1PC	REAR TORSION BAR O/S	twi	395.10	\$412.10	✓
1PC	REAR KNUCKLE ARM O/S	cut/warp	645.10	\$788.30	✓
1PC	REAR SPORT RIM O/S	cut / cut	800 s/n	\$2,025.00	✓
				82664.05	800 s/n

\$26,644.05

S.NETT

1PC	REAR WINDSCREEN SEALANT	721	\$50.00	40
1PC	REAR WINDSCREEN INNER SEAL	721	\$50.00	40
1PC	REAR TYRE O/S	522	\$300.00	X
TO CHECK WIRING				\$80.00 20
TO DISMANTLE & REFIX REAR REVERSE SENSOR				\$80.00 60
TO DISMANTLE & REFIX REAR WINDSCREEN				\$150.00 120
TO DISMANTLE & REFIX REAR CUSHION UPHOLSTERY				\$120.00 80
TO DISMANTLE & REPLACED REAR UNDER CARRIAGE				\$300.00 120
TO DISMANTLE & REFIX BOTH O/S DOOR MECHANISM				\$180.00 120
TO RESET & DIAGNOSIS REPROGRAMME SYSTEM				\$180.00 50
TO CONDUCT WHEEL ALIGNMENT				\$150.00 100
TO SPRAY RUST PROOFING				\$180.00 90
TO CONDUCT CHASSIS ALIGNMENT				11 \$380.00 X
LABOUR FOR PANEL BEATING & REPLACED PARTS				\$2,200.00 1000
TO PUTTY & SPRAY PAINTING				\$2,200.00 1100
TOTAL			\$33,244.05	

LKK Auto Consultants hence notify the Repairer of the following:

- To resurvey before/after spray painting
- To display damaged part(s) during resurvey
- Parts prices are subject to confirmation
- Third party survey is on a "Without Prejudice" basis
- No illegal modification(s) is allowed
- Supplementary item(s) must be resurveyed and is subject to final approval from Insurance Company

Acknowledged by Repairer

Signature:

Date:

P-14676-68

102

P-13208-98

S-N- 880

L- 285-0

16938-98

202

13557