

VEHICLE APPRAISAL REPORT

Our Reference: **TP19-088112**
 Your Reference: **-**
 Vehicle Number: **SMD1720Z**

Date: 25-Sep-19

To: **COMFORTDELGRO RENT-A-CAR PTE LTD**
 C/o AE Auto Pte Ltd,
 160, Sin Ming Drive,
 Sin Ming Auto City #06-01,
 Singapore 575722

Assessment of Vehicle No: **SMD1720Z**
 Date of Accident: **4-Jun-19**
 Date of Inspection: **7-Jun-19**

We have carried out a physical assessment of **SMD1720Z** at M/s AE Auto Pte Ltd according to your instruction on **7-Jun-19** and are pleased to submit our report herewith.

DESCRIPTION & IDENTIFICATION OF VEHICLE

Reg No:	SMD1720Z	Make:	KIA
Reg date:	2018	Model:	SORENTO 2.2 (8AT)
Colour:	Grey	Engine No:	-
Type:	-	Chassis No:	KNAPH81BMJ5465576
Type of Claim:	-	Odometer No:	17756 km
Market Value:	-	Engine Cap.:	2199 cc

CONDITION OF VEHICLE AT THE TIME OF SURVEY (STATIC ONLY)

General Condition : Good	Steering : Serviceable	Engine Modification : NA
Paint work : Good	Handbrake : Serviceable	Pre-accident damage : NA
	Footbrake : Serviceable	

CONDITION OF TYRES

Front Left Size:	Yokohama 235/60 R18 40%	Front Right Size:	Yokohama 235/60 R18 40%
Rear Left Size:	Yokohama 235/60 R18 50%	Rear Right Size:	Yokohama 235/60 R18 50%

The above percentages represent the remaining life of the tyre treads

COST OF REPAIRS	Repairer's S\$	Adjuster's S\$	Difference S\$
Parts	8,116.24	8,116.24	0.00
Labour	3,700.00	3,150.00	550.00
Calculated Cost (S\$) :	11,816.24	11,266.24	550.00

Estimated Repair Period:

7 days


Repair Status:

Surveyed on a "Without Prejudice" basis.

Our Reference: TP19-088112
Your Reference: -
Vehicle Number: SMD1720Z

DESCRIPTION OF DAMAGE


At the time of inspection, this vehicle sustained damages to the **Rear portion**. Please see attached scheduled details.

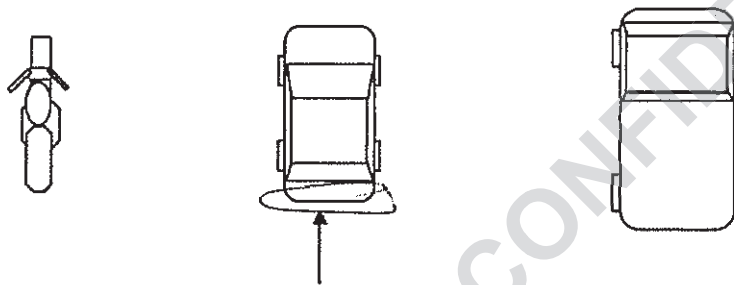

SPECIAL REMARKS

We have not authorised repair. Under normal circumstances, estimated **7 working days** are required to repair the vehicle.

We are pleased to advise that the inspection work was carried out accordingly, and hereby submit our Inspection Report and photographs.

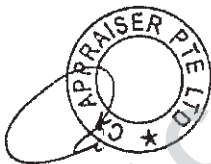

Ang Guea Kiang
Automotive Appraiser
MSAAA

Disclaimer

Pursuant to your instruction, we have **NOT AUTHORIZED** repair. The assessment was conducted on a "**Without Prejudice**" basis. If we are not notified of anything to the contrary within **14 days** from the date hereof, this report shall be treated as correct.

This report is intended for the exclusive use of the address solely in relation to the loss occurrence in which the assessed vehicle is involved. No liability or responsibility whatsoever shall be held by **CA APPRAISER PTE LTD** for any reliance on this report by any third party.

Our Reference : TP19-088112

Your Reference : -

Vehicle Number : SMD1720Z

S/N	QTY	DESCRIPTION	CONDITION	REPAIRER'S ESTIMATE (S\$)		OUR ASSESSMENT (S\$)	
<u>PARTS (LIST ITEMS)</u>							
1	1	BOOTLID	BUCKLED	1,931.60		1,931.60	
2	1	BOOTLID EMBLEM	NECESSARY	52.50		52.50	
3	1	BOOTLID EMBLEM SORENTO	NECESSARY	46.80		46.80	
4	1	BOOTLID EMBLEM C&C	NECESSARY	29.60		29.60	
5	1	BOOTLID LOCK	BENT	406.50		406.50	
6	1	BOOTLID WEATHERSTRIP	DEFORMED	121.50		121.50	
7	1	REAR WINDSCREEN MOULDING	NECESSARY	162.30		162.30	
8	1	REAR WINDSCREEN INNER SEAL	NECESSARY	80.00		80.00	
9	1	REAR BUMPER	CUT/DEFORMED	1,452.50		1,452.50	
10	1	REAR BUMPER LOWER (BLACK)	CUT/DEFORMED	652.30		652.30	
11	1	REAR BUMPER DIFFUSER	DEFORMED	520.60		520.60	
12	1	REAR BUMPER REINFORCEMENT	BENT	460.20		460.20	
13	1SET	REAR BUMPER CLIP	NECESSARY	60.00		60.00	
14	2	REAR BUMPER SIDE RETAINER @\$86	DISTORTED	172.60		172.60	
15	1	REAR BUMPER LOWER SPOILER	DEFORMED	520.60		520.60	
16	1	REAR END PANEL OUTER	DENTED	952.47		952.47	
17	1	REAR BUMPER LAMP LH	CRACKED	312.60		312.60	
18	1	REAR BUMPER LAMP GARNISH LH	CRACKED	85.60		85.60	
19	1SET	REVERSE SENSOR W/WIRE HARNES	MALFUNCTION	820.00		820.00	
					8,840.27		8,840.27
Less Discount :				10%	884.03	10%	884.03
Parts Total :					7,956.24		7,956.24
<u>SPECIAL NETT ITEMS</u>							
20	1	REAR WINDSCREEN SEALANT	NECESSARY	80.00		80.00	
21	1	REAR END PANEL JOINT SEALANT	NECESSARY	80.00		80.00	
Special Nett Total:				160.00		160.00	
Total Parts:				8,116.24		8,116.24	

Our Reference : TP19-088112

Your Reference :-

Vehicle Number : SMD1720Z

S/N	DESCRIPTION	REPAIRER'S ESTIMATE(S\$)	OUR ASSESSMENT(S\$)
	<u>LABOUR & MISC CHARGES</u>		
1	To remove & dismantle damaged parts to cut and chisel out attachment parts. To knock, straighten out dents where necessary to weld, refix, readjust & reshape same.	1,400.00	1,200.00
2	To respray painting on all affected parts, to supply paint material i.e. sand paper, rubbing compound, thinner, paint, lacquer etc.	1,600.00	1,400.00
3	To check wirings and lightings.	100.00	80.00
4	To remove and replace reverse sensors.	120.00	80.00
5	To remove-refit rear boot compartment upholstery, carpet, garnish etc, in order to facilitate repair.	150.00	120.00
6	To supply and apply rust proofing treatment to affected panel.	150.00	120.00
7	To remove and refix rear windscreen glass.	180.00	150.00
	Labour Total :	3,700.00	3,150.00
	TOTAL (PARTS & LABOUR) :	11,816.24	11,266.24

Adjustment / Recommendations

Note : (For Part By Part Repair)

The workshop has agreed to undertake the repair at our adjusted amount of : **\$11,266.24**

Under normal circumstances, the repair period would be about 7 working days.

**POLIS DIRAJA MALAYSIA**
REPOT POLIS

Balai : TRAFIK JOHOR BAHRU(S) Pegawai Penyiasat : R136100
Daerah : J/BAHRU SELATAN
Kontinjen : JOHOR
No Repot : TRAFIK JOHOR BAHRU(S)/014281/19
Tarikh : 04/06/2019
Waktu : 1556 PM
Bahasa Diterima : B. Malaysia

Butir-butir Penerima Repot

Nama : MASKOR BIN AHMAD SAYUTI No Personel : R130284 Pangkat : KPL
Butir-butir Jurubahasa (Jika Ada)
Nama : --- No K/P (Baru) : --- No Polis/Tentera : ---
No Paspot : --- Bahasa Asal : ---
Alamat : ---

Butir-butir Pengadu

Nama : WONG HEUNG MING
No K/P (Baru) : --- No Polis/Tentera : --- No Paspot : S7389147G
No Sijil Beranak : ---
Jantina : Lelaki Tarikh Lahir : 30/06/1973 Umur : 45 tahun 11 bulan
Keturunan : Melayu Warganegara : Malaysia
Pekerjaan : SWASTA
Alamat Tempat Tinggal : APT BLK 5 WOODLANDS DRIVE 72#12-11 SINGAPORE 738091, 738091
Alamat Ibu/Bapa : ---
Alamat Pejabat : ---
No Tel (Rumah) : --- No Tel (Pejabat) : --- No Tel (HP) : 6598377690

Pengadu Menyatakan:-

PADA 04/06/2019 JAM L/KURANG 1530HRS SAYA MEMANDU M/KAR NO SMD1720Z DARI SINGAPORE HENDAK KE KEMPAS.SEMASA SAMPAI DI KM 6. JLN JOHOR BAHRU KOTA TINGGI PADA MASA ITU SAYA SEDANG BERHENTI DI T/LIGHT MERAH TIBA -TIBA SEBUAH M/KAR NO JKN1505 YANG DATANG DARI BELAKANG TELAH MELANGGAR M/KAR SAYA.SAYA TAK CEDERA.KEROSAKKN M/KAR SAYA; BUMPER BELAKANG .SEKIAN LAPORAN SAYA.

Tandatangan Pengadu:

Tandatangan Jurubahasa(Jika ada) :

Tandatangan Penerima Repot:

ID Pencetak | Tarikh @ Masa Cetak

REJ. SALINAN REPORT
TRAFIK JOHOR BAHRU (S)
R5140818 | 22/07/2019 02:20:35 PM
(PANGKAT BENAR)
(PANGKAT UNTUK TUNTUTAN SIVIL)

KETUA TRAFIK DAERAH JOHOR BAHRU (S) JOHOR
TIDAK BOLEH DIGUNAKAN UNTUK TUJUAN PERRICARAAN

Register New Vehicle (Acknowledgement)

Vehicle Particulars


Vehicle No.:	SMD1720Z	14 : 1128621512
Vehicle Type:	R11 - Private Hire (Self-Drive) Station Wagon/Jeep/Land Rover	Vehicle Scheme: Normal
Vehicle Attachment 1:	With Sun Roof	
Vehicle Attachment 2:	-	Vehicle Attachment 3: -
Vehicle Make:	KIA	Vehicle Model: SORENTO 2.2(8AT) CRDI 2WD S/R
Chassis No.:	KNAPH81BMJ5465576	Engine No.: D4HBJH373795
Motor No.:	-	Trailer Chassis No.: -
Propellant:	Diesel	Passenger Capacity: 6
Engine Capacity:	2199 cc	Power Rating: -
Maximum Power Output:	147.0 kW (197 bhp)	
Unladen Weight:	1980 kg	Maximum Laden Weight: 2560 kg
Primary Colour:	Grey	Secondary Colour: -
First Registration Date:	06 Aug 2018	Original Registration Date: 06 Aug 2018
Manufacturing Year:	2018	Open Market Value: \$28,052.00
PARF Eligibility:	Yes	Minimum PARF Benefit: \$15,636.00
No. of Transfers:	0	Additional Registration Fee Rate: First \$20,000.00 (100%), next \$8,052.00 (140%)
Actual ARF Paid:	\$31,273.00	

Owner Particulars

Owner Name:	COMFORTDELGRO RENT-A-CAR PTE. LTD.
Owner ID Type:	Company
Owner ID:	198105775H
Registered Address Type:	Private Residential (Condo Apt or House) / Shopping / Office Complexes
Registered Block /House No.:	205
Registered Street Name:	BRADDELL ROAD
Registered Unit	



Our Ref: TP19-088112
Vehicle No.: SMD1720Z

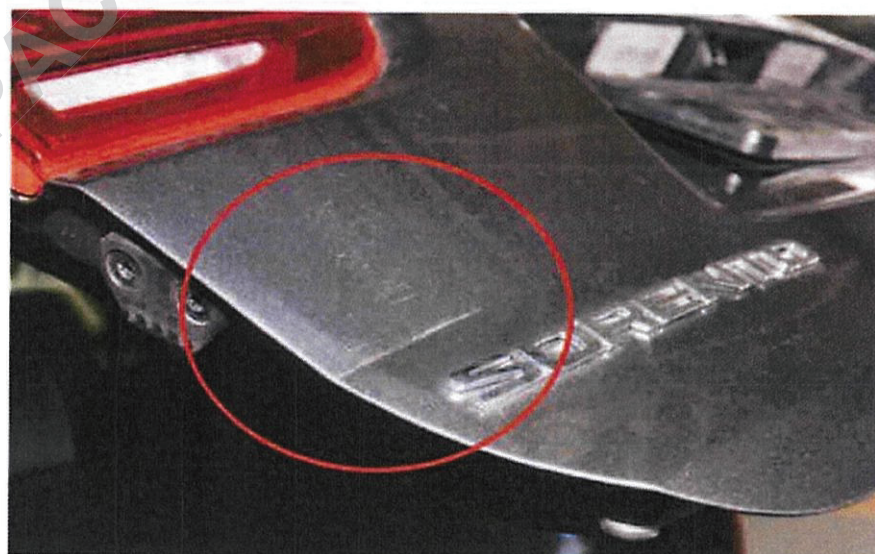



Our Ref: TP19-088112
Vehicle No.: SMD1720Z



Our Ref: TP19-088112
Vehicle No.: SMD1720Z




Our Ref: TP19-088112
Vehicle No.: SMD1720Z

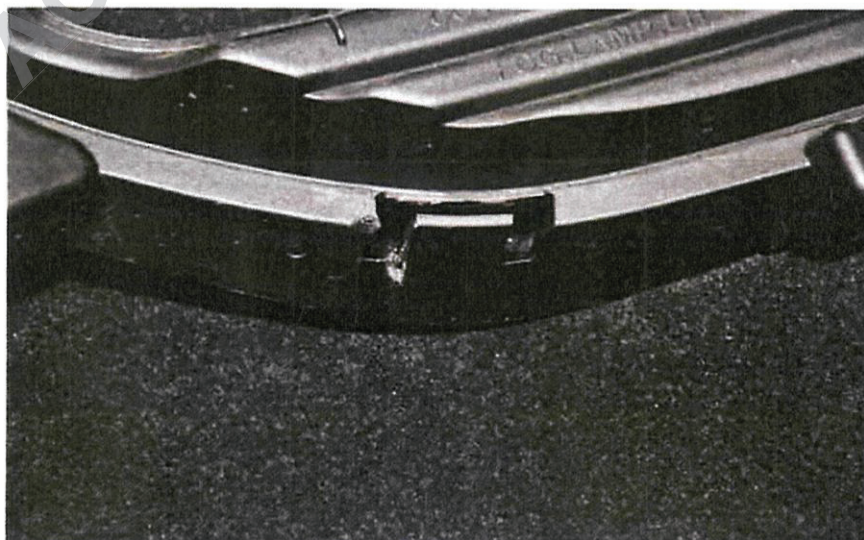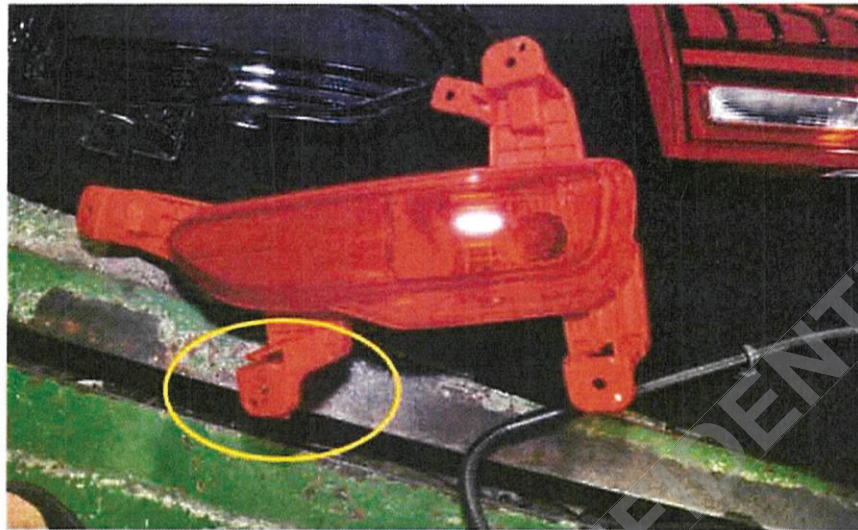


Our Ref: TP19-088112
Vehicle No.: SMD1720Z



Our Ref: TP19-088112
Vehicle No.: SMD1720Z

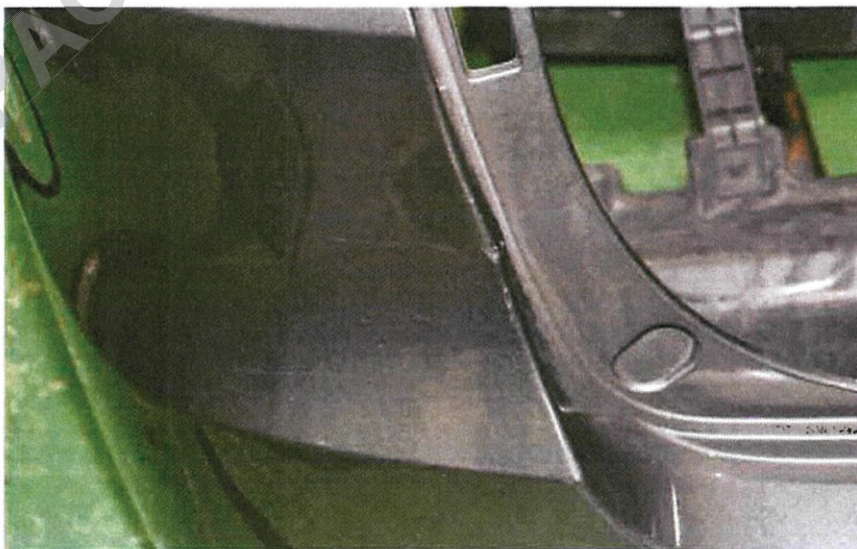

Our Ref: TP19-088112
Vehicle No.: SMD1720Z

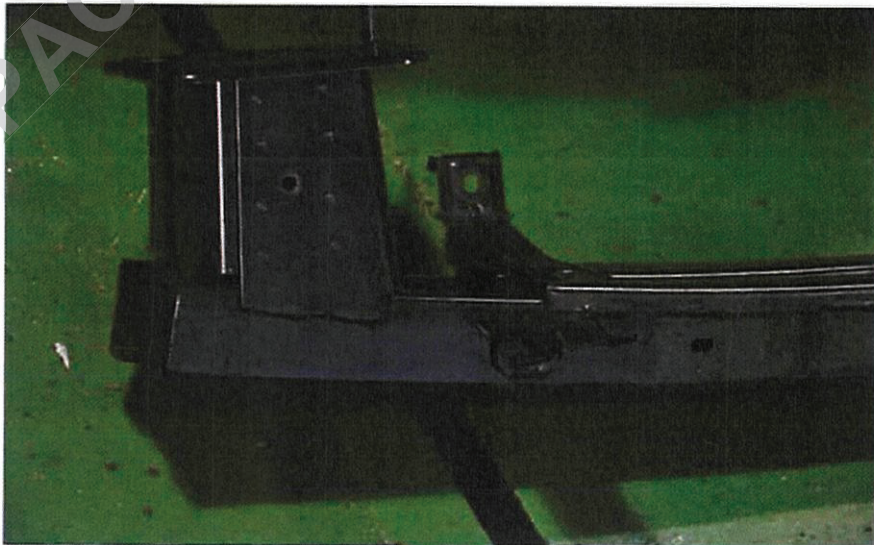

Our Ref: TP19-088112
Vehicle No.: SMD1720Z



Our Ref: TP19-088112
Vehicle No.: SMD1720Z



Our Ref: TP19-088112
Vehicle No.: SMD1720Z

