

Lai Huat (Meng Kee) Motor Pte Ltd
160 Sin Ming Drive, #04-01, #04-02 &
#07-03, Sin Ming Autocity
575722

Insurer Reference: TP-SGN 5599A
Repairer Reference: 72567
Date calculated: 05/04/2022 5:38 PM

Full Report
Registration: SLT 1223U
Printed: 05/04/2022 5:38 PM

Summary Information

Claim

Location:	Singapore (SG)	Work Provider:	China Taiping Insurance (Singapore) Pte Ltd
Printed by:	Jenny Lim	Currency:	SGD
Claim Reference:	TP-SGN 5599A	Date of Incident:	02/04/22
Estimated Repair Time:		Hire Car Start:	
Actual Repair Days:		Hire Car End:	

Vehicle Details

Vehicle

Manufacturer:	HYUNDAI
Model:	TUCSON (TL)
Sub Model:	BASE MODEL
Model Sheet Number:	30 46 01
Registration:	SLT 1223U
VIN number:	
Odometer:	81167

Model Specs

FROM 10.2017	AIR CONDITIONING	ULTRASONIC PARK SYS	2.0 LTR 115/122 KW
TYRES 225/60 R17..H	TWO COAT METALLIC	PREPARE OFF VEHICLE	

Not Authorized
Repairing B4 repair
3 days

Labour

Code	Description	Time Base 10 WU/h	Price = 42.00 SGD/h	
			WU	Price SGD
86520R00 ZAX	RENEW REAR BUMPER INCLUDES: REAR BUMPER REAR LIGHTS, REAR LOWER BUMPER AND REQUIRED ATTACHED PARTS R + R		11.0	46.20
86611R00	RENEW REAR LOWER BUMPER (REMOVED)		8.0	33.60
81750R00	R + R LOWER TAILGATE TRIM		3.0	12.60
87370R00 ZAX	R + R BOOTLID MOULDING		3.0	12.60
86630R00)	R + R REAR BUMPER CARRIER		2.0	8.40
2931	BOOTLID/TAILGATE REPAIR		30.0*	126.00
Labour Cost		Hrs	WU	
Panel / Mechanical Labour		5.70	57.0	239.40
Total of Labour				239.40

LKK Auto Consultants hence notify
the Repairer of the following:

- To resurvey before after spray painting
- To display damaged part(s) during survey
- Parts prices are subject to confirmation
- Third party survey is on a "Without Prejudice" basis
- No illegal modification(s) is allowed
- Supplementary temp must be approved and is subject to final approval from insurance Company

Page 1 of 3

Acknowledged by Repairer
Signature
Date

PRINT DATE 05/04/2022

Paint Work	SYSTEM AZT	Time Basis 10 WU/h
Code	Description - TWO COAT METALLIC	WU Price SGD
	REAR BUMPER NEW PART PAINT K1R	10.0
	BOOT/T-GATE MOULDING NEW PART PAINT K1R	7.0
	BOOTLID/TAILGATE REPAIR PAINTING <50%	20.0

Paint Material Per Part

Code	Description	Price SGD
2583	REAR BUMPER NEW PART PAINT K1R	45.76
2986	BOOT/T-GATE MOULDING NEW PART PAINT K1R	23.62
2931	BOOTLID/TAILGATE REPAIR PAINTING <50%	37.79

Labour Cost - Paint

Factor	Hrs	WU	Price SGD
Time Paint		37.0	
Preparation Main Work Metal	2.50	25.0	105.00
Preparation Comp. Work Plastic	0.50	5.0	21.00
Total	10 WU/h	67.0	281.40

Material Cost - Paint

	Price SGD
New Part Painting - Plastic K1R	69.38
Repair Painting	37.79
Material-constant Metal Preparation	28.60
Material-constant Plastic	9.00
Total	144.77

Spare Parts

Code	Description	Part Number	Part Source	prices as at 2015-06-01	Price SGD
2986	BOOT/T-GATE MOULDING	87371D3010	Original	CAR ✓	140.00
2585	LOWER REAR BUMPER	86612D3000	Original	nd/cw ✓	190.00
2583	REAR BUMPER	86640D3000	Original	Bur	270.00
2640	REAR BUMPER SUPPORT	86631D3100	Original	?	190.00
2702	REAR NUMBER PLATE	KNPL6	Original		0.00
f: OEM Parts	Savings				
n: Non-OEM Parts	Subtotal				0.00
u: Used parts	Fixed Sundry Parts Price				790.00
	Total				100.00
					890.00

Extras

Code	Description	Price SGD
1000	CHK/ERASE FAULT CODE	? 80.00*

Description
REAR NUMBER PLATE
Total Extras

Price SGD
35.00*
115.00

Final Calculation

	SGD	SGD
Parts		
Fixed Sundry Parts Price	790.00	
Total Parts	100.00	890.00
Labour Time Base 10 WU/h		
Total 57.0 WU X 42.00 SGD/h	239.40	
Total of Labour		239.40
Total Of Extras		115.00
Paint Work Time Base 10 WU/h		
Labour Cost 67.0 WU X 42.00 SGD/h	281.40	
Material Cost	144.77	
Total Paint Including Material		426.17
Repair Cost Excludes GST		1,670.57
GST (+7.0%)		116.94
Repair Cost Included GST		1,787.51

Comments

* - USER SUPPLIED DATA
NN - NO MANUFACTURERS CODE EXISTS
) - WU PARTIAL INCL IN OTHER POSITIONS

Assessment Note

No assessment notes entered.

SINGAPORE ACCIDENT STATEMENT

IMPORTANT NOTICE

1. Please report correctly the details of the accident to speed up the claims process.
2. This Form must be completed by the Policyholder and/or the Authorised Driver.
3. Information provided must be as truthful and accurate as possible. Any wilful misrepresentation or withholding of material facts may allow insurance companies to repudiate policy liability.
4. The issue and acceptance of this Form by insurance companies is not an admission of policy liability on the part of the insurance companies.
5. Any false reporting may be referred to the Police for investigation.
6. This report will be forwarded by the insurers of the GIA Records Management Centre established by the General Insurance Association of Singapore (GIA) for archiving and that copies of this report will, for a fee, be made available upon application by interested parties.
7. By the lodgement of this report to the insurers, you hereby consent to the archiving of this report at the centre and to copies of the report being made available aforesaid.

ACCIDENT STATEMENT

Date of Submission	04/04/2022 14:12 (SGT)
Date of Accident	02/04/2022 16:00 (SGT)
Exact Location of Accident	Singapore
Additional Location Information	Along Tampines Road
Country/State of Loss	Singapore

DETAILS OF OWN VEHICLE

Vehicle Registration Number SLT1223U

INSURED/POLICYHOLDER

Is company?	No
Name Of Registered Owner	Lee Boon Seng (Li WenCheng)
NRIC No	S8208545I
Email Address	boonsenglee@gmail.com
Mobile Phone No	(Phone) +65-97609405
Alternative Phone No	(Home) +65-97609405

VEHICLE PARTICULARS

Manufacturer	Hyundai
Model	Tucson
Variant	-
Exact purpose for which vehicle was being used at time of accident	Private use
Are you claiming under your own insurance policy for repair to your vehicle?	No - Claiming third party
Vehicle Category	Private car
Transmission	Auto
CC	1999

INSURANCE COMPANY

Name of Insurance Company	Direct Asia Insurance (Singapore) Pte Ltd
Type of Coverage	Comprehensive
Fleet Policy	No
Policy Number	-
Cover Note Number	-

DRIVER

Name of Driver	Lee Boon Seng (Li WenCheng)
NRIC No	S8208545I

IMPORTANT NOTICE

- 1 Please report **correctly** the details of the accident to speed up the claims process
- 2 This Form must be **completed by the Policyholder and/or the Authorised Driver**
- 3 Information provided must be as **truthful and accurate as possible**. Any willful misrepresentation or withholding of material facts allow insurance companies to **repudiate policy liability**
- 4 The issue and acceptance of this Form by insurance companies is not an admission of policy liability on the part of the insurance companies
- 5 **Any false reporting may be referred to the Police for investigation**
- 6 The report will be forwarded by the insurers of the GIA Records Management Centre established by the General Insurance Association of Singapore (GIA) for archiving and that copies of this report will for a fee be made available upon application by interested parties
- 7 By the lodgement of this report to the insurers, you hereby consent to the archiving of this report at the centre and to copies of the report being made available aforesaid.
8. **Consent under the Personal Data Protection Act (PDPA)**


I understand, acknowledge, agree and consent that

- (a) My insurer, my workshop and the General Insurance Association of Singapore ('GIA') may/are permitted to collect, use, disclose and/or process my personal data/personal information set out in this form and any other personal information provided by me or possessed by my insurer (collectively the 'Personal Information') and disclose and transfer such Personal Information to all insurers who have insured vehicle(s) involved in this accident (all insurer(s) who have insured vehicle(s) involved in this accident shall be collectively referred to as the 'Insurers'), the Insurers' lawyers/law firms, the Monetary Authority of Singapore and any relevant government agency/authority (such as the police) for the purpose(s) of
- (i) processing, handling and/or dealing with my claims including the settlement of the claims and any necessary investigations relating to the claims.
 - (ii) investigating the accident and/or my claims.
 - (iii) carrying out and/or dealing with my instructions or responding to any enquiries by me.
 - (iv) administering my claims (including the mailing of correspondence, statements, invoices, reports or notices to me, which could involve disclosure of certain personal data about me to bring about delivery of the same as well as on the external cover of envelopes/mail packages); and/or
 - (v) complying with applicable law in administering, processing, handling and/or dealing with my claims.
- (collectively the 'Purposes')
- (b) all insurer(s) who have insured vehicle(s) involved in this accident and the Insurers' lawyers/law firms, may/are permitted to collect, use, disclose and/or process my Personal Information for one or more of the above Purposes; and
- (c) my Personal Information may/can be disclosed by any of the Insurers and/or GIA to their third party service providers or agents (including their lawyers/law firms), which may be sited outside of Singapore, for one or more of the above Purposes

Policyholder's Signature / Date & Time

Driver's Signature (If driver is not the policyholder) / Date & Time

Witnessed by Reporting Personnel

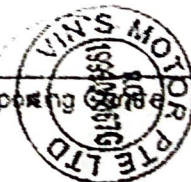

Sketch Plan

