

ASS. REC. BY:

REF:

SMO / 220037001KV

Kenneth

ASSIGNMENT

From:

Date:

Estimated Cost:

OD / TP / WS / TP RES / OD RES / EVA / INV / MY

To inspect Vehicle No:

at Workshop m/s

of

Insured:

Policy No.

Claims No.

Sum Insured:

Excess:

(Client's Record)

Make of Veh:

(Policy Condition)

Remark: The veh had commenced its
repair at the time of inspection.

Bal. or Market Value: \$17K

IDAC Accident Rpt:

Consistent? : Yes or No

GIA / PR Seen:

Consistent? : Yes or No

Est. Repairs:

days

Res.: Yes or No

Lum Sum:

%

3 Val.: Yes or No

CA / REV / REP. / 24 HRS

Date:

Person Contacted:

Vehicle: IN / OUT

Veh No:

STQ 77484 Yr Regn: 05, 09

Type: M.Car / M.Cycle / Bus / Van / Lorry / Taxi / Prime Mover /

Truck / Trailer or

Make:

Hyundai 130 c.c. 1391

Colour:

A.D. Grey A/C: Insured / Std / NI / NA

Sp. Reading

191452 T/Radio: Insured / Std / NI / NA

Eng/No:

C/No:

KMHDC51DR 94 163241

Gen. Cond: Good / Fair / Poor / Burnt

Steering: In order / Jammed / Leaked / Burnt or

Brake: In order / Jammed / Leaked / Burnt or

Modl: Nil / SRim / STD A/Rim or

Tyre Size:

F: 205/55R16

R:

BS / DUN / EXNOVA / GY / FS / LIZA / MIC / OHTSU / PIR / SUMI /

TOYO / YOKO or

Hunko

Front

Rear

R/Bal.

R/Bal.

L/Bal.

L/Bal.

D.O.A.

D.O.I.

Survey held at

Des. of Damages: Frt / Rear / O/S / N/S / U/C / Rooftop or

The U/C / Chassis frame / Body Structure affected due to collision.

Date / Time

Action / Instruction

Date/Time, File Pass to?

☐

: Prell. Report

1)

☐

: Final Report

Date/Time, File Return to?

2)

Days Of Repair:

Resurvey No. of Trip:

Survey Fee:

Transportation:

S + RS. SI

Photos

Others

Add Fee:

☐

: Site Insp (\$

☐

: Interview (\$

☐

: Tech Invs (\$

☐

: Weekend (\$

TOTAL

Report Format :

Lump Sum / I.B.I: (\$

Yew Tee Automobile Tech Pte Ltd (Co.Reg.No.200311009C)

Mega@Woodlands, 39 Woodlands Close #01-12

Singapore 737856

Tel: Fax: Email:

INSURER :**PARTICULARS OF CLAIM**

Claim Type:	TP	Ref. No:	16/04/2022
Policy No:		Date of Loss:	no
Vehicle Reg. No.:	SJQ7748Y	Driveable?	SMP8995M
Driver Age:		Third Party Vehicle No.:	
Any Injuries?	yes	Contact No:	
Insured/Claimant:	SHAFUL AFIQ BIN MOHAMED SALLEH	Driver:	NUR NADIA BINTE KAMAL RUDIN

PARTS MODEL

Make/Model:	Hyundai, I30 1.6 - KMHDC51DM	Vehicle Reg. Date:	27/05/2009
Vehicle Colour:		Engine Number:	
Chassis No:	KMHDC51DR9U163241	Odometer:	
Total Loss?		Est. Duration of Repair(Day)	

DESCRIPTION OF ACCIDENT/LOSS

Description of Accident/loss Collision - Head to Rear

Remarks:

Present Location: Yew Tee Automobile Tech Pte Ltd (Mega)-YTMG

COST OF CLAIMS

	Amount
Parts	3,637.04
Miscellaneous Items	635.00
Labour	1,610.00
Paintwork Labour	1,310.00
Towing	0.00
Gross Total(S\$):	7,192.04
GST 7.00%(S\$):	503.44
Nett Amount(S\$):	7,695.48

This claim is handled by: Sky Toh T C

Not Notarise
L/Lump &
Resurvey After Paint
Kennerth (LKK) 4 days
96910663

LKK Auto Consultants hence notify
the Repairer of the following:

- To resurvey before/after spray painting
- To display damaged part(s) during resurvey
- Parts prices are subject to confirmation
- Third party survey is on a "Without Prejudice" basis
- No illegal modification(s) is allowed
- Supplementary item(s) must be resurveyed and is subject to final approval from Insurance Company

Acknowledged by Repairer

Signature:

Date:

REPAIR DETAILS**Estimates On Parts**

No.	Qty	Particulars	Amount	%Disc	After Disc
1	1	REAR BUMPER	450.00	-20.00	360.00 ✓
2	1	REAR BUMPER SIDE RETAINER LH	80.00	-20.00	64.00 X
3	1	REAR BUMPER SIDE RETAINER RH	80.00	-20.00	64.00 X
4	1	REAR BUMPER INNER SPONGE	130.00	-20.00	104.00 X
5	1	REAR BUMPER REINFORCEMENT	280.00	-20.00	224.00 ✓
6	1	REAR TAILGATE	1,801.30	-20.00	1,441.04 ✓
7	1	REAR TAILGATE I30 EMBLEM	55.00	-20.00	44.00 ✓
8	1	REAR TAILGATE RUBBER	85.00	-20.00	68.00 X
9	1	REAR TAILGATE LOCK	170.00	-20.00	136.00 X
10	1	REAR END PANEL	380.00	-20.00	304.00 X
11	1	REAR END PANEL INNER GARNISH	45.00	-20.00	36.00 X
12	1	REAR TAILLAMP LH	495.00	-20.00	396.00 X
13	1	REAR TAILLAMP RH	495.00	-20.00	396.00 ✓

Total Parts (\$\$) 3,637.04

Estimates of Miscellaneous Items

No.	Qty	Particulars	Amount	%Disc	After Disc
1	1	REAR NUMBER PLATE	45.00	0.00	45.00 X
2	1	REAR BUMPER CLIPS (1 SET)	40.00	0.00	40.00 ✓
3	1	REAR BUMPER SENSORS (1 SET)	250.00	0.00	250.00 200.00
4	1	REAR BUMPER CAMERA	200.00	0.00	200.00 X
5	1	REAR WINDSCREEN SEALANT	100.00	0.00	100.00

Sub Total (\$\$) 635.00

Estimates On Labour

No.	Qty	Particulars	Amount	%Disc	After Disc
1	1	To Disconnect and Reconnect, Check Electrical wiring Harness Wire, Sockets, Replace Damaged Parts.	50.00	0.00	50.00 15/-
2	1	To Remove and Refit Rear Bumper Sensor.	80.00	0.00	80.00 50/-
3	1	To Dismantle and Refit Rear Windscreen Glass.	100.00	0.00	100.00 ✓
4	1	To Transfer Rear Tailgate.	80.00	0.00	80.00 60/-
5	1	To Remove and Replace the above Damaged Parts, Straighten, Knock out, Realign and Repair including Cut and Weld body panels. To Re-adjust to the Original position using power tools.	1,300.00	0.00	1,300.00 400/-

Gross Labour Cost (\$\$) 1,610.00

Estimates On Paint Work Labour

No.	Qty	Particulars	Amount	%Disc	After Disc
1	1	To Carry-Out Body Cavity Preservation.	50.00	0.00	50.00
2	1	To Apply Undercoating On The Repaired and Replaced Panels For Rust Protection.	60.00	0.00	60.00 } 30/-
3	1	To Spray painting on the Replaced and Repair Parts, Prepare Spray Such as Masking Tape	1,200.00	0.00	1,200.00 400/-

SINGAPORE ACCIDENT STATEMENT

IMPORTANT NOTICE

1. Please report correctly the details of the accident to speed up the claims process.
2. This Form must be completed by the Policyholder and/or the Authorised Driver
3. Information provided must be as truthful and accurate as possible. Any wilful misrepresentation or withholding of material facts may allow insurance companies to repudiate policy liability.
4. The issue and acceptance of this Form by insurance companies is not an admission of policy liability on the part of the insurance companies.
5. Any false reporting may be referred to the Police for investigation.
6. This report will be forwarded by the Insurers of the GIA Records Management Centre established by the General Insurance Association of Singapore (GIA) for archiving and that copies of this report will, for a fee, be made available upon application by interested parties.
7. By the lodgement of this report to the Insurers, you hereby consent to the archiving of this report at the centre and to copies of the report being made available aforesaid.

ACCIDENT STATEMENT

Date of Submission 18/04/2022 21:01 (SGT)
Date of Accident 16/04/2022 12:30 (SGT)
Exact Location of Accident Singapore
Additional Location Information 451 Clementi Ave 3 carpark
Country/State of Loss Singapore

DETAILS OF OWN VEHICLE

Vehicle Registration Number SJQ7748Y

INSURED/POLICYHOLDER

Is company? No
Name Of Registered Owner SHAFUL AFIQ BIN MOHAMED SALLEH
NRIC No S9040785F
Email Address Afiq_trainer@hotmail.com
Mobile Phone No (Phone) +65-90626572
Alternative Phone No +65-90626572

VEHICLE PARTICULARS

Manufacturer Hyundai
Model I30
Variant -
Exact purpose for which vehicle was being used at time of accident Private use
Are you claiming under your own insurance policy for repair to your vehicle? No - Claiming third party
Vehicle Category Private car
Transmission Auto
CC 1600


INSURANCE COMPANY

Name of Insurance Company NTUC Income Insurance Co-operative Ltd
Type of Coverage Comprehensive
Fleet Policy No
Policy Number 5121901401
Cover Note Number -

DRIVER

Name of Driver NUR NADIA BINTE KAMAL RUDIN
NRIC No S9127101Z

SKETCH PLAN

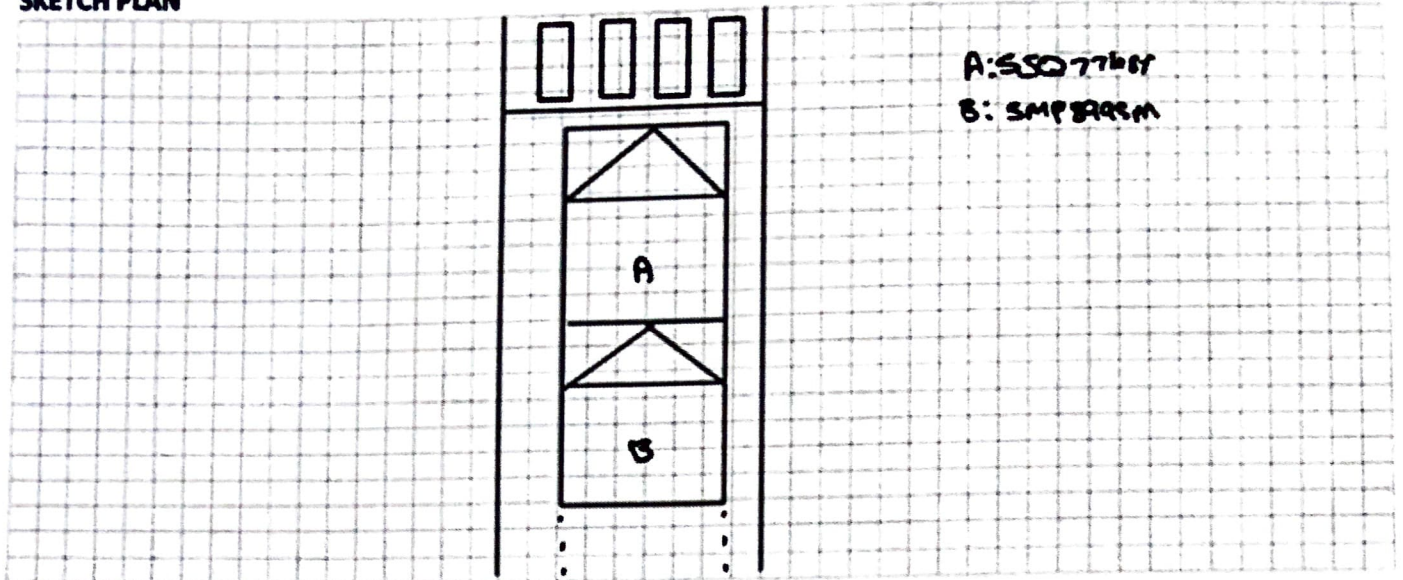

DESCRIBE CIRCUMSTANCES OF THE ACCIDENT

Refer to Police Report

DECLARATION

I/We declare the foregoing particulars are true in every respect.

Policyholder's Signature
Date & Time:

Driver's Signature
(If driver is not the policyholder)
Date & Time: 18/04/2022 2045hrs

Reporting Centre Personnel's Signature
Name: Ash Kamal
NRIC/FIN No.: S994396



**SINGAPORE
POLICE FORCE**



T/20220418/2037

2 of 3

Report No. T/20220418/2037

Police Station Of Origin:
Bukit Panjang N.P.C
1 Segar Road #01-05 SINGAPORE 677738
Tel No: 1800-8929999

CONTINUATION OF REPORT

Brief Details.

On 16/04/2022 at about 1230hrs, I was driving my car (SJQ7748Y) out from the open space carpark at Blk 446 Clementi Ave 3. As I was heading out from the carpark, there was a zebra crossing heading from Blk 446 to Blk 451 to which I stopped before the zebra crossing. I stopped to allow then pedestrians to cross the zebra crossing to which all of a sudden, a car collided with the rear of my vehicle. I came out from my vehicle to which I saw that (SMP8995M) had collided with the rear of my vehicle. I checked my vehicle to which there were dents on my boot and rear bumper. I checked his car to which there were a scratch on his front bumper.

I then exchanged particulars with the driver namely (Sugawara Shota, G3250627K, H/P: 97209125) who informed me that he thought I was moving off and therefore accidentally collided with me. Initially, I made a check on my kids and helper to which they told me that they were feeling fine. However, after coming back home, I, my kids and domestic helper suffered neck pains. Later that night, all 3 of my sons started vomiting. My domestic helper then complained of breathlessness.

I have since went to the doctor along with my children and domestic helper. We were all given 3 days MC.