

ASS. REC. BY:

REF:

ASM/ 220043461/keaz

C

ASSIGNMENT

From:

Date:

Estimated Cost:

OD / TP / WS / TP RES / OD RES / EVA / INV / MV

To Inspect Vehicle No:

at Workshop m/s

of

Insured:

Policy No.

Claims No.

Sum Insured:


Excess:

(Client's Record)

Make of Veh:

(Policy Condition)

Remark: The veh had commenced its
repair at the time of inspection.

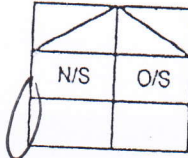

Bal. or Market Value:

834K

IDAC Accident Rpt:

Consistent? : Yes or No

GIA / PR Seen:

Consistent? : Yes or No

Est. Repairs:

04

days

Res.:

Yes or No

Lum Sum:

20

%

3 Val.:

Yes or No

CA / REV / REP. / 24 HRS

Date:

Person Contacted:

Vehicle: IN / OUT

Veh No:

GBE 3089X

Yr Regn:

10, 15

Type: M.Car / M.Cycle / Bus / Van / Lorry / Taxi / Prime Mover /

Truck / Trailer or

Make:

NIS NV200

c.c

1597

Colour

Silver

A/C:

Insured / Std / NI / NA

Sp. Reading

164845

T/Radio:

Insured / Std / NI / NA

Eng/No:

C/No:

VM 20

082812

Gen. Cond: Good / Fair / Poor / Burnt

Steering: In order / Jammed / Leaked / Burnt or

Brake: In order / Jammed / Leaked / Burnt or

Modi: M / S/Rim / STD A/Rim or

Tyre Size:

F:

R:

165R14x8

BS / DUN / EXNOVA / GY / FS / LIZA / MIC / OHTSU / PIR / SUMI /
TOYO / YOKO or

Front

R/Bal.

J

mm

Rear

R/Bal.

J

mm

L/Bal.

J

mm

L/Bal.

J

mm

D.O.A.

25/4/22

D.O.I.

11/5/2022

Survey held at

Des. of Damages: Frt / Rear / O/S / N/S / UIC / Rooftop or

NIS Rear

The UIC / Chassis frame / Body Structure affected due to collision.

Date / Time

Action / Instruction

12/5/21 Sp 814501 Cui

Date/Time, File Pass to?

☐

: Prell. Report

1)

☐

: Final Report

Date/Time, File Return to?

2)

Days Of Repair:

Resurvey No. of Trip:

Survey Fee:

Transportation:

S + RS. \$

Fuels

Others

TOTAL

Add Fee:

☐

: Site Insp (\$

☐

: Interview (\$

☐

Tech Invs (\$

☐

Weekend (\$

Report Format :

Lump Sum / I.B.I: (\$

KIEN CHEONG AUTOMOTIVE

BLK 9 SIN MING INDUSTRIAL ESTATE SECTOR C

#01-26 SINGAPORE 575644

H/P : 8125 9406 FAX : 64550902

The Motor Claims Dept.

AXA Insurance

(LKK)

DATE : 10/5/2022
VEHICLE NO: GBE 3099X
MAKE/MO: Nissan NV200
ACC DATE : 25/4/2022

*Not with the
11 Sep @ 1450h
Resurvey After Rain
4 days*

ESTIMATE

S/N	PC	Nett Items	Page . 1 .	AMOUNT S\$
1		1 Rear LH Fender panel		1,636.00 X
2		1 Rear LH center panel		1,659.10 X
3		1 Rear LH wheel inner shield		49.00 X
4		1 Rear LH mudflap		68.00 X
5		1 Rear LH shock absorber		115.00 2
6		1 Rear LH shock absorber stopper		91.30 X
7		1 Rear LH bearing with hub 351.6		381.30 2
8		1 Rear axle beam		2,417.10 X
9		1 Rear LH tyre wheel hub cover		155.00 ✓
		<i>Rec bumper Rd 485.90 ✓</i>		6,571.80
			Lrss10%	-657.18
				5,914.62
Special Items				
1		1 Rear LH wheel inner shield clips (1set)		20.00 X
2		1 Rear LH tyre rim		237.00 X
				257.00
Labour Charges				
1		Wheel Alignment		100.00 601
3		Anti rust		250.00 X
5		To respray painting & etc		1,200.00 4001
6		Panel beat, remove and replacing above parts		2,200.00 4001
				3,750.00
Total amount				9,921.62

(S/D/s : Nine Thousand Nine Hundred twenty-one and cents Sixty-two only)



LKK Auto Consultants hence notify
the Repairer of the following:

- To resurvey before/after spray painting
- To display damaged part(s) during resurvey
- Parts prices are subject to confirmation
- Third party survey is on a "Without Prejudice" basis
- No illegal modification(s) is allowed
- Supplementary item(s) must be resurveyed and is subject to final approval from Insurance Company

Acknowledged by Repairer

Signature:

Date: