

ASS. REC. BY: Taufik


REF: CS/1M/220044a/7gc

ASSIGNMENT

From: _____ Date: _____
 Estimated Cost: _____
OD / TP / WS / TP RES / OD RES / EVA / INV / MV
 To Inspect Vehicle No: _____
 at Workshop m/s _____
 of _____
 Insured: _____
 Policy No. _____
 Claims No. M2202286
 Sum Insured: _____ Excess: _____
 (Client's Record)
 Make of Veh: _____

(Policy Condition)

Remark: The veh had commenced its repair at the time of inspection.

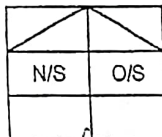

Bal. or Market Value: _____
 IDAC Accident Rpt: _____ Consistent? : Yes or No
 GIA / PR Seen: _____ Consistent? : Yes or No
 Est. Repairs: 2 days Res.: Yes or No
 Lum Sum: _____ % 3 Val.: Yes or No
 CA / REV / REP. / 24 HRS
 Date: _____ Person Contacted: WY
 Vehicle: IN / OUT

Veh No: SHUA 4546R Yr Regn: 2016 / Dec
 Type: M.Car / M.Cycle / Bus / Van / Lorry / Taxi / Prime Mover /
 Truck / Traller or
 Make: Toyota Prim C.C. 1798
 Colour: blue A/C: Insured / Std / NI / NA
 Sp. Reading: 768477 T/Radio: Insured / Std / NI / NA
 Eng/No: _____
 C/No: 5TDK131490 3539598
 Gen. Cond: Good / Fair / Poor / Burnt
 Steering: In order / Jammed / Leaked / Burnt or
 Brake: In order / Jammed / Leaked / Burnt or
 Modl: Nil / S/Rim / STD A/Rim or
 Tyre Size: F: 195/65R15
 R: ~ ~
 BS / DUN / EXNOVA / GY / FS / LIZA / MIC / OHTSU / PIR / SUMI /
 TOYO / YOKO or westlake
 Front Rear
 R/Bal. 6 mm R/Bal. 6 mm
 L/Bal. 6 mm L/Bal. 6 mm
 D.O.A. _____ D.O.I. 11/5/22
 Survey held at Carpet by
 Des. of Damages: Frt / Rear / O/S / N/S / U/C / Rooftop or
 The U/C / Chassis frame / Body Structure affected due to collision.

Date / Time	Action / Instruction
25/05/22@3.20pm	revised to Francis Ng via Merimen.
	Taufikh finalised LS \$900, 2 days. (Red \$1067.24, 54%)

Date/Time, File Pass to?

☐ : Prell. Report
☐ : Final Report

1) 25/05 Typist

Date/Time, File Return to?

2)

Days Of Repair: 2

Resurvey No. of Trip: 1

Add Fee: ☐ : Site Insp (\$ _____)
☐ : Interview (\$ _____)
☐ : Tech. Invs (\$ _____)
☐ : Weekend (\$ _____)

Survey Fee:

Transportation:

S + RS _____ SI

Photos

Others

TOTAL

Rep. Format: MER-TP

Lump Sum / L.S. 900

ComfortDelGro Engineering Pte Ltd (Co.Reg.No:199506048W)

59 Loyang Drive
Singapore 508969
Tel: 6214 8300

TP INSURER:
CTPL

Tokio Marine Insurance Singapore Ltd (HQ)

Jumani

Singapore

PARTICULARS OF CLAIM

Claim Type:	THIRD PARTY	Ref. No:	
Policy No:		Date of Loss:	10/05/2022
Vehicle Reg. No.:	SHA4546R	Driveable?	YES
Party At Fault:	UNKNOWN		
Make/Model:	TOYOTA PRIUS, 1.8 HYBRID CVT (A)	Vehicle Reg. Date:	30/12/2016
Vehicle Colour:	BLUE	Gen Condition:	GOOD
Engine No:	2ZRR926784	Chassis No:	JTDKB3FU903539598
Odometer:	0 KM		
Paint Type:			
List Item Discount:	25.00 %		
Total Loss?	NO		
Est. Duration of Repair (day)	4		
Present Location:	COMFORTDELGRO ENGINEERING PTE LTD (LOYANG)		

COST OF CLAIMS

	Amount
Parts	
Miscellaneous Items	1,206.24
Labour	11.00
Paintwork Labour	750.00
Towing	0.00
	0.00
Gross Total (S\$)	1,967.24
+ GST 7.00% (S\$)	137.71
Nett Amount (S\$)	2,104.95

This claim is handled by: JUMANI BIN MASUDIN

REPAIR DETAILS**Reference****Part Source:** MRM-SG Version: 1.0 (Last Synchronised: 10 May 2022)**Parts:** 144 TOYOTA PRIUS 1.8 HYBRID CVT (A) (Catalogue:Merimen Singapore 1.0)**Labour:** Repairer's (Price-denominated Standard List)**Print Code:** ComfortDelGro Engineering Pte Ltd/SHA4546R/10/05/2022 16:10**Validity:** These estimates are valid only if they contain the print code (above) on all estimate pages, running page numbers with the END OF ESTIMATES marker on the last estimate page**Further Info:** Items/values not in reference catalogue are prefixed with an asterisk *.**Estimates on Parts**

No.	Qty	Part No.	Particulars	%Disc	%Depr	Amount
1	1		*REAR BUMPER ASSY	25.00	0.00	Rx *503.04 FL
2	10		*REAR BUMPER CLIPS	25.00	0.00	ner *22.00 FL
3	1		*REAR BUMPER BEAM	25.00	0.00	? *378.32 FL
4	1		*REAR BUMPER MLDG CENTRE	25.00	0.00	de *654.96 FL
5	1		*REAR BUMPER MAT	25.00	0.00	* *50.00 FL

F=Franchise part. L=ListItemDisc.

Sub Total (\$\$)**1,608.32****- List Item Discount on L Items (\$\$)****402.08****Total Parts (\$\$)****1,206.24**

ComfortDelGro Engineering Pte Ltd/SHA4546R/10/05/2022 16:10. Not valid without Reference section.
Generated using Merimen e-Claims IEAS

Estimates on Miscellaneous Items

No	Qty	Particulars	Amount
Miscellaneous Items			
1	1	OD/TP Case (Insurer)	11.00
Sub Total (S\$)			11.00

Estimates on Labour

No	Particulars	Lab.Type	Amount
Labour Items			
1	PANEL BEATING	New	350 400.00
2	SPRAYPAINT	New	250 300.00
3	REMOVE/REFIX REVERSE SENSOR	New	30 50.00
Gross Labour Cost (S\$)			750.00

ComfortDelGro Engineering Pte Ltd/SHA4546R/10/05/2022 16:10. Not valid without Reference section.
Generated using Merimen e-Claims IEAS

< END OF ESTIMATES >

Tan Kah 2425749
in 4/5/22 @ 5200-
02 days
[15] Repair after repair
Tan Kah @ (Khan) 2022

LKK Auto Consultants hence notify
the Repairer of the following:

- To resurvey before/after spray painting
- To display damaged part(s) during resurvey
- Parts prices are subject to confirmation
- Third party survey is on a "Without Prejudice" basis
- No illegal modification(s) is allowed
- Supplementary item(s) must be resurveyed and is subject to final approval from Insurance Company

Acknowledged by Repairer

Signature:

Date:

From:

Date:

Veh No:

COMFORTDELGRO ENGINEERING

ComfortDelGro Engineering Pte Ltd

205 Braddell Road Singapore 579701

Mainline + 65 6383 6280 Facsimile + 65 6280 9755

Workshops

205 Braddell Road Singapore 579701

59 Loyang Drive Singapore 503969

383 Sin Ming Drive Singapore 575717

Date/Time: 10.05.2022 15:59

Page : 1

Team: ARC Repair TP(CLS0)1

JOB CARD Sales Order:

JC NO.305515581

STOMER

/MS COMFORT TRANSPORTATION PTE LTD
STOMER NO. 7010045
DRESS 383 SIN MING DRIVE
Singapore SINGAPORE 575717
65508755 (R) (O)
(P)

COUNT CARD NO.

REGN NO.:

SHA4546R

MILEAGE

MAKE :

TOYOTA

FUEL

E.....1/2.....F

MODEL

PRIUS HYBRID(G4)10.05.2022 13:45

DATE/TIME IN

YR OF MANU.

30.12.2016

TARGET DATE

CHASSIS CODE

JTDKB3FU903539598

COMPLETION DATE/TIME:

JOB DESCRIPTION


Accident Date: 10.05.2022

NATURE: 3P 10.05.2022

S/NO

LABOR CODE

DESCRIPTION

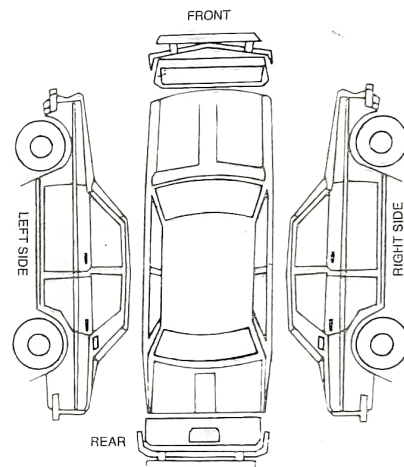

CHECKED & PASSED OUT BY:

SERVICE ADVISOR

CUSTOMER'S SIGNATURE

Acknowledgement Slip

Exit Pass

:

D.:

e No.: SHA4546R

JU TOKIO

Vehicle No.:

SHA4546R

Signature/Date

Signature/Date

Name of Service Advisor

Date

returned to Service Reception upon collection

To be kept by Security Guard