

ASS. REC. BY: P. K. M.REF: 08/AIS22004589/Rtc

2554

ASSIGNMENT

From: _____ Date: _____

Estimated Cost: _____

☒ OP / TP / WS / TP RES / OD RES / EVA / INV / MVTo Inspect Vehicle No: GBL 212Tat Workshop m/s Auto Insureof 6, MARSILINH LNInsured: AIS

Policy No. _____

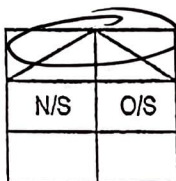
Claims No. _____

Sum Insured: _____ Excess: TBA

(Client's Record)

Make of Veh: _____

(Policy Condition)

Remark: The veh had commenced its
repair at the time of inspection.Bal. or Market Value: 79K

IDAC Accident Rpt: _____ Consistent? : Yes or No

GIA / PR Seen: _____ Consistent? : Yes or No

Est. Repairs: _____ days Res.: Yes or No

Lum Sum: _____ % 3 Val.: Yes or No

CA / ☒ REV / REP. / 24 HRS

Vehicle: IN / OUT

Date: _____ Person Contacted: _____

Veh No: GBL 212T Yr Regn: 2011 / P8BType: M.Car / M.Cycle / Bus ☒ Van / Lorry / Taxi / Prime Mover /

Truck / Trailer or

Make: Volkswagen Caddy Maxi TDI c.c. 1968Colour: WHITE A/C: Insured / Std / NI / NASp. Reading: 33848 T/Radio: Insured / Std / NI / NA

Eng/No: _____

C/No: WV1ZZZ2K2LX132312Gen. Cond: Good ☒ Fair / Poor / BurntSteering: ☒ Inorder / Jammed / Leaked / Burnt orBrake: ☒ Inorder / Jammed / Leaked / Burnt orModl: ☒ NII / S/Rim / STD A/Rim orTyre Size: F: 195/65R15R:

BS / DUN / EXNOVA / GY / FS / LIZA / MIC / OHTSU / PIR / SUMI /

TOYO / YOKO or

CONTINENTAL

Front

Rear

R/Bal. 6 mm R/Bal. 6 mmL/Bal. 6 mm L/Bal. 6 mmD.O.A. 30/04/22 D.O.I. 13/05/22Survey held at Auto InsureDes. of Damages: ☒ Frt / Rear / O/S / N/S / U/C / Rooftop or

The U/C / Chassis frame / Body Structure affected due to collision.

Date / Time

Action / Instruction

Repair Limit - 48K

Date/Time, File Pass to?

☐ : Prel. Report☐ : Final Report

1)

Date/Time, File Return to?

2)

Days Of Repair: _____

Resurvey No. of Trip: _____

Add Fee:

☐ : Site Insp (\$ _____)☐ : Interview (\$ _____)☐ : Tech. Invs (\$ _____)☐ : Weekend (\$ _____)

Survey Fee:

Transportation:

S + RS. SI

Photos

Others

TOTAL

Report Format :

Lump Sum / I.B.A. (%)



Auto Insure Pte. Ltd.
6 Marsiling Lane
Singapore (739145)
E: claims01@autoinsure.com.sg
W: www.autoinsure.com.sg
T: 3157 2626 F: 6368 0081
GST No.: 201437380M

Page No.1

AUTOMOBILE ASSESSMENT REPORT

Our Ref: **GBL212T (SIEW)**

Date: **11-May-22**

BY EMAIL ONLY
(claims01@autoinsure.com.sg)

ATTENTION: MOTOR CLAIMS DEPT

Allianz Insurance Singapore Pte. Ltd

79 Robinson Road
#09-01,
Singapore 068897

Assessed Vehicle No : **GBL212T**
Car Make and Model : **VOLKSWAGEN CADDY MAXI TDI DSG**
Date of Accident : **30-Apr-22**
Date of Assessment : **11-May-22**

We have carried out a physical assessment of GBL212T at our workshop Auto Insure Pte Ltd sustained damages to the FRONT portion of the vehicle.

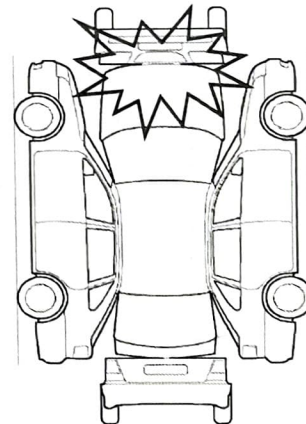
4. DESCRIPTION OF DAMAGE

At the time of the inspection observed that this vehicle had sustained damages to the FRONT portion of the vehicle.

Please see attached schedule for details.

Remarks: NIL

Estimated Amount : **P/P**
Adjusted Amount : **\$ 22,186.99**
Est. Repair Days : **10**



Pursuant to your instruction, we have **AUTHORIZED to** repair.
The assessment was conducted on a "**WITHOUT PREJUDICE**" basis.

If we are not notified of anything within 14 Days from the date hereof, this report shall be treated as correct.

Disclaimer

This report is intended for the exclusive use of the addressee solely in relation to the loss of occurrence in which the assessed vehicle is involved.

No liability or responsibility whatsoever shall be held by

AUTO INSURE PTE. LTD. For any reliance on this report by any third party.

S/NO	QTY	DESCRIPTIONS	ASSESSED CONDITION	EST. BY WORKSHOP
PARTS REPLACEMENT - LIST ITEMS				
1	1	BONNET <i>bue /</i>		\$ 1,320.00
2	1	BONNET HINGE RH <i>bt /</i>		\$ 90.00
3	1	BONNET HINGE LH <i>bt /</i>		\$ 90.00
4	1	BONNET LOCK UPPER <i>bt /</i>		\$ 66.00
5	1	BONNET LOCK LOWER <i>bt /</i>		\$ 120.00
6	1	HEADLAMP RH <i>cr /</i>		\$ 360.00
7	1	HEADLAMP LH <i>ms /</i>		\$ 360.00
8	1	HEADLAMP INNER COVER RH <i>ms /</i>		\$ 22.00
9	1	HEADLAMP INNER COVER LH <i>ms /</i>		\$ 22.00
10	1	FRONT GRILLE CHROME RH <i>cr /</i>		\$ 24.00
11	1	FRONT GRILLE CHROME LH <i>cr /</i>		\$ 24.00
12	1	FRONT BUMPER <i>dis /</i>		\$ 780.00
13	1	FRONT BUMPER LOGO (VW) <i>no ms /</i>		\$ 60.00
14	1	FRONT BUMPER TOWING COVER RH <i>scr /</i>		\$ 12.00
15	1	FRONT BUMPER FOG LAMP COVER RH <i>ms /</i>		\$ 90.00
16	1	FRONT BUMPER FOG LAMP COVER LH <i>scr /</i>		\$ 90.00
17	1	FRONT BUMPER SIDE RETAINER RH <i>cr /</i>		\$ 55.00
18	1	FRONT BUMPER SIDE RETAINER LH <i>cr /</i>		\$ 55.00
19	1	FRONT BUMPER INNER BRACKET RH <i>scr / cr /</i>		\$ 145.00
20	1	FRONT BUMPER INNER BRACKET LH <i>scr / cr /</i>		\$ 145.00
21	1	FRONT TEMPERATURE SENSOR OUTER <i>ms /</i>		\$ 35.00
22	1	FRONT BUMPER SPONGE UPPER <i>cr /</i>		\$ 60.00
23	1	FRONT BUMPER REINFORCEMENT <i>bt /</i>		\$ 385.00
24	1	FRONT BUMPER SPONGE LOWER <i>cr /</i>		\$ 42.00
25	1	FRONT BUMPER REINFORCEMENT LOWER <i>bt /</i>		\$ 145.00
26	1	FRONT ENGINE LOWER COVER ?		\$ 180.00
27	1	FRONT SUPPORT PANEL <i>cr /</i>		\$ 840.00
28	1	FRONT BRACE PANEL <i>bt /</i>		\$ 90.00
29	1	HEADLAMP PANEL UPPER RH <i>bt /</i>		\$ 30.00
30	1	HEADLAMP PANEL UPPER LH <i>bt /</i>		\$ 30.00
31	1	HEADLAMP LOWER BRACKET RH <i>cr /</i>		\$ 145.00
32	1	HEADLAMP LOWER BRACKET LH <i>cr /</i>		\$ 145.00
33	1	FRONT AIR GUIDE <i>cr /</i>		CHECK PRICES
34	1	FRONT AIR INLET DUCT <i>cr /</i>		\$ 48.00
35	1	FRONT AIR INLET COVER <i>cr /</i>		\$ 24.00
36	1	AIR FILTER ASSY <i>cr /</i>		\$ 345.00
37	1	AIR FILTER ELEMENT <i>at /</i>		\$ 35.00
38	1	AIR FILTER INTAKE HOSE <i>cr /</i>		\$ 84.00
39	1	WIPER TANK <i>de /</i>		\$ 108.00
40	1	WIPER TANK MOTOR ?		\$ 90.00
41	1	AIR CON CONDENSER SIDE COVER RH <i>cr /</i>		\$ 24.00
42	1	AIR CON CONDENSER SIDE COVER LH <i>cr /</i>		\$ 24.00
43	1	AIR CON CONDENSER <i>bt /</i>		\$ 360.00
44	1	AIR CON DISCHARGE HOSE <i>bt /</i>		\$ 600.00
45	1	AIR CON SUCTION HOSE <i>bt /</i>		\$ 600.00

46	1	AIR CON HOSE INNER ?		\$	600.00
47	1	AUXILIARY WATER PUMP HOSE cut		\$	22.00
48	1	AUXILIARY RADIATOR bt		\$	390.00
49	1	RADIATOR UPPER AIR DUCT can		\$	66.00
50	1	RADIATOR LOWER AIR DUCT can		\$	66.00
51	1	RADIATOR UPPER BRACKET RH bt		\$	36.00
52	1	RADIATOR UPPER BRACKET LH bt		\$	36.00
53	1	RADIATOR LOWER STOPPER RH ac		\$	12.00
54	1	RADIATOR LOWER STOPPER LH ac		\$	12.00
55	1	RADIATOR bt		\$	390.00
56	1	RADIATOR UPPER HOSE (SMALL) cut X		\$	22.00
57	1	RADIATOR UPPER HOSE (BIG) cut		\$	96.00
58	1	RADIATOR FAN COVER can		\$	180.00
59	1	RADIATOR FAN RH ?		\$	345.00
60	1	RADIATOR FAN LH can		\$	480.00
61	1	COOLING WATER PIPE bt			CHECK PRICES
62	1	CHARGER INTAKE HOSE cut			CHECK PRICES
63	1	ENGINE WIRE HARNESS ?		\$	700.00
64	1	FUEL FILTER bt		\$	440.00
65	1	ADBLUE TANK FILLER NECK cut		\$	225.00
66	1	ADBLUE TANK can		\$	1,440.00
67	1	ENGINE MOUNTING BRACKET RH can		\$	120.00
68	1	ENGINE MOUNTING RH can		\$	240.00
69	1	FRONT CHASSIS RH repair			REPAIR
70	1	FRONT CHASSIS LH repair			REPAIR
71	1	FRONT WHEEL HOUSE RH repair			REPAIR
72	1	FRONT FENDER RH bt		\$	420.00
73	1	FRONT FENDER SIGNAL LAMP RH sc		\$	24.00
74	1	FRONT FENDER INNER SHIELD RH cut		\$	60.00
75	1	FRONT FENDER LH bt		\$	420.00
76	1	FRONT FENDER SIGNAL LAMP LH sc		\$	24.00
77	1	FRONT FENDER INNER SHIELD LH cut		\$	60.00
78	1	FRONT QUARTER GLASS RH cut		\$	90.00
79	1	FRONT QUARTER GLASS LH cut		\$	90.00
80	1	FRONT DOOR RH repair			REPAINT
81	1	FRONT DOOR LH repair			REPAINT
			SUB TOTAL	\$	15,505.00
			MARGIN 10%	\$	1,550.50
			TOTAL AMOUNT	\$	17,055.50

Our Ref: **GBL212T**

S/NO	QTY	SPECIAL NETT ITEMS	ASSESSED CONDITION	EST. BY WORKSHOP
1	1	FRONT NUMBER PLATE & HOLDER <i>cm</i>		\$ 50.00 <i>35</i>
2	1	FRONT BUMPER CLIPS <i>ne</i>		\$ 50.00 <i>30</i>
3	2	FRONT FENDER INNER SHIELD CLIPS RH & LH <i>m</i>		\$ 50.00 <i>30</i>
4	1	AIR CON GAS <i>ne</i>		\$ 80.00 <i>✓</i>
5	1	RADIATOR COOLANT <i>ne</i>		\$ 60.00 <i>50</i>
6	1	ADBLUE <i>ne</i>		\$ 50.00 <i>40</i>
			SUB TOTAL	\$ 340.00
			TOTAL PARTS COST	\$ 17,395.50

Our Ref: **GBL212T**

S/NO	DESCRIPTION	EST. BY WORKSHOP
	LABOUR & PAINTWORK	
1	REMOVE, REFIT AND REPAIR AFFECTED DAMAGED PARTS	\$ 1000 <i>1,200.00</i>
2	TO REMOVE & REFIT AIR CON CONDENSER, PIPES & VACUUM, INCLUDING RECHARGING GAS	\$ 100 <i>150.00</i>
3	SIMPLE WIRING	\$ 20.00 <i>✓</i>
4	TO REMOVE & REFIT ENGINE TO FACILITATE REPAIR & REPLACED ENGINE MOUNTING RH <i>✓</i>	\$ 200 <i>350.00</i>
5	TO REPAIR & WELD FRONT CHASSIS RH & LH	\$ 200 <i>300.00</i>
6	ANTI RUST COATING	\$ 40 <i>60.00</i>
7	PAINT MATERIALS PER PANEL	\$ 1000 <i>1,200.00</i>
8	SUNDRIES	\$ 30 <i>60.00</i>
	TOTAL BEFORE GST	\$ 20,735.50
	LESS EXCESS	\$ -
	TOTAL BEFORE GST	\$ 20,735.50
	7% GST	\$ 1,451.49
	TOTAL REPAIR COST	\$ 22,186.99

Adjustments / Recommendations

Our estimator have thoroughly inspected each and every item on the estimate against physical damage found on the vehicle and have listed the breakdown of our finding and recommendation.

****This estimate is based on visual inspection of the affected vehicle. Should we require further labour charges & spare parts in the process of repairs, we shall inform you accordingly.**

*****On a separate note, please let us have your authorize repair confirmation and/or approval for the above OD case in your next reply.**

Yours Faithfully,

Jason Heng
Claims Director

- LKK Auto Consultants hence notify the Repairer of the following:
- To resurvey before/after spray painting
 - To display damaged part(s) during resurvey
 - Parts prices are subject to confirmation
 - Third party survey is on a "Without Prejudice" basis
 - No illegal modification(s) is allowed
 - Supplementary item(s) must be resurveyed and is subject to final approval from Insurance Company

Acknowledged by Repairer
Signature:
Date:

Rahul
Hf 2001.00 68
9 days
13/05/22 @ 1500
EXCESS: TBA
Revet
Resy before paint

SINGAPORE ACCIDENT STATEMENT

IMPORTANT NOTICE

1. Please report correctly the details of the accident to speed up the claims process.
2. This Form must be completed by the Policyholder and/or the Authorised Driver
3. Information provided must be as truthful and accurate as possible. Any wilful misrepresentation or withholding of material facts may allow insurance companies to repudiate policy liability.
4. The issue and acceptance of this Form by insurance companies is not an admission of policy liability on the part of the insurance companies.
5. Any false reporting may be referred to the Police for investigation.
6. This report will be forwarded by the insurers of the GIA Records Management Centre established by the General Insurance Association of Singapore (GIA) for archiving and that copies of this report will, for a fee, be made available upon application by interested parties.
7. By the lodgement of this report to the insurers, you hereby consent to the archiving of this report at the centre and to copies of the report being made available aforesaid.

ACCIDENT STATEMENT

Date of Submission	06/05/2022 16:11 (SGT)
Date of Accident	30/04/2022 16:40 (SGT)
Exact Location of Accident	MCE, Singapore
Additional Location Information	EXIT TOWARDS AYE
Country/State of Loss	Singapore

DETAILS OF OWN VEHICLE

Vehicle Registration Number GBL212T

INSURED/POLICYHOLDER

Is company?	Yes
Name Of Registered Owner	SKYLINK VEHICLE RENTAL PTE LTD
Company Reg No	2XXXXX755G
Email Address	YVETTE@SKYLINK.COM.SG
Mobile Phone No	(Phone) +65-92335098
Alternative Phone No	+65-92335098

VEHICLE PARTICULARS

Manufacturer	Volkswagen
Model	Caddy
Variant	MAXI TDI DSG
Exact purpose for which vehicle was being used at time of accident	Employment
Are you claiming under your own insurance policy for repair to your vehicle?	Yes
Vehicle Category	Commercial vehicle
Transmission	Auto
CC	1968

INSURANCE COMPANY

Name of Insurance Company	Allianz Insurance Singapore Pte. Ltd.
Type of Coverage	Comprehensive
Fleet Policy	Yes
Policy Number	SPMF1000000537
Cover Note Number	-

DRIVER

Name of Driver	NIE QIUGUI
NRIC No	SXXXX070I

Date of Birth	14/07/1983
Occupation	Outdoor
Date Of Driving Pass	10/10/2011
Driving experience	10 YEARS AND 6 MONTHS
Gender	Female
Mobile Number	(Phone) +65-97265867
Alt. Phone Number	-
Email Address	YVETTE@SKYLINK.COM.SG
Address	BLK 63 CHAI CHEE ROAD #05-806
Address complement	-
Postcode	S460063
Is the driver the policyholder?	No
If No, Relationship of the Driver with the Insured	Hirer
Does Driver Own Other Vehicles?	No
Vehicle Registration Number of Other Vehicle Owned by Driver	-
Insurance Company of Other Vehicle Owned by Driver	-

GENERAL INFORMATION OF THE ACCIDENT

Type of Accident	Collision - Head to Rear
Weather Conditions	Clear
Road Surface	Dry

OTHER INFORMATION

Was any foreign vehicle involved in the accident?	No
Number of vehicles involved in the accident	2
Was anybody injured in the Accident?	No
Was any injured conveyed to hospital by ambulance?	-
Was any other vehicle or property damaged?	Yes
Number of Passengers (Including Driver)	1
Has the driver been approached by unknown person(s) soliciting/offering accident claims assistance?	No

DETAILS OF POLICE ACTION

Was the accident reported to the police?	No
Was notice of intended Prosecution given?	No
If yes, against whom?	-

CIRCUMSTANCES OF ACCIDENT

REFER TO SKETCH PLAN

ATTACHMENT(S)

Are accident photos available for attachment?	Yes
Was there any video captured by Car Camera?	No
Was there any audio recorded?	No

DETAILS OF OTHER VEHICLE PROPERTY 1

Vehicle Registration Number	-
Vehicle Manufacturer	-
Vehicle Model	-
Vehicle Variant	-
Vehicle Colour	-
Vehicle Category	NA / Unknown
Name of Driver	-
Contact Number	-
Address	-
Address complement	-

Describe Circumstances of the Accident

On 30/09/2022 at about 16:40, I was driving my vehicle (A) along MCE Exit to AYE. The traffic were heavy. The vehicle (B) in front of me suddenly stop. I can not stop in time. So I hit onto the vehicle (B) rear portion. After accident happened, I'm very nervous. I can not recall the vehicle (B) vehicle number.

Declaration

We declare the foregoing particulars are true in every respect



Policyholder's Signature / Date & Time

Driver's Signature (If driver is not the policyholder) / Date & Time

Witnessed by: Following Company Representative

Signature

Allianz Insurance Singapore Pte. Ltd.

CERTIFICATE OF INSURANCE

ROAD TRANSPORT ACT 1987 (MALAYSIA)
 MOTOR VEHICLES (THIRD PARTY RISKS) RULES 1959 (FEDERATION OF MALAYSIA)
 MOTOR VEHICLES (THIRD PARTY RISKS AND COMPENSATION) ACT (CAP. 189 OF THE REVISED EDITION) (REPUBLIC OF SINGAPORE)
 MOTOR VEHICLES (THIRD PARTY RISKS AND COMPENSATION) RULES 1996 (REPUBLIC OF SINGAPORE)
 MOTOR VEHICLES (THIRD PARTY RISKS AND COMPENSATION) RULES, 1960
 OR ANY AMENDMENT, ACT OR ACT PASSED IN SUBSTITUTION THEREOF

Certificate Number	: SPMF1000000537
Date of Issue	: 26 April 2022
Coverage	: COMPREHENSIVE - AUTHORISED WORKSHOP
Policyholder	: SKYLINK VEHICLE RENTAL PTE. LTD
Finance Company	: -
Period of Insurance	: 23 April 2022 To 22 April 2023 (both dates inclusive)
Registration Number	: GBL212T
Chassis Number of Vehicle	: WV1ZZZ2KZLX132312

Persons or Classes of Persons Entitled to Drive*:

- (a) The Policyholder.
- (b) Any other person who is driving on the Policyholder's order or with his/her permission or to whom the vehicle is hired.
- * Provided that the person driving is permitted in accordance with the licensing or other laws or regulation to drive the Motor Vehicle or has been permitted and is not disqualified by order of Court of Law or by reason of any enactment or regulations in that behalf from driving the Motor Vehicle. And provided further that the Motor Vehicle is registered under the Road Traffic Act (Cap 276) (Republic of Singapore) and such registration has not been cancelled at the time of accident loss or damage.

Limitation as to Use[^]:

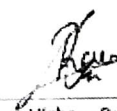
- (a) Use for carriage of passengers or goods in connection with the Policyholder's business.
- (b) Use for social, domestic and pleasure purposes and business purposes of any person to whom the vehicle is hired.
- [^] Limitation rendered inoperative by Section 8 of Motor Vehicles (Third-Party Risks and Compensation) Act (Chapter 189) and Section 95 of the Road Transport Act, 1987 (Malaysia), are not to be included under these headings.

Policy does not cover:

- (a) Use for racing, pace-making, reliability trials or speed-testing.
- (b) Use whilst drawing a trailer except the towing (other than for reward) of any one disabled mechanically propelled vehicle.
- (c) Use for the carriage of passengers for hire or reward by any person to whom the vehicle is hired.

I/We hereby certify that the Policy to which this Certificate relates is issued in accordance with the provisions of the Motor Vehicles (Third Party Risks and Compensation) Act (Chapter 189) and Part IV of the Road Transport Act, 1987 (Malaysia).

26 April 2022
 Issue Date


 Hicham Raissi
 Chief Executive Officer
 Allianz Insurance Singapore Pte. Ltd.

Intermediary Code : 0000161 AON SINGAPORE PTE LTD

> Back to OneMotoring

Enquire PARF/COE Rebate for Registered Vehicle

Vehicle Owner Particulars	
Owner ID Type:	Company
Owner ID:	755G
Vehicle Details	
Vehicle No.:	GBL212T
Vehicle to be Exported:	No
Intended Deregistration Date:	10 May 2022
Vehicle Make:	VOLKSWAGEN
Vehicle Model:	CADDY MAXI TDI DSG
Primary Colour:	White
Manufacturing Year:	2020
Engine No.:	DFS026261
Chassis No.:	WV1ZZZ2KZLX132312
Maximum Power Output:	-
Open Market Value:	\$25,628.00
Original Registration Date:	25 Feb 2021
First Registration Date:	25 Feb 2021
Transfer Count:	0
Actual ARF Paid:	\$1,282.00
Intended PARF Rebate Details	
PARF Eligibility:	No
PARF Eligibility Expiry Date:	-
PARF Rebate Amount:	\$0.00
Intended COE Rebate Details	
COE Expiry Date:	24 Feb 2031
COE Category:	C - Goods Vehicle & Bus
COE Period(Years):	10
PQP Paid:	\$34,359.00
COE Rebate Amount:	\$30,207.00
Total Rebate Amount:	\$30,207.00

The information contained herein is correct as at 10 May 2022

OK

Volkswagen Caddy 2.0A TDI

Overview

Financial

Accessories

Similar

Research

Photos

Map



SKYLINK

YOUR ONE-STOP COMMERCIAL VEHICLE
SOLUTION PROVIDER

Price	\$79,800	Lifespan ⓘ	30-Mar-2041
Depreciation ⓘ	\$8,990 /yr View models with similar depre	Reg Date	31-Mar-2021 (8yrs 10mths 14days COE left)
Mileage	N.A.	Manufactured ⓘ	2020
Road Tax ⓘ	N.A.	Transmission	Auto
Dereg Value ⓘ	\$39,946 as of today (change)	Fuel Type	Diesel
COE ⓘ	\$45,001	OMV ⓘ	\$26,741
Engine Cap	1,968 cc	ARF ⓘ	\$1,338
Curb Weight ⓘ	1,480 kg	No. of Owners ⓘ	2