

ASS. REC. BY:

REF: C12/ CS/CTI22005835/Kqy3Kenneth

ASSIGNMENT

From: _____

Date: _____

Estimated Cost: _____

OD/TP/WS/TP RES/OD RES/EVA/INV/MV

To Inspect Vehicle No: _____

at Workshop m/s _____

of _____

Insured: _____

Policy No. _____

Claims No. SNM22D204152/C01

Sum Insured: _____

Excess: 2K

(Client's Record)

Make of Veh: _____

(Policy Condition)

Remark: The veh had commenced its
repair at the time of inspection.Bal. or Market Value: \$ 43k

IDAC Accident Rpt: _____

Consistent? : Yes or No

GIA / PR Seen: _____

Consistent? : Yes or No

Est. Repairs: 06 days

Res.: Yes or No

Lum Sum: 20 %

3 Val.: Yes or No

CA / REV / REP. / 24 HRS

Date: _____

Person Contacted: _____

Vehicle: IN / OUT

Veh No: GB6 385TYr Regn: 05, 17

Type: M.Car / M.Cycle / Bus / Van / Lorry / Taxi / Prime Mover /

Truck / Trailer or _____

Make: NIS NV200c.c. 1481Colour: Silver

A/C: Insured / Std / NI / NA

Sp. Reading: 141298

T/Radio: Insured / Std / NI / NA

Eng/No: _____

C/No: VSKYBAN 208 0143767Gen. Cond: Good / Fair / Poor / BurntSteering: In order / Jammed / Leaked / Burnt orBrake: In order / Jammed / Leaked / Burnt orModi: Nil / S/Rim / STD A/Rim or

Tyre Size: F: _____

R: Masway 175/70R14

SS / DUN / EXNOVA / GY / FS / LIZA / MIC / OHTSU / PIR / SUMI /

TOYO / YOKO or

Front

R/Bal. 2 mmL/Bal. 3 mmD.O.A. 14/6/22

Survey held at

Des. of Damages: Front / Rear / O/S / N/S / U/C / Rooftop or

The U/C / Chassis frame / Body Structure affected due to collision.

Date / Time

Action / Instruction

20/06/22@4.36pm revert to Jacqueline Tan via Merimen.

27/06/22@11.10am Cecilia Lee informed C/A via Merimen.

27/06/22@12.07pm Informed wksp C/A & ex: \$2000 by email.

Kenneth finalised LS \$3100, 6 days. (Red \$4729.15, 60%)

Date/Time, File Pass to?

☐

: Prel. Report

11/25/07 Typist

☐

: Final Report

Date/Time, File Return to?

2)

Days Of Repair: 6Resurvey No. of Trip: 2

Survey Fee:

Transportation:

S - RS - SI

F - RS

D - RS

Add Fee:

☐

Site Insp (\$

☐

Interview (\$

☐

Tech Invs (\$

☐

Weekend (\$

Report Format: MER-OD

Lump Sum 11.8.1 (\$ 3100

TOTAL

S&H Motor Pte Ltd
160 Sin Ming Drive #07-02
Sin Ming Autocity
Singapore 575722

Insurer Reference:

Repairer Reference: 048453

Date calculated: 18/06/2022 11:53 AM

Full Report

Registration: GBG585T

Printed: 18/06/2022 11:59 AM

Summary Information

Claim

Location:	Singapore (SG)	Work Provider:	China Taiping Insurance (Singapore) Pte Ltd
Printed by:	SH Motor	Currency:	SGD
Claim Reference:		Date of Incident:	14/06/22
Estimated Repair Time:		Hire Car Start:	
Actual Repair Days:		Hire Car End:	

Vehicle Details

Vehicle

Manufacturer:	NISSAN
Model:	NV200 (M20)
Sub Model:	BASE MODEL
Model Sheet Number:	71 89 01
Registration:	GBG585T
VIN number:	VSKYBAM20Z0143767
Odometer:	

Model Specs

FROM 03.2014	AIR CONDITIONING	CENTRAL LOCKING	PAINTED DOOR MIRRORS
ELECT DOOR MIRRORS	NAVIGATION SYSTEM	FOG LAMPS	LOAD COMP COVER LONG
EQUIPMENT UPPER	1461CCM 78/81KW	6-SPEED	EMERGENCY BRAKE SYS
TYRES 225/65 HR 17	WHEELS 5.5J X 14	SPARE WHEEL	CHASSIS JIG CELETTE
PRODUCTION JAPAN	DIESEL PARTICLE FILT	COMBI	REAR WING DOORS
COLD CASE	S/PANEL W/O GLAZING	TWO COAT METALLIC	PREPARE OFF VEHICLE

Not Ashwin
11 Bay 8
McCurry After Paint
Ex @ 2000h
6day

Labour

Code	Description	Time Base 10 WU/h	Price = 42.00 SGD/h	
			WU	Price SGD
NO NUMBER	JOB ALLOWANCE		5.0	21.00
1420B1	RENEW FRONT LOWER CROSSMEMBER INCLUDES: R + R COMPLETE FRONT BUMPER, HEADLAMPS, RADIATOR, CONDENSER AND NECESSARY ATTACHED PARTS, DRAIN + REFILL COOLING SYSTEM AND AIR CONDITIONING		11.0	46.20
1441B1	RENEW FRONT UPPER CROSSMEMBER AND BOTH HEADLAMP PANELS INCLUDES: R + R COMPLETE FRONT BUMPER, FRONT WINGS, WHEELHOUSE LINERS, HEADLAMPS, RADIATOR, CONDENSER AND NECESSARY ATTACHED PARTS, DRAIN + REFILL COOLING SYSTEM AND AIR CONDITIONING,		54.0	226.80

LKK Auto Consultants hence notify
the Repairer of the following:

- To resurvey before/after spray painting
- To display damaged part(s) during resurvey
- Parts prices are subject to confirmation
- Third party survey is on a "Without Prejudice" basis
- No illegal modification(s) is allowed
- Supplementary item(s) must be resurveyed and
is subject to final approval from Insurance Company

Code	Description	WU	Price S
1150A1	ADJUST HEADLAMPS	1.0	4.20
NO NUMBER	RENEW RADIATOR GRILLE (REMOVED)	2.0	8.40
1010A1	ADD/WORK R + R FRONT FOG LAMPS	1.0	4.20
	RENEW COMPLETE FRONT BUMPER (REMOVED)		
	INCLUDES: R + R NECESSARY ATTACHED PARTS, RENEW IF NECESSARY		
2212A1	RENEW BOTH FRONT FOG LAMPS	2.0	8.40
1350A1	RENEW L/HEADLAMP (REMOVED)	1.0	4.20
1350A1	RENEW R/HEADLAMP (REMOVED)	1.0	4.20
0471	BONNET REPAIR	11 10.0*	42.00
0475	L/BONNET HINGE REPAIR	11 5.0*	21.00
0476	R/BONNET HINGE REPAIR	11 5.0*	21.00
0742	R/F WING REPAIR	10 28.0*	84.00
1208	R/F SIDE MEMBER REPAIR	13 30.0*	126.00
Labour Cost		Hrs	WU
Panel / Mechanical Labour		14.80	148.0
Total of Labour			621.60

Paint

Paint Work

SYSTEM AZT

Time Basis 10 WU/h

Code	Description - TWO COAT METALLIC	WU	Price SGD
	FRT BUMPER REINF SURFACE PAINT	4.0	
	L/HEADLAMP SUPPORT SURFACE PAINT	4.0	
	R/HEADLAMP SUPPORT SURFACE PAINT	4.0	
	L/RADIATOR BRACKET SURFACE PAINT	4.0	
	R/RADIATOR BRACKET SURFACE PAINT	4.0	
	TOWING EYE COVER NEW PART PAINT K1G	4.0	
	L/F BUMP CORNER MLDG NEW PART PAINT K1G	6.0	
	R/F BUMP CORNER MLDG NEW PART PAINT K1G	6.0	
	BONNET REPAIR PAINTING <50%	17.0	
	R/F WING REPAIR PAINTING <50%	11.0	
	R/F SIDE MEMBER SURFACE PAINT	4.0	

Paint Material Per Part

Code	Description	Price SGD
0340	FRT BUMPER REINF SURFACE PAINT	4.23
1019	L/HEADLAMP SUPPORT SURFACE PAINT	1.49
1020	R/HEADLAMP SUPPORT SURFACE PAINT	1.49
1023	L/RADIATOR BRACKET SURFACE PAINT	1.49
1024	R/RADIATOR BRACKET SURFACE PAINT	1.49
0299	TOWING EYE COVER NEW PART PAINT K1G	1.13
0357	L/F BUMP CORNER MLDG NEW PART PAINT K1G	9.07
0358	R/F BUMP CORNER MLDG NEW PART PAINT K1G	9.07
0471	BONNET REPAIR PAINTING <50%	30.04
0742	R/F WING REPAIR PAINTING <50%	13.57
1208	R/F SIDE MEMBER SURFACE PAINT	3.98

Labour Cost - Paint

Factor	Hrs	WU	Price SGD
Time Paint	42.00 SGD/h		
Preparation Main Work Metal		68.0	
Preparation Comp. Work Plastic	2.50	25.0	105.00
Total	0.80	8.0	33.60
	10 WU/h	10.10	101.0
			424.20

Material Cost - Paint

	Price SGD
New Part Painting - Plastic K1G	19.27
Repair Painting	43.61
Surface-/Blend Paint	14.17
Material-constant Metal Preparation	28.60
Material-constant Plastic	12.70
Total	118.35

Spare Parts

Code	Description	Part Number	Part Source	prices as at 2015-06-01/01	
					Price SGD
0281	FRONT BUMPER	62022 3LG4H	Original	CD	350.00 ✓
0287	L/F BUMPER BRACKET	62225 BJ00A	Original	B	40.00 ✓
0288	R/F BUMPER BRACKET	62224 BJ00A	Original	B	40.00 ✓
0299	TOWING EYE COVER	622A0 JX00A	Original	MIT	35.00 ✓
0333	FRT BUMPER ABSORBER	62090 JX52C	Original	MIT	180.00 ✓
0340	FRT BUMPER REINF	62030 JX01C	Original	B	390.00 ✓
0357	L/F BUMP CORNER MLDG	62025 JX01A	Original	MIT	85.00 ✓
0358	R/F BUMP CORNER MLDG	62024 JX01A	Original	MIT	85.00 ✓
0410	GRILLE	62310 JX00B	Original	MIT	290.00 ✓
0431	RAD GRILLE BADGE	62889 WB60A	Original	M	75.00 ✓
0492	BONNET LOCK	65601 JX00A	Original	R	60.00 X
0561	LEFT HEADLAMP ASSY	26060 JX31A	Original		295.00 ?
0562	RIGHT HEADLAMP ASSY	26010 JX31A	Original	CM	295.00 ✓
0637	L/F FOG LAMP	26150 8993B	Original	MIT	230.00 ✓
0638	R/F FOG LAMP	26150 8993B	Original	MIT	230.00 ✓
0842	R/F WHEELHOUSE COVER	63840 JX30A	Original	CM	120.00 ✓
1001	FRT LWR CROSSMEMBER	62530 JX00A	Original		350.00 ?
1003	L/F CTR WIND DEFLECT	62821 JX00A	Original	MIT	45.00 ✓
1004	R/F CTR WIND DEFLECT	62820 JX00A	Original	MIT	45.00 ✓
1017	FRT UPP CROSSMEMBER	62511 JX00A	Original		450.00 ?
1019	L/HEADLAMP SUPPORT	62513 JX00A	Original		120.00 ?
1020	R/HEADLAMP SUPPORT	62512 JX00A	Original		120.00 ?
1023	L/RADIATOR BRACKET	62521 JX00A	Original		85.00 ?
1024	R/RADIATOR BRACKET	62520 JX00A	Original		85.00 ?
4469	CONDENSER	92110 JX51A	Original		550.00 ?
4481	COMPR/CONDENSER HOSE	92490 BJ40D	Original	R	130.00 X
4484	COND/EVAPORATOR PIPE	92440 JX51C	Original	R	150.00 X
7761	RADIATOR	21410 JX51A	Original		580.00 ?
7767	ELECTRIC FAN CPL	21480 BJ40A	Original		480.00 ?
7787	EXPANSION TANK	21710 BJ40A	Original	R	130.00 X
8780	FRT ENG COMP PROTECT	62663 5LGOA	Original	CM	120.00 ✓
1000	FRNT GRILLE MOULDING	FRONT GRILLE	Original		110.00 ?

Code	Description	Part Number	Part Source	Price SGD
f: OEM Parts	Savings			0.00
n: Non-OEM Parts	Subtotal			6,350.00
u: Used parts	Total			6,350.00

Extras

Code	Description	Price SGD
1001	ECU diagnostic ECU diagnostic	7 150.00*
1002	Electrical work Electrical work	201 50.00*
1003	Engine coolant Engine coolant	25 - 30.00*
1004	Air con coolant Air con	✓ 50.00*
1005	Front number plate Number Plate	00 - 35.00*
	Total Extras	315.00

Final Calculation

	SGD	SGD
Parts		
Total Parts	6,350.00	6,350.00
Labour Time Base 10 WU/h		
Total 148.0 WU X 42.00 SGD/h	621.60	621.60
Total of Labour		621.60
Total Of Extras		315.00
Paint Work Time Base 10 WU/h		
Labour Cost 101.0 WU X 42.00 SGD/h	424.20	
Material Cost	118.35	
Total Paint Including Material		542.55
Repair Cost Excludes GST		7,829.15
GST (+7.0%)		548.04
Repair Cost Included GST		8,377.19

Comments

- * - USER SUPPLIED DATA
- NN - NO MANUFACTURERS CODE EXISTS
-) - WU PARTIAL INCL IN OTHER POSITIONS

Assessment Note

No assessment notes entered.

SINGAPORE ACCIDENT STATEMENT

IMPORTANT NOTICE

1. Please report correctly the details of the accident to speed up the claims process.
2. This Form must be completed by the Policyholder and/or the Authorised Driver
3. Information provided must be as truthful and accurate as possible. Any wilful misrepresentation or withholding of material facts may allow insurance companies to repudiate policy liability.
4. The issue and acceptance of this Form by insurance companies is not an admission of policy liability on the part of the insurance companies.
5. Any false reporting may be referred to the Police for investigation.
6. This report will be forwarded by the insurers of the GIA Records Management Centre established by the General Insurance Association of Singapore (GIA) for archiving and that copies of this report will, for a fee, be made available upon application by interested parties.
7. By the lodgement of this report to the insurers, you hereby consent to the archiving of this report at the centre and to copies of the report being made available aforesaid.

ACCIDENT STATEMENT

Date of Submission	15/06/2022 16:18 (SGT)
Date of Accident	14/06/2022 10:40 (SGT)
Exact Location of Accident	Bukit Batok East Ave 2, Singapore
Additional Location Information	Bukit Batok East Ave 2 & 5 between signal (near Blk 501)
Country/State of Loss	Singapore

DETAILS OF OWN VEHICLE

Vehicle Registration Number	GBG585T
INSURED/POLICYHOLDER	
Is company?	Yes
Name Of Registered Owner	Autovill Export and Lease
Company Reg No	5XXXX510D
Email Address	kangsheng978@gmail.com
Mobile Phone No	(Phone) +65-90067710
Alternative Phone No	(Home) +65-90067710

VEHICLE PARTICULARS

Manufacturer	Nissan
Model	Nv200
Variant	-
Exact purpose for which vehicle was being used at time of accident	Employment
Are you claiming under your own insurance policy for repair to your vehicle?	Yes
Vehicle Category	Commercial vehicle
Transmission	Auto
CC	1461

INSURANCE COMPANY

Name of Insurance Company	China Taiping Insurance (Singapore) Pte. Ltd.
Type of Coverage	Comprehensive
Fleet Policy	No
Policy Number	DMCVSNA00094542100
Cover Note Number	-

DRIVER

Name of Driver	Mustafa Kamal
Work Permit No	GXXXX069U

SKETCH PLAN

IMPORTANT NOTICE

1. Please report correctly the details of the accident to speed up the claims process.
2. This Form must be completed by the Policyholder and/or the Authorised Driver.
3. Information provided must be as truthful and accurate as possible. Any willful misrepresentation or withholding of material facts may allow insurance companies to repudiate policy liability.
4. The issue and acceptance of this Form by insurance companies is not an admission of policy liability on the part of the insurance companies.
5. Any false reporting may be referred to the Police for investigation.
6. The report will be forwarded by the insurers of the GIA Records Management Centre established by the General Insurance Association of Singapore (GIA) for archiving and that copies of this report will for a fee be made available upon application by interested parties.
7. By the lodgement of this report to the insurers, you hereby consent to the archiving of this report at the centre and to copies of the report being made available aforesaid.

8. Consent under the Personal Data Protection Act (PDPA)

I understand, acknowledge, agree and consent that:

(a) My insurer, my workshop and the General Insurance Association of Singapore ("GIA") may/are permitted to collect, use, disclose and/or process my personal data/personal information set out in this [form] and any other personal information provided by me or possessed by my insurer (collectively the "Personal Information") and disclose and transfer such Personal Information to all insurer(s) who have insured vehicle(s) involved in this accident (all insurer(s) who have insured vehicle(s) involved in this accident shall be collectively referred to as the "Insurers"), the Insurers' lawyers/law firms, the Monetary Authority of Singapore and any relevant government agency/authority (such as the police), for the purpose(s) of:

(i) processing, handling and/or dealing with my claims including the settlement of the claims and any necessary investigations relating to the claims;

(ii) investigating the accident and/or my claims;

(iii) carrying out and/or dealing with my instructions or responding to any enquiries by me;

(iv) administering my claims (including the mailing of correspondence, statements, invoices, reports or notices to me, which could involve disclosure of certain personal data about me to bring about delivery of the same as well as on the external cover of envelopes/letters/packages); and/or

(v) complying with applicable law in administering, processing, handling and/or dealing with my claims.

(collectively the "Purposes")

(b) all insurer(s) who have insured vehicle(s) involved in this accident and the Insurers' lawyers/law firms, may/are permitted to collect, use, disclose and/or process my Personal Information for one or more of the above Purposes; and

(c) my Personal Information may/can be disclosed by any of the Insurers and/or GIA to their third party service providers or agents (including their lawyers/law firms), which may be sited outside of Singapore, for one or more of the above Purposes.


AUTOVILL EXPORT AND LEASE
53417510D

Policyholder's Signature / Date & Time

Driver's Signature (If driver is not the policyholder) / Date & Time

Witnessed by Reporting Centre Personnel

Sketch Plan

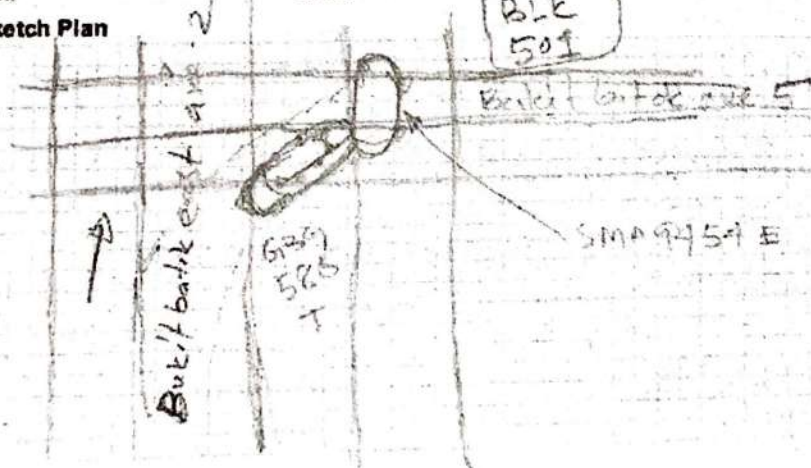

Inquire PARF/COE Rebate for Registered Vehicle

Vehicle Owner Particulars

Owner ID Type: Business

Owner ID: 510D

Vehicle Details

Vehicle No.: GBG585T

Vehicle to be Exported: Yes

Intended Deregistration Date: 15 Jun 2022

Vehicle Make: NISSAN

Vehicle Model: NV200 1.5 MT ABS AIRBAG 2WD 6DR E5 W/RC

Primary Colour: Silver

Manufacturing Year: 2016

Engine No.: K9KC400D056824

Chassis No.: VSKYBAM20Z0143767

Maximum Power Output: -

Open Market Value: \$20,122.00

Original Registration Date: 30 May 2017

First Registration Date: 30 May 2017

Transfer Count: 2

Actual ARF Paid: \$1,007.00

Intended PARF Rebate Details

PARF Eligibility: No

PARF Eligibility Expiry Date: -

PARF Rebate Amount: \$0.00

Intended COE Rebate Details

COE Expiry Date: 29 May 2027

COE Category: C - Goods Vehicle & Bus

COE Period(Years): 10

QP Paid: \$30,600.00

COE Rebate Amount: \$15,160.00

Total Rebate Amount: \$15,160.00

The information contained herein is correct as at 15 Jun 2022

OK