

ASS. REC. BY:

REF:

012 / 22 006258 / K943

C

Kenneth

ASSIGNMENT

From:

Date:

Estimated Cost:

OD / TP / WS / TP RES / OD RES / EVA / INV / MV

To Inspect Vehicle No:

at Workshop m/s

of

Insured:

Policy No.

Claims No.

Sum Insured:

Excess:

(Client's Record)

Make of Veh:

(Policy Condition)

Remark: The veh had commenced its
repair at the time of inspection.

☒	☒
N/S	O/S
☐	☐

Bal. or Market Value:

\$109K

IDAC Accident Rpt:

Consistent? : Yes or No

GIA / PR Seen:

Consistent? : Yes or No

Est. Repairs:

08

days

Res.: Yes or No

Lum Sum:

1.31

%

3 Val.: Yes or No

CA / REV / REP. / 24 HRS

Date:

Person Contacted:

Vehicle: IN / OUT

Veh No:

SMI-8348P

Yr Regn:

10, 15

Type: M.Car / M.Cycle / Bus / Van / Lorry / Taxi / Prime Mover /

Truck / Trailer or

Make:

BMW X4

c.c

2979

Colour

h. P. White

A/C:

Insured / Std / NI / NA

Sp. Reading

108217

T/Radio:

Insured / Std / NI / NA

Eng/No:

C/No:

WBAXW 520700 F90320

Gen. Cond: Good / Fair / Poor / Burnt

Steering: In order / Jammed / Leaked / Burnt or

Brake: In order / Jammed / Leaked / Burnt or

Mod: NII / S/Rim / STD A/Rim or

Tyre Size:

F:

245/45R19

R:

275/40R19

BS / DUN / EXNOVA / GY / FS / LIZA / MIC / OHTSU / PIR / SUMI /
TOYO / YOKO or

Front

Rear

R/Bal.

4

mm

R/Bal.

4

mm

L/Bal.

4

mm

L/Bal.

4

mm

D.O.A.

26/6/22

D.O.I.

30/6/2022

Survey held at

Des. of Damages: Frt / Rear / O/S / N/S / UIC / Rooftop or

The UIC / Chassis frame / Body Structure affected due to collision.

Date / Time

Action / Instruction

17/4 @ 2,157.86 Cdn

24/4/23 @ 4.12pm re-analysed final fig 821097.16 (Red 81312.13, 67.7)
(No Lump Sum)

Date/Time, File Pass to?

☐

: Prell. Report

1) 25/4 Kenneth

☐

: Final Report

Date/Time, File Return to?

Days Of Repair:

8

Resurvey No. of Trip:

2

Survey Fee:

Transportation:

S + RS, SI

Fees

Others

TOTAL

Add Fee:

☐

: Site Insp (\$

☐

: Interview (\$

☐

Tech Invs (\$

☐

Weekend (\$

Report Format :

MER-PD

Lump Sum / I.B.I. (\$

21097.16

Cheng Hoe Motor Pte Ltd
#01-374/382,Blk 1019, Yishun
Industrial Park A
768761

Insurer Reference: SMF8346P

Repairer Reference: a0313

Date calculated: 29/06/2022 2:00 PM

Full Report

Registration: SMF8346P

Printed: 29/06/2022 2:01 PM

Summary Information

Claim

Location:	Singapore (SG)	Work Provider:	China Taiping Insurance (Singapore) Pte Ltd
Printed by:	CHENG HOE	Currency:	SGD
Claim Reference:	SMF8346P	Date of Incident:	26/06/22
Estimated Repair Time:	10	Hire Car Start:	
Actual Repair Days:		Hire Car End:	

Vehicle Details

Vehicle

Manufacturer:	BMW
Model:	X4(F26)
Sub Model:	XDRIVE 35I
Model Sheet Number:	01 X4 02
Registration:	SMF8346P
VIN number:	WBAXW520700F90320
Odometer:	0

Model Specs

FROM 07.2015	SHELF PACKAGE	AIR CON AUTO 1-ZONE	EMISSION STD EURO 5
WINDSCREEN RAIN SENS	COMFORT ACCESS SYST	LIGHT PACKAGE-APRON	DIP REAR VIEW MIRROR
COMFORT TELEPHONE	TELESSERVICE	NAVIG SYSTEM PROFESS	SURROUND SOUND SYS
LED FOG LAMPS	HIGH BEAM ASSISTANT	LED HEADLAMP	HEADLAMP WASHERS
LEATHER TRIM	FRT SPORT SEATS	ELEC/SEAT ADJ MEMORY	LUMBAR SUPPORT
ALARM SWITCH	ACTIVE CRUISE CONTR	HEAD-UP DISPLAY	DIP REAR VIEW MIRROR
FRT/RR PARK DIST CON	REARVIEW CAMERA	SURROUND VIEW	3.0 LTR 225 KW
MULTI FUNC S-WHEEL	8-GEAR AUTOMATIC	DYN DAMPER CONTROL	STOP-START SYSTEM
245/45-/275/40 R19 Y	WHEEL8.5/9.5JX19 ALU	INT MOULDINGS ALUMIN	INT MOULDING BLACK
ELECTRIC SUNROOF	EQUIPMENT XLINE	VERSION HOT COUNTRY	TYRE W/FLAT RUNNING
PREPARE OFF VEHICLE	CLEAR COAT HARD	3 COAT METALLIC	

*Not Notified
Repair B4 repair
Ex \$5000
8 days*

Vehicle Condition


Vehicle Status

Pre-Accident Damage: VEHICLE IN AMK

Date of Inspection:

Damage Areas

All ☐
Underbody ☐

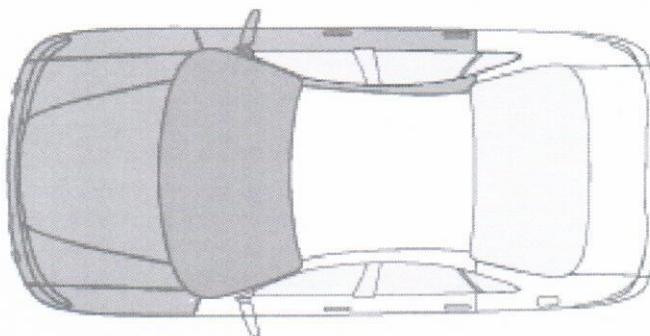

Tyres Condition

Tyre Brand	Tread (Left Middle), mm	Tread (Left Outer), mm	Tread (Left Inner), mm	Tread (Right Inner), mm	Tread (Right Outer), mm	Tread (Right Middle), mm	Condition
------------	-------------------------	------------------------	------------------------	-------------------------	-------------------------	--------------------------	-----------

Spare Tyre Brand Tread (Spare), mm

Labour

Code	Description	Time Base 12 WU/h	Price = 42.00 SGD/h	
			WU	Price SGD
41 35 550	RENEW L/F WING INCLUDES: R + R WHEELARCH TRIM, SIDE INDICATOR AND A-PILLAR MOULDING		8.0	28.00
41 33 040	RENEW FRONT PANEL INCLUDES: R + R BUMPER CARRIER AND BOTH HEADLAMP MOUNTS		30.0	105.00
51 23 711)	R + R BONNET CABLE		1.0	3.50
51 11 675	RENEW COMPLETE FRONT BUMPER COVER (FRONT BUMPER REMOVED)		13.0	45.50
66 20 610	ADD/WORK PARK DISTANCE CONTROL		1.0	3.50
63 17 751)	RENEW L/F FOG LAMP (REMOVED)		1.0	3.50
63 12 648	RENEW HEADLAMPS (REMOVED)		6.0	21.00
51 71 538	R + R R/F WHEELHOUSE COVER FRONT		4.0	14.00
41 61 600	R + R BONNET		4.0	14.00
41 61 501	REPLACE BONNET (WITH BONNET REMOVED)		9.0	31.50
41 61 563	RENEW L/BONNET HINGE (BONNET REMOVED)		2.0	7.00

Code	Description	WU	Price SGD
41 61 564	RENEW R/BONNET HINGE (BONNET REMOVED)	2.0	7.00
51 31 511	RENEW WINDSCREEN	25.0	87.50
NO NUMBER	R + R CONDENSER-/EVAPORATOR PIPE	4.0	14.00
64 50 509	DRAIN/REFILL AIR CONDITIONING	6.0	21.00
17 11 510	R + R RADIATOR	13.0	45.50
17 11 656)	R + R RADIATOR SUPPORT	3.0	10.50
64 53 550)	R + R AIR CONDITIONING CONDENSER	3.0	10.50
11 53 762	RENEW LOWER WATER HOSE	2.0	7.00
11 53 765	R + R UPPER WATER HOSE	1.0	3.50
00 00 556	VEHICLE CHECK (BY VEHICLE DIAGNOSTIC SYSTEM)	2.0	7.00
61 00 730	PROGRAM AND CODE CONTROL UNIT/S (AFTER VEHICLE TEST)	4.0	14.00
66 51 526	CALIBRATE CAMERA ASSISTANCE SYSTEMS (FOR VEHICLE TEST)	1.0	3.50
9852	FAULT MEM AFTER REP READ OUT	30 40.0*	140.00
0742	R/F WING REPAIR	10.0* ✓	35.00
Labour Cost		Hrs	WU
Panel / Mechanical Labour		16.30	195.0
Total of Labour			682.50

Paint

Paint Work		Time Basis 12 WU/h	
Code	Description - 3 COAT METALLIC	WU	Price SGD
99 68 920	FRONT BUMPER COVER PAINTING STAGE 2	19.0	66.50
LE 0284	LOWER BUMPER COVER PAINTING STAGE 2	10.0	35.00
LE 0309	FRONT BUMPER TRIM PAINTING STAGE 2	7.0	24.50
LE 0343	L/OUT U-SONIC SENDER PAINTING STAGE 2	1.0	3.50
LE 0345	L/INN U-SONIC SENDER PAINTING STAGE 2	1.0	3.50
LE 0346	R/INN U-SONIC SENDER PAINTING STAGE 2	1.0	3.50
99 61 830	BONNET PAINTING STAGE 2	32.0	112.00
99 35 850	L/F WING PAINTING STAGE 2	14.0	49.00
LE 0787	L/F WHEELARCH TRIM PAINTING STAGE 2	9.0	31.50
99 35 860	R/F WING PAINTING STAGE 3	21.0	73.50
L 0313	FRT TOWING EYE COVER PAINTING STAGE 1	1.0	3.50
L 0344	R/OUT U-SONIC SENDER PAINTING STAGE 1	1.0	3.50
99 51 820	LEFT FRONT DOOR PAINTING STAGE 1	14.0	49.00
99 99 000	ADDITIONAL TIME FOR ONE MAIN WORK INCLUDES: MIX COLOUR AND SPRAY COLOUR SAMPLE	22.0	77.00

Total Paint	Hrs	WU	Price SGD
	12.80	153.0	535.50

Material Cost - Paint
 New Part Painting
 Repair Painting
 Surface-/Blend Paint
 Material-constant Metal
Total

Price SGD
 225.00
 20.79
 25.38
 13.47
 284.64

Spare Parts

				prices as at 2022-06-16	
Code	Description	Part Number	Part Source	Price SGD	
0471	BONNET	41 61 7 267 337	Original	B ₁	1,250.00 ✓
0463	BUFFER STOP	51 23 7 162 448	Original	SWE	22.00 ✗
0464	BUFFER STOP	51 11 7 272 751	Original	SWE	22.00 ✗
1414	CLEANER R1 FRT SCRIN	83 19 2 211 217		na	26.15 ✗
4483	COND/EVAPORATOR PIPE	64 53 9 228 234	Original	su	270.00 ✗
4465	CONDENSER	64 53 9 216 143	Original	pu	690.00 ✓
1326	COWL PANEL INSUL	51 48 7 268 477	Original	su	50.00 ✗
7789	ELECTRIC FAN CPL	17 42 7 560 877	Original	cm	970.00 ✗
0499	FRONT BONNET CABLE	51 23 7 210 735	Original	cm	55.00 ✗
0283	FRONT BUMPER COVER	51 11 7 389 911	Original	Tr	1,050.00 ✓
0336	FRONT BUMPER SUPPORT	51 11 2 575 934	Original	360 ✓ B ₁	290.00 ✓
0309	FRONT BUMPER TRIM	51 11 7 413 498	Original	O/I	290.00 ✓
0305	FRONT LWR AIR GRILLE	51 11 7 338 475	Original	su	95.00 ✗
0257	FRONT NUMBER PLATE	KNPL3	Original	SN B ₁	35.00 ✓
1009	FRONT PANEL	51 74 7 210 476	Original	Bux	370.00 ✓
1415	FRONT SCREEN CLIP	51 13 7 232 420		na	14.70 ✗
1416	FRONT SCREEN CLIP	51 13 7 379 033		na	25.50 ✗
1418	FRONT SCREEN CLIP	51 31 7 255 727		na	8.90 ✗
1421	FRONT SCREEN CLIP	51 31 7 338 613		na	5.80 ✗
1422	FRONT SCREEN CLIP	51 31 7 338 614		na	5.80 ✗
1423	FRONT SCREEN COVER	51 31 7 338 603		50 - LPA na	41.60 ✗
0303	FRONT UPP AIR GRILLE	51 11 7 338 492	Original	CM	75.00 ✗
9578	FRONT WIRING	61 12 9 335 481	Original	? CM	360.00 ✗
1017	FRT CONNECTING STRUT	51 64 7 210 501	Original	CM	150.00 ✗
0260	FRT NO PLATE BRKT	51 11 7 338 529	Original	Red	80.00 ✓
1419	FRT ROUND BUFFER	51 31 1 925 433		su	11.20 ✗
1420	FRT SQUARE BUFFER	51 31 2 996 980		su	16.00 ✗
0340	FRT UPP IMPACT DAMP	51 11 7 338 525	Original	CM	70.00 ✗
0431	GRILLE BADGE	51 14 8 132 375	Original	su	85.00 ✗
9645	HIGH TONE HORN	61 33 7 217 703	Original	pu	75.00 ✗
8727	INTERCOOLER	17 51 7 593 845	Original	O/I	600.00 ✗
0475	L/BONNET HINGE	41 61 7 262 875	Original	B ₁	82.00 ✓
0503	L/BONNET LOCK	51 23 7 224 883	Original	B ₁	70.00 ✓
0307	L/BUMPER AIR GRILLE	51 11 7 348 109	Original	CM	78.00 ✗
0337	L/C-MEMBER BRACKET	51 11 7 276 426	Original	O/I	45.00 ✗
0497	L/F BONNET STRUT	51 23 7 210 727	Original	pu	95.00 ✗
0291	L/F BUMPER BRACKET	51 11 7 308 081	Original	bi	32.00 ✗
0329	L/F DEFORMATION ELEM	51 64 7 274 657	Original	CM	105.00 ✗
0637	L/F FOG LAMP	63 17 7 317 251	Original	my CM	320.00 ✗
0415	L/F GRILLE	51 13 7 367 421	Original	na	105.00 ✗
0577	L/F LED INDICATOR	63 11 7 406 357	Original	CM	120.00 ✗
9665	L/F LED LIGHT MODULE	63 11 7 354 974	Original	su	390.00 ✗
1019	L/F PANEL SUPPORT	51 64 7 210 503	Original	160 B ₁	65.00 ✓
0625	L/F WASHER JET	61 67 7 357 001	Original	CM	150.00 ✗

Code	Description	Part Number	Part Source	Price SGD
0787	L/F WHEELARCH TRIM	51 77 7 210 081	Original	Dir 145.00 ✓
0841	L/F W-HOUSE CVR FRT	51 71 7 213 641	Original	CM 120.00 ✓
0741	L/F WING	41 35 7 267 323	Original	Bu 510.00 ✓
9667	L/HEADLAMP MODULE	63 11 7 427 616	Original 720 ✓	Del 520.00 ✓
1187	L/HEADLAMP MOUNTING	51 64 7 210 499	Original	Short 170.00 ✓
0345	L/INN U-SONIC SENDER	66 20 9 274 428	Original	Short 175.00 ✓
0343	L/OUT U-SONIC SENDER	66 20 9 274 428	Original	Short 175.00 ✓
7769	L/RADIATOR BRACKET	17 11 7 593 838	Original	CM 75.00 ✓
0491	L/UPPER LOCK	51 23 7 210 733	Original	Dir 48.00 ✓
0633	L/WASHER NOZZLE TRIM	SEE GUIDE NO. 0635	Original	CM 85.00 ✓
0495	LEFT ADJUSTER	51 76 7 183 752	Original	CM 26.00 ✓
0561	LEFT HEADLAMP ASSY	63 11 7 401 145	Original	Bro 2,850.00 ✓
0284	LOWER BUMPER COVER	51 11 7 389 904	Original	CM Bu 330.00 ✓
9646	LOW TONE HORN	61 33 7 217 702	Original	Sm 75.00 ✓
7773	LWR RADIATOR HOSE	17 12 7 646 151	Original	Sm 105.00 ✓
0476	R/BONNET HINGE	41 61 7 262 876	Original	Dir 82.00 ✓
0504	R/BONNET LOCK	51 23 7 224 883	Original	Bu 70.00 ✓
0326	R/F AIR DUCT	51 74 7 338 578	Original	Sm 85.00 ✓
0498	R/F BONNET STRUT	51 23 7 210 727	Original	Pu 95.00 ✓
0416	R/F GRILLE	51 13 7 367 422	Original	CM 105.00 ✓
1020	R/F PANEL SUPPORT	51 64 7 210 504	Original 160 ✓	Bu 65.00 ✓
0346	R/INN U-SONIC SENDER	66 20 9 274 428	Original	Short 175.00 ✓
7770	R/RADIATOR BRACKET	17 11 7 593 839	Original	CM 75.00 ✓
0492	R/UPPER LOCK	51 23 7 210 734	Original	Dir 48.00 ✓
7761	RADIATOR	17 11 8 623 350	Original	Pu 790.00 ✓
0496	RIGHT ADJUSTER	51 76 7 183 752	Original	CM 26.00 ✓
0562	RIGHT HEADLAMP ASSY	63 11 7 401 146	Original	mg CM 2,850.00 ✓
1018	RR CONNECTING STRUT	51 64 7 210 502	Original	CM 190.00 ✓
0481	SOUND INSULATION	51 48 9 175 051	Original	Dehum 190.00 ✓
0623	TUBE	61 67 7 357 005	Original	CM 70.00 ✓
7776	UPPER RADIATOR HOSE	17 12 7 646 150	Original	Sm 90.00 ✓
1401	WINDSCREEN	51 31 7 337 767	Original	CM 750.00 ✓
1411	WINDSCREEN BOND KIT	83 19 2 289 285	Original SN	Re 40.00 ✓

f: OEM Parts
n: Non-OEM Parts
u: Used parts

Savings	0.00
Subtotal	19,971.65
Fixed Sundry Parts Price	100.00
Total	20,071.65

Extras

Code	Description	Price SGD
1000	WS GLASS SENSOR TAPE	Re 40.00* ✓
1001	AC GAS	Re 50.00* ✓
1002	COOLANT X 2L	Re 40.00* ✓
Total Extras		130.00

Final Calculation

	SGD	SGD
Parts	19,971.65	
Fixed Sundry Parts Price	100.00	
Total Parts		20,071.65
Labour Time Base 12 WU/h		
Total 195.0 WU X 42.00 SGD/h	682.50	
Total of Labour		682.50
Total Of Extras		130.00
Paint Work Time Base 12 WU/h		
Labour Cost 153.0 WU X 42.00 SGD/h	535.50	
Material Cost	284.64	
Total Paint Including Material		820.14
Repair Cost Excludes GST		21,704.29
GST (+7.0%)		1,519.30
Repair Cost Included GST		23,223.59

Comments

* - USER SUPPLIED DATA
NN - NO MANUFACTURERS CODE EXISTS
) - WU PARTIAL INCL IN OTHER POSITIONS

Assessment Note

No assessment notes entered.

22409.27

Cheng Hoe Motor Pte Ltd
#01-374/382, Blk 1019, Yishun
Industrial Park A
768761

EMAILED ON 05/08/22

Insurer Reference: SMF8346P
Repairer Reference: A0313
Date calculated: 26/07/2022 8:23 AM

Full Report
Registration: SMF8346P
Printed: 26/07/2022 8:23 AM

Summary Information

Claim

Location:	Singapore (SG)	Work Provider:	China Taiping Insurance (Singapore) Pte Ltd
Printed by:	CHENG HOE	Currency:	SGD
Claim Reference:	SMF8346P	Date of Incident:	26/06/22
Estimated Repair Time:	10	Hire Car Start:	
Actual Repair Days:		Hire Car End:	

Vehicle Details

Vehicle

Manufacturer:	BMW
Model:	X4(F26)
Sub Model:	XDRIVE 35I
Model Sheet Number:	01 X4 02
Registration:	SMF8346P
VIN number:	WBAXW520700F90320
Odometer:	0

Model Specs

FROM 07.2015	SHELF PACKAGE	AIR CON AUTO 1-ZONE	EMISSION STD EURO 5
WINDSCREEN RAIN SENS	COMFORT ACCESS SYST	LIGHT PACKAGE-APRON	DIP REAR VIEW MIRROR
COMFORT TELEPHONE	TELESSERVICE	NAVIG SYSTEM PROFESS	SURROUND SOUND SYS
LED FOG LAMPS	HIGH BEAM ASSISTANT	LED HEADLAMP	HEADLAMP WASHERS
LEATHER TRIM	FRT SPORT SEATS	ELEC/SEAT ADJ MEMORY	LUMBAR SUPPORT
ALARM SWITCH	ACTIVE CRUISE CONTR	HEAD-UP DISPLAY	DIP REAR VIEW MIRROR
FRT/RR PARK DIST CON	REARVIEW CAMERA	SURROUND VIEW	3.0 LTR 225 KW
MULTI FUNC S-WHEEL	8-GEAR AUTOMATIC	DYN DAMPER CONTROL	STOP-START SYSTEM
245/45-/275/40 R19 Y	WHEEL8.5/9.5JX19 ALU	INT MOULDINGS ALUMIN	INT MOULDING BLACK
ELECTRIC SUNROOF	EQUIPMENT XLINE	VERSION HOT COUNTRY	TYRE W/FLAT RUNNING
PREPARE OFF VEHICLE	CLEAR COAT HARD	3 COAT METALLIC	

Vehicle Condition


Vehicle Status

Pre-Accident Damage: VEHICLE IN AMK

Date of Inspection:

Damage Areas

All ☐
Underbody ☐

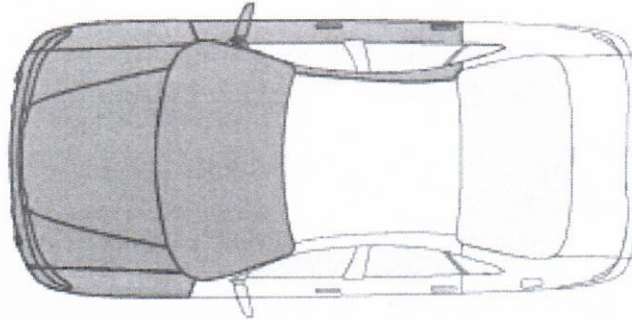

Tyres Condition

Tyre Brand	Tread (Left Middle), mm	Tread (Left Outer), mm	Tread (Left Inner), mm	Tread (Right Inner), mm	Tread (Right Outer), mm	Tread (Right Middle), mm	Condition
------------	-------------------------	------------------------	------------------------	-------------------------	-------------------------	--------------------------	-----------

Spare Tyre Brand	Tread (Spare), mm
------------------	-------------------

Labour

Code	Description	Time Base 12 WU/h	Price = 42.00 SGD/h	
			WU	Price SGD
41 35 550	RENEW L/F WING INCLUDES: R + R WHEELARCH TRIM, SIDE INDICATOR AND A-PILLAR MOULDING	8.0		28.00
41 33 040	RENEW FRONT PANEL INCLUDES: R + R BUMPER CARRIER AND BOTH HEADLAMP MOUNTS	30.0		105.00
51 23 711)	R + R BONNET CABLE	1.0		3.50
51 11 675	RENEW COMPLETE FRONT BUMPER COVER (FRONT BUMPER REMOVED)	13.0		45.50
66 20 610	ADD/WORK PARK DISTANCE CONTROL	1.0		3.50
63 17 751)	RENEW L/F FOG LAMP (REMOVED)	1.0		3.50
63 12 648	RENEW HEADLAMPS (REMOVED)	6.0		21.00
41 61 600	R + R BONNET	4.0		14.00
41 61 501	REPLACE BONNET (WITH BONNET REMOVED)	9.0		31.50
41 61 563	RENEW L/BONNET HINGE (BONNET REMOVED)	2.0		7.00
41 61 564	RENEW R/BONNET HINGE	2.0		7.00

Code	Description	WU	Price SGD
	(BONNET REMOVED)		
51 31 511	RENEW WINDSCREEN	25.0	87.50
64 50 509	DRAIN/REFILL AIR CONDITIONING	6.0	21.00
17 11 510	R + R RADIATOR	13.0	45.50
17 11 656)	R + R RADIATOR SUPPORT	3.0	10.50
17 22 510)	R + R AUTOMATIC GEARBOX OIL COOLER	4.0	14.00
64 53 550)	R + R AIR CONDITIONING CONDENSER	3.0	10.50
00 00 556	VEHICLE CHECK	2.0	7.00
	(BY VEHICLE DIAGNOSTIC SYSTEM)		
61 00 730	PROGRAM AND CODE CONTROL UNIT/S	4.0	14.00
	(AFTER VEHICLE TEST)		
66 51 526	CALIBRATE CAMERA ASSISTANCE SYSTEMS	1.0	3.50
	(FOR VEHICLE TEST)		
9852	FAULT MEM AFTER REP READ OUT	30.0*	105.00
0742	R/F WING REPAIR	10.0*	35.00
Labour Cost		Hrs	WU
Panel / Mechanical Labour		14.80	178.0
Total of Labour			623.00

Paint

Paint Work		Time Basis 12 WU/h	
Code	Description - 3 COAT METALLIC	WU	Price SGD
99 68 920	FRONT BUMPER COVER PAINTING STAGE 2	19.0	66.50
LE 0284	LOWER BUMPER COVER PAINTING STAGE 2	10.0	35.00
LE 0343	L/OUT U-SONIC SENDER PAINTING STAGE 2	1.0	3.50
LE 0345	L/INN U-SONIC SENDER PAINTING STAGE 2	1.0	3.50
LE 0346	R/INN U-SONIC SENDER PAINTING STAGE 2	1.0	3.50
99 61 830	BONNET PAINTING STAGE 2	32.0	112.00
99 35 850	L/F WING PAINTING STAGE 2	14.0	49.00
LE 0787	L/F WHEELARCH TRIM PAINTING STAGE 2	9.0	31.50
99 35 860	R/F WING PAINTING STAGE 3	21.0	73.50
L 0309	FRONT BUMPER TRIM PAINTING STAGE 1	5.0	17.50
L 0313	FRT TOWING EYE COVER PAINTING STAGE 1	1.0	3.50
L 0344	R/OUT U-SONIC SENDER PAINTING STAGE 1	1.0	3.50
99 51 820	LEFT FRONT DOOR PAINTING STAGE 1	14.0	49.00
99 99 000	ADDITIONAL TIME FOR ONE MAIN WORK INCLUDES: MIX COLOUR AND SPRAY COLOUR SAMPLE	22.0	77.00

Total Paint	Hrs	WU	Price SGD
	12.60	151.0	528.50

Material Cost - Paint	Price SGD
New Part Painting	212.00
Repair Painting	20.79
Surface-/Blend Paint	32.40
Material-constant Metal	13.47
Total	278.66

Spare Parts

				prices as at 2022-07-18	
Code	Description	Part Number	Part Source	Price SGD	
8406	AIR INTAKE GRILLE	13 71 7 811 020	Supplementary (h)	CM 15.00	✓
0471	BONNET	41 61 7 267 337	Original	1,250.00	
1414	CLEANER R1 FRT SCRIN	83 19 2 211 217	Original	0.00	
4465	CONDENSER	64 53 9 216 143	Original	690.00	
1326	COWL PANEL INSUL	51 48 7 268 477	Original	0.00	
7789	ELECTRIC FAN CPL	17 42 7 560 877	Original	970.00	
0499	FRONT BONNET CABLE	51 23 7 210 735	Original	55.00	
0283	FRONT BUMPER COVER	51 11 7 389 911	Original	1,050.00	
0336	FRONT BUMPER SUPPORT	51 11 2 575 934	Original PRICE ADJUSTMENT	360.00	✓
A 0305	FRONT LWR AIR GRILLE	51 11 7 338 475	Original	95.00	
0257	FRONT NUMBER PLATE	KNPL3	Original SN	35.00	-
1009	FRONT PANEL	51 74 7 210 476	Original	370.00	
1415	FRONT SCREEN CLIP	51 13 7 232 420		14.70	X
1416	FRONT SCREEN CLIP	51 13 7 379 033		25.50	X
1418	FRONT SCREEN CLIP	51 31 7 255 727		8.90	X
1421	FRONT SCREEN CLIP	51 31 7 338 613		5.80	X
1422	FRONT SCREEN CLIP	51 31 7 338 614		5.80	X
1423	FRONT SCREEN COVER	51 31 7 338 603	Supplementary	CM 50.00	✓
0303	FRONT UPP AIR GRILLE	51 11 7 338 492	Original	75.00	
9578	FRONT WIRING	61 12 9 335 481	Original	360.00	
1017	FRT CONNECTING STRUT	51 64 7 210 501	Original	150.00	
0260	FRT NO PLATE BRKT	51 11 7 338 529	Original	80.00	
1419	FRT ROUND BUFFER	51 31 1 925 433	Original	0.00	
1420	FRT SQUARE BUFFER	51 31 2 996 980	Original	0.00	
0340	FRT UPP IMPACT DAMP	51 11 7 338 525	Original	70.00	
8888	GEARBOX OIL COOLER	17 21 7 593 856	Supplementary (h)	Pu 510.00	✓
0431	GRILLE BADGE	51 14 8 132 375	Original	85.00	
8405	INLET FLANGE AIR FIL	13 71 7 601 869	Supplementary (h)	CM 40.00	✓
8727	INTERCOOLER	17 51 7 593 845	Original	600.00	
0475	L/BONNET HINGE	41 61 7 262 875	Original	82.00	
0503	L/BONNET LOCK	51 23 7 224 883	Original	70.00	
0307	L/BUMPER AIR GRILLE	51 11 7 348 109	Original	78.00	
0337	L/C-MEMBER BRACKET	51 11 7 276 426	Original	45.00	
0497	L/F BONNET STRUT	51 23 7 210 727	Original	95.00	
0291	L/F BUMPER BRACKET	51 11 7 308 081	Original	32.00	
0329	L/F DEFORMATION ELEM	51 64 7 274 657	Original	105.00	
0637	L/F FOG LAMP	63 17 7 317 251	Original	320.00	
0415	L/F GRILLE	51 13 7 367 421	Original	105.00	
1019	L/F PANEL SUPPORT	51 64 7 210 503	Original PRICE ADJUSTMENT	160.00	✓
0595	L/F S/PANEL BRKT FRT	41 35 7 267 327	Supplementary (h)	R 140.00	✓
0625	L/F WASHER JET	61 67 7 357 001	Original	150.00	
0787	L/F WHEELARCH TRIM	51 77 7 210 081	Original	145.00	
0841	L/F W-HOUSE CVR FRT	51 71 7 213 641	Original	120.00	
0741	L/F WING	41 35 7 267 323	Original	510.00	
9667	L/HEADLAMP MODULE	63 11 7 427 616	Original PRICE ADJUSTMENT	720.00	✓
1187	L/HEADLAMP MOUNTING	51 64 7 210 499	Original	170.00	
0345	L/INN U-SONIC SENDER	66 20 9 274 428	Original	175.00	
0343	L/OUT U-SONIC SENDER	66 20 9 274 428	Original	175.00	
7769	L/RADIATOR BRACKET	17 11 7 593 838	Original	75.00	
0491	L/UPPER LOCK	51 23 7 210 733	Original	48.00	
0633	L/WASHER NOZZLE TRIM	SEE GUIDE NO. 0635	Original	85.00	
0495	LEFT ADJUSTER	51 76 7 183 752	Original	26.00	

Code	Description	Part Number	Part Source	Price SGD
0561	LEFT HEADLAMP ASSY	63 11 7 401 145	Original	2,850.00
0284	LOWER BUMPER COVER	51 11 7 389 904	Original	330.00
0476	R/BONNET HINGE	41 61 7 262 876	Original	82.00
0504	R/BONNET LOCK	51 23 7 224 883	Original	70.00
0498	R/F BONNET STRUT	51 23 7 210 727	Original	95.00
0416	R/F GRILLE	51 13 7 367 422	Original	105.00
1020	R/F PANEL SUPPORT	51 64 7 210 504	Original PRICE ADJUSTMENT	160.00 ✓
0346	R/INN U-SONIC SENDER	66 20 9 274 428	Original	175.00
7770	R/RADIATOR BRACKET	17 11 7 593 839	Original	75.00
0492	R/UPPER LOCK	51 23 7 210 734	Original	48.00
7761	RADIATOR	17 11 8 623 350	Original	790.00
0496	RIGHT ADJUSTER	51 76 7 183 752	Original	26.00
0562	RIGHT HEADLAMP ASSY	63 11 7 401 146	Original	2,850.00
1018	RR CONNECTING STRUT	51 64 7 210 502	Original	190.00
0481	SOUND INSULATION	51 48 9 175 051	Original	190.00
0623	TUBE	61 67 7 357 005	Original	70.00
1401	WINDSCREEN	51 31 7 337 767	Original	750.00
1411	WINDSCREEN BOND KIT	83 19 2 289 285	Original SN	40.00 ✓

f: OEM Parts

n: Non-OEM Parts

u: Used parts

Savings

Subtotal

Fixed Sundry Parts Price

Total

19362 0.00

19,497.70

100.00

19462 19,597.70

Extras

Code	Description	Price SGD
1000	WS GLASS SENSOR TAPE	40.00* ✓
1001	AC GAS	50.00*
1002	COOLANT X 2L	40.00*
Total Extras		130.00

19497.70
 - 60.70
 - 75

 19362
 + 100 sundry
 x 120 SN
 x 75
 x

Final Calculation

	SGD	SGD
Parts		
Fixed Sundry Parts Price	19,497.70	
Total Parts	100.00	19,597.70
Labour Time Base 12 WU/h		
Total 178.0 WU X 42.00 SGD/h	623.00	
Total of Labour		623.00
Total Of Extras		130.00
Paint Work Time Base 12 WU/h		
Labour Cost 151.0 WU X 42.00 SGD/h	528.50	
Material Cost	278.66	
Total Paint Including Material		807.16
Repair Cost Excludes GST		21,157.86
GST (+7.0%)		1,481.05
Repair Cost Included GST		22,638.91

Comments

- * - USER SUPPLIED DATA
- NN - NO MANUFACTURERS CODE EXISTS
-) - WU PARTIAL INCL IN OTHER POSITIONS

Assessment Note

No assessment notes entered.

20922.16

21157.86
- 60.70 (KVA screen clip)
5 items
21097.16

> Back to OneMotoring

Enquire PARF/COE Rebate for Registered Vehicle

Vehicle Owner Particulars

Owner ID Type:	Singapore NRIC
Owner ID:	585F

Vehicle Details

Vehicle No.:	SMF8346P
Vehicle to be Exported:	No
Intended Deregistration Date:	27 Jun 2022
Vehicle Make:	B.M.W.
Vehicle Model:	X4 XDRIVE35I SR LED NAV HUD
Primary Colour:	White
Manufacturing Year:	2015
Engine No.:	03709296N55B30A
Chassis No.:	WBAXW520700F90320
Maximum Power Output:	225.0 kW (301 bhp)
Open Market Value:	\$60,975.00
Original Registration Date:	07 Oct 2015
First Registration Date:	07 Oct 2015
Transfer Count:	3
Actual ARF Paid:	\$81,755.00

Intended PARF Rebate Details

PARF Eligibility:	Yes
PARF Eligibility Expiry Date:	06 Oct 2025
PARF Rebate Amount:	\$53,140.00

Intended COE Rebate Details

COE Expiry Date:	06 Oct 2025
COE Category:	E - Open Category
COE Period(Years):	10
QP Paid:	\$61,010.00
COE Rebate Amount:	\$19,977.00
Total Rebate Amount:	\$73,117.00

The information contained herein is correct as at 27 Jun 2022

OK

SINGAPORE ACCIDENT STATEMENT

IMPORTANT NOTICE

1. Please report correctly the details of the accident to speed up the claims process.
2. This Form must be completed by the Policyholder and/or the Authorised Driver
3. Information provided must be as truthful and accurate as possible. Any wilful misrepresentation or withholding of material facts may allow insurance companies to repudiate policy liability.
4. The issue and acceptance of this Form by insurance companies is not an admission of policy liability on the part of the insurance companies.
5. Any false reporting may be referred to the Police for investigation.
6. This report will be forwarded by the insurers of the GIA Records Management Centre established by the General Insurance Association of Singapore (GIA) for archiving and that copies of this report will, for a fee, be made available upon application by interested parties.
7. By the lodgement of this report to the insurers, you hereby consent to the archiving of this report at the centre and to copies of the report being made available aforesaid.

ACCIDENT STATEMENT

Date of Submission	27/06/2022 15:04 (SGT)
Reported by	Both
Date of Accident	26/06/2022 14:07 (SGT)
Exact Location of Accident	Singapore
Additional Location Information	CTE
Country/State of Loss	Singapore

DETAILS OF OWN VEHICLE

Vehicle Registration Number	SMF8346P
-----------------------------	----------

INSURED/POLICYHOLDER

Is company?	No
Name Of Registered Owner	HO KANG WEN
NRIC No	SXXXX585F
Email Address	Kangwen91@gmail.Com
Mobile Phone No	(Phone) +65-91172310
Alternative Phone No	-

VEHICLE PARTICULARS

Manufacturer	BMW
Model	X4
Variant	-
Exact purpose for which vehicle was being used at time of accident	Private use
Are you claiming under your own insurance policy for repair to your vehicle?	Yes
Vehicle Category	Private car
Transmission	Auto
CC	2979

INSURANCE COMPANY

Name of Insurance Company	China Taiping Insurance (Singapore) Pte. Ltd.
Policy Number / Cover Note Number	DMPCSNW00093892200

DRIVER

Name of Driver	HO KANG WEN
NRIC No	SXXXX585F
Date Of Birth	15/02/1991
Occupation	Indoor

Date Of Driving Pass	18/11/2011
Driving experience	10 YEARS AND 7 MONTHS
Gender	Male
Mobile Number	(Phone) +65-91172310
Alt. Phone Number	-
Email Address	Kangwen91@gmail.Com
Address	BLK 427 YISHUN AVE 11 #08-592
Address complement	-
Postcode	760427
Is the driver the policyholder?	Yes
If No, Relationship of the Driver with the Insured	-
Does Driver Own Other Vehicles?	No
Vehicle Registration Number of Other Vehicle Owned by Driver	-
Insurance Company of Other Vehicle Owned by Driver	-

GENERAL INFORMATION OF THE ACCIDENT

Type of Accident	Chain Collision
Weather Conditions	Clear
Road Surface	Dry

OTHER INFORMATION

Was any foreign vehicle involved in the accident?	No
Number of vehicles involved in the accident	3
Was anybody injured in the Accident?	No
Was any injured conveyed to hospital by ambulance?	-
Was any other vehicle or property damaged?	Yes
Number of Passengers (Including Driver)	1
Has the driver been approached by unknown person(s) soliciting/offering accident claims assistance?	No
Translator's name	-
Translator's ID	-
Translator's phone number	-
Translator's email	-
Original language used in the statement	-

DETAILS OF POLICE ACTION

Was the accident reported to the police?	Yes
Police Station Name	Paya Lebar Neighbourhood Police Post
Police Station Address	Blk 114 Hougang Avenue 1 #01-1270 Singapore 530114
Was notice of intended Prosecution given?	No
If yes, against whom?	-

CIRCUMSTANCES OF ACCIDENT

REFER TO STATEMENT

ATTACHMENT(S)

Are accident photos available for attachment?	Yes
Was there any video captured by Car Camera?	No

DETAILS OF OTHER VEHICLE PROPERTY 1

Vehicle Registration Number	SKQ4092M
Vehicle Manufacturer	Volvo
Vehicle Model	-
Vehicle Variant	-
Vehicle Colour	-
Vehicle Category	Private car

Name of Driver	KOH KHENG YEOW
NRIC No	SXXXX866A
Contact Number	-
Address	-
Address complement	-
Postcode	-
Insurance Company Name	-
Nature Of Damage	-
Details of property damaged in accident	-
No. Of Passenger (Including Driver)	2

DETAILS OF OTHER VEHICLE PROPERTY 2

Vehicle Registration Number	SMH3205K
Vehicle Manufacturer	-
Vehicle Model	-
Vehicle Variant	-
Vehicle Colour	-
Vehicle Category	Private hire
Name of Driver	SNG CHIEW KEE
NRIC No	SXXXX414Z
Contact Number	-
Address	-
Address complement	-
Postcode	-
Insurance Company Name	-
Nature Of Damage	-
Details of property damaged in accident	-
No. Of Passenger (Including Driver)	-

SKETCH PLAN

1. VEHICLE NO.: SME 8346P
 2. INSURER CO: China
 3. ACCIDENT DATE & TIME: 26/06/22 @ 1407

IMPORTANT NOTICE


1. Please report correctly the details of the accident to speed up the claims process.
2. This Form must be completed by the Policyholder and/or the Authorised Driver.
3. Information provided must be as truthful and accurate as possible. Any willful misrepresentation or withholding of material facts may allow insurance companies to repudiate policy liability.
4. The issue and acceptance of this Form by insurance companies is not an admission of policy liability on the part of the insurance companies.
5. Any false reporting may be referred to the Police for investigation.
6. The report will be forwarded by the insurers of the GIA Records Management Centre established by the General Insurance Association of Singapore (GIA) for archiving and that copies of this report will for a fee be made available upon application by interested parties.
7. By the lodgement of this report to the insurers, you hereby consent to the archiving of this report at the centre and to copies of the report being made available aforesaid.
8. **Consent under the Personal Data Protection Act (PDPA)**
 I understand, acknowledge, agree and consent that:
 - (a) My insurer, my workshop and the General Insurance Association of Singapore ("GIA") may/are permitted to collect, use, disclose and/or process my personal data/personal information set out in this form and any other personal information provided by me or possessed by my insurer (collectively the "Personal Information") and disclose and transfer such Personal Information to all insurer(s) who have insured vehicle(s) involved in this accident (all insurer(s) who have insured vehicle(s) involved in this accident shall be collectively referred to as the "Insurers"), the Insurers' law yers/law firms, the Monetary Authority of Singapore and any relevant government agency/authority (such as the police), for the purpose(s) of:
 - (i) processing, handling and/or dealing with my claims including the settlement of the claims and any necessary investigations relating to the claims;
 - (ii) investigating the accident and/or my claims;
 - (iii) carrying out and/or dealing with my instructions or responding to any enquiries by me;
 - (iv) administering my claims (including the mailing of correspondence, statements, invoices, reports or notices to me, which could involve disclosure of certain personal data about me to bring about delivery of the same as well as on the external cover of envelopes/mail packages); and/or
 - (v) complying with applicable law in administering, processing, handling and/or dealing with my claims, (collectively the "Purposes")
 - (b) all insurer(s) who have insured vehicle(s) involved in this accident and the Insurers' law yers/law firms, may/are permitted to collect, use, disclose and/or process my Personal Information for one or more of the above Purposes; and
 - (c) my Personal Information may/can be disclosed by any of the Insurers and/or GIA to their third party service providers or agents (including their law yers/law firms), which may be sited outside of Singapore, for one or more of the above Purposes.

Policyholder's Signature / Date & Time

Driver's Signature (if driver is not the policyholder) / Date & Time

Witnessed by Reporting Centre Personnel

Sketch Plan

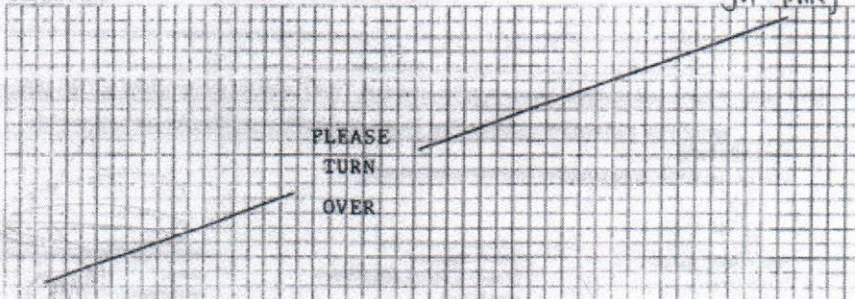

Sketch Plan

Handwritten sketch plan showing a vertical road with arrows indicating traffic flow. To the right of the sketch, the following details are written:

- A: SMF 8346P (alone)
- B: SK04092M (in male passenger)
Koh Kheng Yeow
50200866A
- C: SMH 3205K

DESCRIBE CIRCUMSTANCES OF THE ACCIDENT

Vehicle No: SMF 8346P (China)
 Date & Time: 26/06/2022 @ 1407 (clear day)
 Refer to police report.

Note: Please note that your insurer may have 14days Time Frame for you to submit an Own Damage Claim under your own comprehensive policy. Please check with your policy for more information.

DECLARATION

I/We declare the foregoing particulars are true in every respect.

Policyholder's Signature: 
 Date & Time: _____

Driver's Signature: 
 (if driver is not the policyholder)
 Date & Time: _____

Reporting Centre Personnel's Signature: 
 Name: 
 NRIC/FIN No.: _____

☒ Claim Own Policy ☐ Claim Third Party ☐ Reporting Only
☐ Claim OD/TP at other workshop ()