

ASS. REC. BY:

REF:

CTZ/ 22007344/Kg

Kenneth

ASSIGNMENT

From:

Date:

Estimated Cost:

OD / TP / WS / TP RES / OD RES / EVA / INV / MV

To Inspect Vehicle No:

at Workshop m/s

Play

of

7520

Insured:

Policy No.

Claims No.

Sum Insured:

Excess:

(Client's Record)

Make of Veh:

Asterian

(Policy Condition)

Remark: The veh had commenced its repair at the time of inspection.

Bal. or Market Value:

IDAC Accident Report:

Consistent? : Yes or No

GIA / PR Seen:

Consistent? : Yes or No

Est. Repairs:

04

days

Res.: Yes or No

Lum Sum:

1.31

%

3 Val.: Yes or No

CA / REV / REP. / 24 HRS

Date:

Person Contacted:

Vehicle: IN / OUT

Veh No:

SKW 3485M

Yr Regn:

10.15

Type: M/Car / M/Cycle / Bus / Van / Lorry / Taxi / Prime Mover /

Truck / Trailer or

Make:

A) Volkswagen Passat

c.c

1798

Colour

M. Gray

A/C:

Insured / Std / NI / NA

Sp. Reading

64638

T/Radio:

Insured / Std / NI / NA

Eng/No:

C/No:

WVWZ88307G-E 059735

Gen. Cond: Good / Fair / Poor / Burnt

Steering: In order / Jammed / Leaked / Burnt or

Brake: In order / Jammed / Leaked / Burnt or

Modl: Nil / S/Rlm / STD / Rlm or

Tyre Size:

F:

215/55R17

R:

BS / DUN / EXNOVA / GY / FS / LIZA / MIC / OHTSU / PIR / SUMI /

TOYO / YOKO or

Front

R/Bal.

9

mm

Rear

R/Bal.

9

mm

L/Bal.

9

mm

L/Bal.

9

mm

D.O.A.

27/7/22

D.O.I.

15/8/2022

Survey held at

Des. of Damages: Frt / Rear / O/S / N/S / UIC / Rooftop or

O/S Rca

The UIC / Chassis frame / Body Structure affected due to collision.

Date / Time

Action / Instruction

Date/Time, File Pass to?

☐

: Prell. Report

1)

☐

: Final Report

Days Of Repair:

Resurvey No. of Trip:

Survey Fee:

Transportation:

S + R.S. SI

Fees

Others

TOTAL

Add Fee:

☐

: Site Insp (\$

☐

: Interview (\$

☐

Tech Invs (\$

☐

Weekend (\$

Report Format :

Lump Sum / I.B.I: (\$

Ding Auto Pte Ltd
Sin Ming Industrial Est. Sec C, Blk
10, #01-20
575645

Insurer Reference: SKW3485M
Repairer Reference: 049569
Date calculated: 05/08/2022 4:55 PM

Antodex estimate



Full Report
Registration: SKW3485M
Printed: 05/08/2022 4:55 PM

Summary Information

Claim Location:	Singapore (SG)	Work Provider:	China Taiping Insurance (Singapore) Pte Ltd
Printed by:	Ding Auto	Currency:	SGD
Claim Reference:	SKW3485M	Date of Incident:	28/07/22
Estimated Repair Time:		Hire Car Start:	
Actual Repair Days:		Hire Car End:	

Vehicle Details

Vehicle Manufacturer:	VW
Model:	PASSAT (CB)
Sub Model:	BASE MODEL
Model Sheet Number:	06 E3 01
Registration:	SKW3485M
VIN number:	
Odometer:	0
Model Specs	
BLUE MOTION	FRONT DRIVE
	SALOON

Not Authorised
Repair After 4 days

LKK Auto Consultants hence notify the Repairer of the following:

- To resurvey before/after spray painting
- To display damaged part(s) during resurvey
- Parts prices are subject to confirmation
- Third party survey is on a "Without Prejudice" basis
- No illegal modification(s) is allowed
- Supplementary item(s) must be resurveyed and is subject to final approval from Insurance Company

Acknowledged by Repairer

Signature:

Date:


Vehicle Condition

Vehicle Status

Pre-Accident Damage:
Date of Inspection:

Damage Areas

All ☐
Underbody ☐

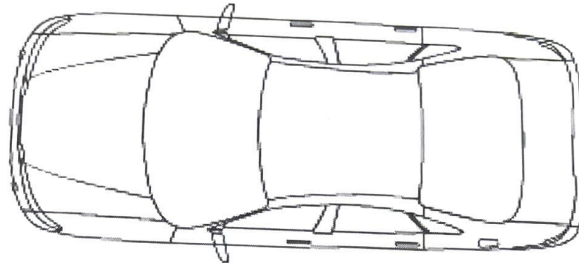

Tyres Condition

Tyre Brand	Tread (Left Middle), mm	Tread (Left Outer), mm	Tread (Left Inner), mm	Tread (Right Inner), mm	Tread (Right Outer), mm	Tread (Right Middle), mm	Condition
------------	-------------------------	------------------------	------------------------	-------------------------	-------------------------	--------------------------	-----------

Spare Tyre Brand Tread (Spare), mm

Labour

Code	Description	Time Base 10 WU/h	Price = 42.00 SGD/h	
			WU	Price SGD
58 51 19 00	R + R RIGHT REAR DOOR			
	INCLUDES: DOOR ADJUST		3.0	12.60
53 55 53 00	REMOVE PARTS R/SIDE PANEL			
	INCLUDES: REMOVE TAILLAMPS, BUMPER		22.0	92.40
	COVER, WHEELHOUSE LINER, SIDE TRIM, SEAT			
	CUSHION, SEAT BACKREST, INNER SILL			
	MOULDING, REAR SCREEN, C-PILLAR TRIM,			
	SEAT BELT, BOOTLID, LOCK PLATE, BOOT			
	TRIMS AND CROSSMEMBER			
53 55 55 00	RENEW RIGHT SIDE PANEL		76.0	319.20
53 55 59 00	FIT PARTS R/SIDE PANEL		33.0	138.60
	INCLUDES: FIT REMOVED PARTS, RENEW IF			
	NECESSARY,			
	CHECK LIGHTING			
53 56 55 50	RENEW RIGHT OUTER LOWER SIDE PANEL			
46 15 19 50	R + R R/R BRAKE CARRIER		27.0	113.40
46 53 19 50	R + R RIGHT REAR BRAKE DISC		5.0	21.00
42 72 19 50	R + R R/R COIL SPRING		1.0	4.20
			7.0	29.40

Description	WU	Price SGD
(WHEEL REMOVED)		
42 93 19 50 R + R RIGHT REAR SHOCK ABSORBER	4.0	16.80
42 93 55 50 RENEW R/R SHOCK ABSORBER (REMOVED)	2.0	8.40
42 67 19 50 R + R R/R WHEEL HUB AND BEARING	2.0	8.40
44 12 55 50 RENEW RIGHT REAR WHEEL/TYRE (WHEEL REMOVED)	3.0	12.60
INCLUDES: R + R TYRE, FIT VALVE AND BALANCE WHEEL		
01 50 00 ZAX GFS / GUIDED FUNCTION (READ OUT FAULT MEMORY)	3.0	12.60
Labour Cost	Hrs	WU
Panel / Mechanical Labour	18.80	188.0
Total of Labour		789.60

Paint

Paint Work

Code	Description - MF	Time Basis 10 WU/h	WU	Price SGD
LE 2162	R/OUTER SILL COVER NEW PART PAINTING S1		4.0	16.80
53 53 61 50	R/SIDE PANEL NEW PART PAINTING S1		16.0	67.20
53 55 61 00)	ADD/TIME FOR ONE MAIN WORK R/SIDE PANEL NEW PART PAINT STAGE 1		3.0	12.60
51 01 71 13	PAINTING PREPARATION WORK NEW PART S1 METAL (PART/S FITTED)		18.0	75.60
51 01 71 93	PREPARATION FOR PAINT (PLASTIC PARTS) (WITH PART(S) REMOVED) (ASSEMBLY OPERATION)		2.0	8.40

Total Paint	Hrs	WU	Price SGD
	4.30	43.0	180.60

Spare Parts

Code	Description	Part Number	Part Source	prices as at 2015-06-01	Price SGD
2162	R/OUTER SILL COVER	3G0 853 858 F GRU			0.00
26 Mar	R/R BUMPER GUIDE	3G5 807 376 A	Original		
9202	R/RR SHOCK ABSORBER	3Q0 513 049 FA	Original	45.00 X	
9552	R/RR WHEEL	3Q0 601 027 C 03C	Original	260.00 X	
				1,400.00	
4202	R/R WHEELHOUSE CVR	3G0 810 972 H	Original	160.00 X	
9182	R/R WHEEL HUB/BRG	3G0 598 611 A	Original	380.00	
3482	R/SIDE PANEL	3G5 809 844 A	Original	1,400.00 X	
1000	REAR DOOR CHROME	DOOR CHROME	Original	300.00 X	
Savings					0.00
Subtotal					3,945.00
Total					3,945.00

f: OEM Parts
n: Non-OEM Parts
u: Used parts

Cost Calculation

Parts	SGD	SGD
Total Parts	3,945.00	3,945.00
Labour Time Base 10 WU/h		
Total 188.0 WU X 42.00 SGD/h		
Total of Labour	789.60	789.60
Paint Work Time Base 10 WU/h		
Labour Cost 43.0 WU X 42.00 SGD/h		
Total Paint Including Material	180.60	180.60
Repair Cost Excludes GST		180.60
GST (+7.0%)		4,915.20
Repair Cost Included GST		344.06
		5,259.26

Comments

- * - USER SUPPLIED DATA
- NN - NO MANUFACTURERS CODE EXISTS
-) - WU PARTIAL INCL IN OTHER POSITIONS

Assessment Note

No assessment notes entered.



SINGAPORE ACCIDENT STATEMENT

IMPORTANT NOTICE

1. Please report correctly the details of the accident to speed up the claims process.
2. This Form must be completed by the Policyholder and/or the Actual Driver.
3. Information provided must be as truthful and accurate as possible. Any wilful misrepresentation or withholding of material facts may allow insurance companies to repudiate policy liability.
4. The issue and acceptance of this Form by insurance companies is not an admission of policy liability on the part of the insurance companies.
5. Any false reporting may be referred to the Police for investigation.
6. This report will be forwarded by the insurers of the GIA Records Management Centre established by the General Insurance Association of Singapore (GIA) for archiving and that copies of this report will, for a fee, be made available upon application by interested parties.
7. By the lodgement of this report to the insurers, you hereby consent to the archiving of this report at the centre and to copies of the report being made available aforesaid.

ACCIDENT STATEMENT

Date of Submission	28/07/2022 10:40 (SGT)
Reported by	Both
Date of Accident	27/07/2022 08:35 (SGT)
Exact Location of Accident	Singapore
Additional Location Information	COLLYER QUAY AFTER CROSS JUNCTION OF CHURCH STREET
Country/State of Loss	Singapore

DETAILS OF OWN VEHICLE

Vehicle Registration Number	SKW3485M
-----------------------------	----------

INSURED/POLICYHOLDER

Is company?	No
Name Of Registered Owner	ZHOU MING
NRIC No	SXXXX757D
Email Address	ZHOUMINGMBOX@HOTMAIL.COM
Mobile Phone No	(Phone) +65-91783873
Alternative Phone No	-

9178 3973

VEHICLE PARTICULARS

Manufacturer	Volkswagen
Model	Passat
Variant	-
Exact purpose for which vehicle was being used at time of accident	Private use
Are you claiming under your own insurance policy for repair to your vehicle?	No - Claiming third party
Vehicle Category	Private car
Transmission	Auto
CC	1800

INSURANCE COMPANY

Name of Insurance Company	China Taiping Insurance (Singapore) Pte. Ltd.
Policy Number / Cover Note Number	DMPCSNW00196642100

DRIVER

Name of Driver	ZHOU MING
NRIC No	SXXXX757D
Date Of Birth	17/07/1973