

ASSIGNMENT

From: _____ Date: _____

Estimated Cost: _____

DD / TP / WS / TP RES / OD RES / EVA / INV / MV

To inspect Vehicle No: _____

at Workshop m/s _____

of _____

Insured: _____

Policy No. _____


Claims No. 202222005928SLSum Insured: _____ Excess: 0/-

(Client's Record)

Make of Veh: _____

(Policy Condition)

Remark: The veh had commenced its repair at the time of inspection.

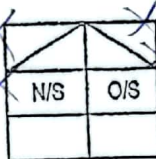

Bal. or Market Value: _____

IDAC Accident Report: _____ Consistent? : Yes or No

GIA / PR Seen: _____ Consistent? : Yes or No

Est. Repairs: 12 days Res.: Yes or No

Lum Sum: _____ % 3 Val.: Yes or No

CA / REV / REP. / 24 HRS

Date: _____ Person Contacted: _____ Vehicle: IN / OUT

Veh No: SM4 7997M Yr Regn: 13/8/90Type: M. Car / M. Cycle / Bus / Van / Lorry / Taxi / Prime Mover /

Truck / Trailer or

Make: Volkswagen Sharan c.c. 1984Colour: White A/C: Insured / Std / NI / NASp. Reading: 30903 T/Radio: Insured / Std / NI / NA

Eng/No: _____

C/No: WVW 2227N 22LV013418Gen. Cond: Good / Fair / Poor / BurntSteering: In order / Jammed / Leaked / Burnt orBrake: In order / Jammed / Leaked / Burnt orModi: Nil / S/Rim / STD A/Rim orTyre Size: F: 225/45R18R: 1

BS / DUN / EXNOVA / GY / FS / LIZA / MIC / OHTSU / PIR / SUMI /

TOYO / YOKO or Pirelli

Front _____ Rear _____

R/Bal. 4 mm R/Bal. 4 mmL/Bal. 4 mm L/Bal. 4 mmD.O.A. 1/8/22 D.O.I. 4/8/22Survey held at VolkswagenDes. of Damages: Front RH, Front LH

The U/C / Chassis frame / Body Structure affected due to collision.

Date / Time Action / Instruction

MK-165K

05/08/22 @ 11.30am revert to Sharon Lim via Merimen.

05/08/22 @ 10.41pm Sharon Lim informed C/A via Merimen.

08/08/22 Informed wksp C/A & ex:\$0/- by email.

21/09/22 @ 10.23am confirmed with Christopher final fig \$19493.50, 12 days. (Red \$4817.97, 20%)

Date/Time, File Pass to?

☐ : Prel. Report

1) 21/09 Typist

☐ : Final Report

Date/Time, File Return to?

2)

Report Format: MER-ODLump Sum / I.B.F. (\$) 19493.50Days Of Repair: 12Resurvey No. of Trip: 1Add Fee: ☐ : Site Insp (\$ _____)☐ : Interview (\$ _____)☐ : Tech. Invs (\$ _____)☐ : Weekend (\$ _____)

Survey Fee:

Transportation:

S + RS. \$ _____

Photos

Others

TOTAL

VOLKSWAGEN CENTRE SINGAPORE

247 Alexandra Road
Singapore 159934
Biz. Reg. No.: 199101494Z
GST No.: M200985052



SKODA

Commercial Vehicles

Quotation

Non binding - Preview

Page

1/3

Company
ALLIANZ GLOBAL
CORPORATE & SPECIALTY SE
SINGAPORE
12 MARINA VIEW
#14-01 ASIA SQUARE TOWER 2
Singapore 018961

Customer Details:
Mr
LIM
BOON KIAT, MELVIN
(LIN WENJIE, MELVIN)
7 PINE GROVE
#04-01
Singapore 597592

Document no.
Document date
Customer no.
Customer GST-ID
Dealer
Job order number
Job order date
Service Advisor

03-08-2022
5211042669
T11FC0131K
30001
2022022337/ 1
02-08-2022
Dass Anthonidas
Christopher

License plate	Model code	First registration	VIN	Model	Mileage
SMU7997M	7N24MYH2	13-08-2020	VWVZZZ7NZLV013418	Sharan Highline 2.0 TSI 162kW DSG Toulon	30,903

Position no.	Description	Quantity	Unit	Unit price excl. GST	Tax code	Total amount excl. GST	Total amount incl. GST
9801B004	B&P CHECK SHORT CIRCUIT / HARNESS REPAIR				#1	200.00	214.00
9801B005	B&P DIAGNOSIS AND PROGRAMMING				#1	360.00	385.20
9801B001	TO ALIGN LED HEADLIGHT				#1	100.00	107.00
9801B001	R&R RHS U/CARRIAGE	560 x 1.5			#1	1,680.00	1,797.60
9801B001	R&R LHS U/CARRIAGE	560 x 1			#1	1,120.00	1,198.40
9801B003	B&P WHEEL ALIGNMENT				#1	300.00	321.00
7N0807217J GRU	Cover For Bumper Primed	1	pcs.	2,158.33	28.00%	1,554.00	1,662.78
7N0805903 9B9	Front Spoiler Satin Black	1	pcs.	180.73	28.00%	130.13	139.24
7N0807183A	Guide Piece	1	pcs.	44.68	28.00%	32.17	34.42
	LHS BUMPER SIDE BRACKET						
7N0807184A	Guide Piece	1	pcs.	44.68	28.00%	32.17	34.42
	RHS BUMPER SIDE BRACKET						
7N0807724	Support Part	1	pcs.	35.47	28.00%	25.54	27.33
	RHS NOZZLE BRACKET						
7N0853666B 9B9	Cooling Air Grill Satin B	1	pcs.	183.52	28.00%	132.13	141.38
	RHS FOG LAMP GRILLE						
7N0853651F 9B9	Radiator Grille Satin Bla	1	pcs.	721.37	28.00%	519.39	555.75
7N2941754B	Headlamps For Curve Light	1	pcs.	2,603.62	28.00%	1,874.61	2,005.83
7N0821022B	Fender	1	pcs.	714.05	28.00%	514.12	550.11
	RH						
7N0821136A	Cross Support	1	pcs.	53.04	28.00%	38.19	40.86
	RHS FENDER BRACKET						
7N0805912B	Wheelhouse Liner	1	pcs.	173.61	28.00%	125.00	133.75
	RHS FENDER LINER						
7N0821021B	Fender	1	pcs.	714.05	28.00%	514.12	550.11
	LH						
7N0831055AF	Door	1	pcs.	2,531.00	28.00%	1,822.32	1,949.88
	LHS FRT DOOR						
7N0837701C	Door Seal Outer	1	pcs.	388.48	28.00%	279.71	299.29
D 378500A2	Alu-Lamin. Insulation	1	pcs.	43.65	28.00%	31.43	33.63
	DOOR INSULATION						
N 91203801	Bolt With Polygon Socket	1	pcs.	5.62	28.00%	4.05	4.33
WHT005504	Fill. Hd. Screw	2	pcs.	3.12	28.00%	4.49	4.80
5M0837975	Expanding Nut	4	pcs.	4.92	28.00%	14.17	15.16
3C0837975	Clip	4	pcs.	3.23	28.00%	9.30	9.95
7N0854939H GRU	Cover For Door Primed	1	pcs.	298.86	28.00%	215.18	230.24
	LHS FRT DOOR LOWER MLDG						
3C0853586	Grommet	8	pcs.	1.84	28.00%	10.60	11.34
3C0407151G	Track Control Arm	1	pcs.	510.63	28.00%	367.65	393.39
	RHS LOWER ARM						
N 10141003	Bolt Hex. Hd. With Should	1	pcs.	11.95	28.00%	8.60	9.20
N 91143301	Hexagon Flange Screw	1	pcs.	10.10	28.00%	7.27	7.78
N 10560702	Bolt Hex. Hd. With Should	2	pcs.	6.02	28.00%	8.67	9.28
3C0407366B	Guide Joint	1	pcs.	152.60	28.00%	109.87	117.56

VOLKSWAGEN CENTRE SINGAPORE

247 Alexandra Road
Singapore 159934
Biz. Reg. No.: 199101494Z
GST No.: M200985052



Quotation

Non binding - Preview

Page

2/3

Company
ALLIANZ GLOBAL
CORPORATE & SPECIALTY SE
SINGAPORE
12 MARINA VIEW
#14-01 ASIA SQUARE TOWER 2
Singapore 018961

Customer Details:
Mr
LIM
BOON KIAT, MELVIN
(LIN WENJIE, MELVIN)
7 PINE GROVE
#04-01
Singapore 597592

Document no.
Document date
Customer no.
Customer GST-ID
Dealer
Job order number
Job order date
Service Advisor

03-08-2022
5211042669
T11FC0131K
30001
2022022337/ 1
02-08-2022
Dass Anthonidas
Christopher

License plate	Model code	First registration	VIN	Model	Mileage		
SMU7997M	7N24MYH2	13-08-2020	WVWZZZ7NZLV013418	Sharan Highline 2.0 TSI 162kW DSG Toulon	30,903		
Position no.	Description	Quantity	Unit	Unit price excl. GST	Tax code	Total amount excl. GST	Total amount incl. GST
N 10332002	Shouldered Hex. Nut	3	pcs.	3.12	28.00% #1	6.74	7.21
WHT000785	Shouldered Hex. Nut	1	pcs.	5.93	28.00% #1	4.27	4.57
5K0498621	Wheel Bearing With Mounti	1	pcs.	619.56	28.00% #1	446.08	477.31
3C0407254F	Wheel Bearing Housing	1	pcs.	705.71	28.00% #1	508.11	543.68
N 90954802	Oval Hexagon Socket Head	1	pcs.	8.65	28.00% #1	6.23	6.67
N 10106402	Shouldered Hex. Nut Self-	1	pcs.	3.60	28.00% #1	2.59	2.77
N 0150816	Shouldered Hex. Nut	1	pcs.	3.21	28.00% #1	2.31	2.47
7N0413031Q	Gas-Filled Shock Absorber	1	pcs.	433.78	28.00% #1	312.32	334.18
7N0412249	Ball Bearing	1	pcs.	36.67	28.00% #1	26.40	28.25
	TOP BEARING						
7N0412331	Suspension Strut Mounting	1	pcs.	140.26	28.00% #1	100.99	108.06
	TOP MTG						
N 91021601	Shouldered Hex. Nut	1	pcs.	6.02	28.00% #1	4.33	4.63
WHT008926	Bolt Hex. Hd.	3	pcs.	5.05	28.00% #1	10.91	11.67
1K0423810A	Tie Rod	1	pcs.	115.39	28.00% #1	83.08	88.90
1K0423812K	Tie Rod End	1	pcs.	147.41	28.00% #1	106.14	113.57
WHT000785	Shouldered Hex. Nut	1	pcs.	5.93	28.00% #1	4.27	4.57
N 90834901	Retaining Clip	1	pcs.	5.62	28.00% #1	4.05	4.33
VWLM3318	DEGREASER CLEANER 500ml	1	pcs.	18.80	28.00% #1	13.54	14.49
5K0498621	Wheel Bearing With Mounti	1	pcs.	619.56	28.00% #1	446.08	477.31
	LHS WHEEL BEARING						
3C0407253F	Wheel Bearing Housing	1	pcs.	705.71	28.00% #1	508.11	543.68
N 90954802	Oval Hexagon Socket Head	1	pcs.	8.65	28.00% #1	6.23	6.67
N 10106402	Shouldered Hex. Nut Self-	1	pcs.	3.60	28.00% #1	2.59	2.77
3C0407365B	Guide Joint	1	pcs.	152.60	28.00% #1	109.87	117.56
N 10332002	Shouldered Hex. Nut	3	pcs.	3.12	28.00% #1	6.74	7.21
WHT000785	Shouldered Hex. Nut	1	pcs.	5.93	28.00% #1	4.27	4.57
3C0199231E	Bracket	1	pcs.	183.59	28.00% #1	132.18	141.43
	LHS LOWER ARM MTG						
N 10141003	Bolt Hex. Hd. With Should	1	pcs.	11.95	28.00% #1	8.60	9.20
N 91143301	Hexagon Flange Screw	1	pcs.	10.10	28.00% #1	7.27	7.78
N 10560702	Bolt Hex. Hd. With Should	2	pcs.	6.02	28.00% #1	8.67	9.28
VWLM3318	DEGREASER CLEANER 500ml	1	pcs.	18.80	28.00% #1	13.54	14.49
	Towing assistance - AWP	1	pcs.	195.00	#1	195.00	208.65
	LABOUR	-64	pcs.	560.00	#1	3,360.00	3,595.20
	SPRAY PAINT	-85	pcs.	530.00	#1	4,240.00	4,536.80
	TRANSFER DOOR MECHANISM	1	pcs.	560.00	#1	560.00	599.20
	ALLIANZ OD						
	DOA: 1/8/2022						
	EXCESS:						
	SURVEY BY:						

Quotation valid till 09-08-2022

Tax Code	Labour	Material	Material Discount	GST %	GST	Total Discount	Total amount excl. GST	Total amount incl. GST
----------	--------	----------	-------------------	-------	-----	----------------	------------------------	------------------------

VOLKSWAGEN CENTRE SINGAPORE

247 Alexandra Road
Singapore 159934
Biz. Reg. No.: 199101494Z
GST No.: M200985052



Quotation

Non binding - Preview

Page

3/3

Company
ALLIANZ GLOBAL
CORPORATE & SPECIALTY SE
SINGAPORE
12 MARINA VIEW
#14-01 ASIA SQUARE TOWER 2
Singapore 018961

Customer Details:
Mr
LIM
BOON KIAT, MELVIN
(LIN WENJIE, MELVIN)
7 PINE GROVE
#04-01
Singapore 597592

Document no.
Document date
Customer no.
Customer GST-ID
Dealer
Job order number
Job order date
Service Advisor

03-08-2022
5211042669
T11FC0131K
30001
2022022337/ 1
02-08-2022
Dass Anthonidas
Christopher

License plate SMU7997M	Model code 7N24MYH2	First registration 13-08-2020	VIN WVWZZZ7NZLV013418	Model Sharan Highline 2.0 TSI 162kW DSG Toulon	Mileage 30.903			
Tax Code	Labour	Material	Material Discount	GST %	GST	Total Discount	Total amount excl. GST	Total amount incl. GST
#1	3,760.00	19,636.39	4,387.19	7%	1,637.75	4,387.19	23,396.39	25,034.14
Total	3,760.00	19,636.39	4,387.19		1,637.75	4,387.19	23,396.39	25,034.14

Steve CLKK)
4/8/22, 11:31L

OP-L1 ML
EXA D-?

PIP
Ly BL y
10 days

Customer

Service Advisor

---VISIT OUR WEBSITE: aftersales.vw.com.sg (for online service appointments) and volkswagen.com.sg and www.skoda.com.sg (for additional services, products and promotions).---

All invoices are denominated in SGD, unless otherwise stated.

LKK Auto Consultants hence notify the Repairer of the following:

- To resurvey before/after spray painting
- To display damaged part(s) during resurvey
- Parts prices are subject to confirmation
- Third party survey is on a "Without Prejudice" basis
- No illegal modification(s) is allowed
- Supplementary item(s) must be resurveyed and is subject to final approval from Insurance Company

Acknowledged by Repairer

Signature:

Date:

SINGAPORE ACCIDENT STATEMENT

IMPORTANT NOTICE

1. Please report **correctly** the details of the accident to speed up the claims process.
2. This Form must be **completed by the Policyholder and/or the Actual Driver**
3. Information provided must be as truthful and accurate as possible. Any wilful misrepresentation or withholding of material facts may allow insurance companies to repudiate policy liability.
4. The issue and acceptance of this Form by insurance companies is not an admission of policy liability on the part of the insurance companies.
5. **Any false reporting may be referred to the Police for investigation.**
6. This report will be forwarded by the insurers of the GIA Records Management Centre established by the General Insurance Association of Singapore (GIA) for archiving and that copies of this report will, for a fee, be made available upon application by interested parties.
7. By the lodgement of this report to the insurers, you hereby consent to the archiving of this report at the centre and to copies of the report being made available aforesaid.

ACCIDENT STATEMENT

Date of Submission	02/08/2022 16:34 (SGT)
Reported by	Owner
Date of Accident	01/08/2022 16:20 (SGT)
Exact Location of Accident	Singapore
Additional Location Information	ALONG JURONG GATEWAY ROAD
Country/State of Loss	Singapore

DETAILS OF OWN VEHICLE

Vehicle Registration Number SMU7997M

INSURED/POLICYHOLDER

Is company?	No
Name Of Registered Owner	LIM BOON KIAT, MELVIN (LIN WENJIE, MELVIN)
NRIC No	SXXXX542J
Email Address	melvinlim@singnet.com.sg
Mobile Phone No	(Phone) +65-92992999
Alternative Phone No	-

VEHICLE PARTICULARS

Manufacturer	Volkswagen
Model	Sharan
Variant	Sharan Highline 2.0 TSI 162kW DSG Toulon
Exact purpose for which vehicle was being used at time of accident	Private use
Are you claiming under your own insurance policy for repair to your vehicle?	Yes
Vehicle Category	Private car
Transmission	Auto
CC	2000

INSURANCE COMPANY

Name of Insurance Company	Allianz Insurance Singapore Pte. Ltd.
Policy Number / Cover Note Number	SP2000423805

DRIVER

Name of Driver	KHOO MIN MIN, SERENE
NRIC No	SXXXX010B
Date Of Birth	26/12/1986
Occupation	Indoor

Date Of Driving Pass
Driving experience

Gender

Mobile Number

Alt. Phone Number

Email Address

Address

Address complement

Postcode

Is the driver the policyholder?

If No, Relationship of the Driver with the Insured

Does Driver Own Other Vehicles?

Vehicle Registration Number of Other Vehicle Owned by Driver

Insurance Company of Other Vehicle Owned by Driver

03/04/2006

16 YEARS AND 4 MONTHS

Female

(Phone) +65-92992999

-

melvinlim@singnet.com.sg

7 PINE GROVE

#04-01

597592

No

Spouse

No

-

-

GENERAL INFORMATION OF THE ACCIDENT

Type of Accident

Weather Conditions

Road Surface

Collision - Change/cross lane

Clear

Dry

OTHER INFORMATION

Was any foreign vehicle involved in the accident?

Number of vehicles involved in the accident

Was anybody injured in the Accident?

Was any injured conveyed to hospital by ambulance?

Was any other vehicle or property damaged?

Number of Passengers (Including Driver)

Has the driver been approached by unknown person(s) soliciting/offering accident claims assistance?

Translator's name

Translator's ID

Translator's phone number

Translator's email

Original language used in the statement

No

3

No

-

Yes

4

No

-

-

-

-

-

PASSENGER 1

Name

Gender

SHANNEN LIM

Female

PASSENGER 2

Name

Gender

SHAYLA LIM

Female

PASSENGER 3

Name

Gender

SHAYNE LIM

Male

DETAILS OF POLICE ACTION

Was the accident reported to the police?

Was notice of intended Prosecution given?

If yes, against whom?

No

No

-

CIRCUMSTANCES OF ACCIDENT

PLEASE REFER TO SKETCH PLAN

ATTACHMENT(S)

Are accident photos available for attachment?

Yes



Accident report SV1122820001

Was there any video captured by Car Camera?

Yes

DETAILS OF OTHER VEHICLE PROPERTY 1

Vehicle Registration Number	SHC7189H
Vehicle Manufacturer	-
Vehicle Model	-
Vehicle Variant	-
Vehicle Colour	-
Vehicle Category	Taxi
Name of Driver	-
Contact Number	-
Address	-
Address complement	-
Postcode	-
Insurance Company Name	-
Nature Of Damage	-
Details of property damaged in accident	-
No. Of Passenger (Including Driver)	-

DETAILS OF OTHER VEHICLE PROPERTY 2

Vehicle Registration Number	SLC3598P
Vehicle Manufacturer	-
Vehicle Model	-
Vehicle Variant	-
Vehicle Colour	-
Vehicle Category	Private car
Name of Driver	-
Contact Number	-
Address	-
Address complement	-
Postcode	-
Insurance Company Name	-
Nature Of Damage	-
Details of property damaged in accident	-
No. Of Passenger (Including Driver)	-

SKETCH PLAN


IMPORTANT NOTICE

1. Please report correctly the details of the accident to speed up the claims process.
2. This Form must be completed by the Policyholder and/or the Actual Driver.
3. Information provided must be as truthful and accurate as possible. Any wilful misrepresentation or withholding of material facts may allow insurance companies to reputate policy liability.
4. The issue and acceptance of this Form by insurance companies is not an admission of policy liability on the part of the insurance companies.
5. **Any false reporting may be referred to the Traffic Police Department for investigation.**
6. This report will be forwarded by the insurers to the GIA Records Management Centre established by the General Insurance Association of Singapore (GIA) for archiving and that copies of this report will for a fee be made available upon application by interested parties.
7. By the lodgement of this report to the insurers, you hereby consent to the archiving of this report at the centre and to copies of the report being made available aforesaid.

6. Consent under the Personal Data Protection Act (PDPA)

I understand, acknowledge, agree and consent that


- (a) My insurer, my workshop and the General Insurance Association of Singapore ("GIA") may/are permitted to collect, use, disclose and/or process my personal data/personal information set out in this [form] and any other personal information provided by me or possessed by my insurer (collectively the "Personal Information") and disclose and transfer such Personal Information to all insurer(s) who have insured vehicle(s) involved in this accident (all insurer(s) who have insured vehicle(s) involved in this accident shall be collectively referred to as the "Insurers"); the Insurers' lawyers/law firms, the Monetary Authority of Singapore and any relevant government agency/authority (such as the police), for the purpose(s) of:
 - (i) processing, handling and/or dealing with my claims including the settlement of the claims and any necessary investigations relating to the claims;
 - (ii) investigating the accident and/or my claims;
 - (iii) carrying out and/or dealing with my instructions or responding to any enquiries by me;
 - (iv) administering my claims (including the mailing of correspondence, statements, invoices, reports or notices to me, which could involve disclosure of certain personal data about me to bring about delivery of the same as well as on the external cover of envelopes/mail packages); and/or
 - (v) complying with applicable law in administering, processing, handling and/or dealing with my claims (collectively the "Purposes")
- (b) all insurer(s) who have insured vehicle(s) involved in this accident and the Insurers' lawyers/law firms, may/are permitted to collect, use, disclose and/or process my Personal Information for one or more of the above Purposes; and
- (c) my Personal Information may/can be disclosed by any of the Insurers and/or GIA to their third-party service providers or agents (including their lawyers/law firms), which may be sited outside of Singapore, for one or more of the above Purposes.


Policyholder's Signature / Date & Time


Actual Driver's Signature (If driver is not the policyholder) / Date & Time


Witnessed by Reporting Centre Personnel (Name as in NRIC/ID card)

Sketch Plan

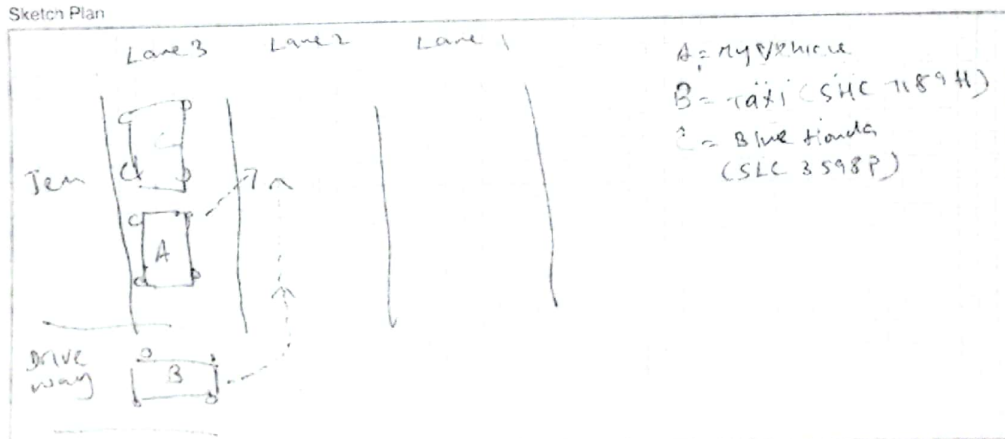

Describe Circumstance of the Accident

Accident happened on 1 Aug 2022 at around 4.30pm along Jurong Gateway Road (outside Ser).

I was travelling on the third lane behind a Blue Honda. The Honda stopped in front of my vehicle and I proceeded to check my right side mirror to filter right to the second lane.

After confirming there was no vehicle approaching I proceeded to switch lane and a taxi at the same time exit the driveway and drove straight to the second lane. The taxi hit my vehicle right front side bumper and the impact caused my vehicle to hit the Honda on my left.

Declaration

(We declare the foregoing particulars are true in every respect)

Neil 02/08/22
Policyholder's Signature / Date & Time

Neil 02/08/22
Actual Driver's Signature (if driver is not the policyholder) / Date & Time

Ching
Witnessed by Reporting Centre Personnel (Name as in NRIC/ID card)

4-00-2022