

(08/11/13) wef

ASS. REC. BY:

REF:

CS4/CTI22008420/Rvy3

614B

COPY: 2023/04

ASSIGNMENT

From:

Date:

Estimated Cost:

(OD) TP / WS / TP RES / OD RES / EVA / INV / MV

To Inspect Vehicle No: SKL 3618E

at Workshop m/s Auto Insure

of 6, Mares Lane LN

Insured:

CTI

Policy No. DMPCSA00214662101

Claims No. SNM22D206049/C01/CHNGPW

Sum Insured:


Excess:

1500

(Client's Record)

Make of Veh:

(Policy Condition)

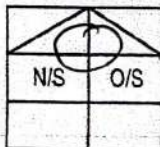Remark: The veh had commenced its
repair at the time of inspection.

Bal. or Market Value:

45K

IDAC Accident Report:

Consistent? : Yes or No

GIA / PR Seen:

Consistent? : Yes or No

Est. Repairs:

days

Res.: Yes or No

Lum Sum:

%

3 Val.: Yes or No

CA / REV / REP. / 24 HRS

Date:

Person Contacted:

Vehicle: IN / OUT

Veh No:

SKL 3618E

Yr Regn:

2013 / OCT

Type: M.Car / M.Cycle / Bus / Van / Lorry / Taxi / Prime Mover /

Truck / Trailer or

Make:

Jaguar XF 2.2 140

c.c 2179

Colour:

BLACK

A/C:

Insured / Std / NI / NA

Sp. Reading

212302

T/Radio:

Insured / Std / NI / NA

Eng/No:

C/No:

SAJAC056500400869

Gen. Cond: Good / Fair / Poor / Burnt

Steering: In order / Jammed / Leaked / Burnt or

Brake: In order / Jammed / Leaked / Burnt or

Modi: Nil / S/Rim / STD A/Rim or

Tyre Size:

F:

245/45 ZR18

R:

BS / DUN / EXNOVA / GY / FS / LIZA / MIC / OHTSU / PIR / SUMI /

TOYO / YOKO or

Front

Rear

R/Bal.

6

mm

R/Bal.

6

mm

L/Bal.

6

mm

L/Bal.

6

mm

D.O.A.

25/08/22

D.O.I.

30/08/22

Survey held at

Auto Insure

Des. of Damages: Frt / Rear / O/S / N/S / U/C / Rooftop or

The U/C / Chassis frame / Body Structure affected due to collision.

Date / Time

Action / Instruction

REPAIR LIMIT - 8K

13/10/22 Submit preli report-revised fig \$855.62 check items \$10,110

Date/Time, File Pass to?

☐

: Preli. Report

1)

☐

: Final Report

Date/Time, File Return to?

2) 13/10/22-typist

Days Of Repair: 3

Resurvey No. of Trip:

Investigation- \$500

Survey Fee:

Transportation:

Report Format :

Lump Sum / I.B.I. (\$))

Add Fee:

☐

: Site Insp (\$

) : S + RS. SI

☐

: Interview (\$

) : Photos

☐

: Tech. Invs (\$

) : Others

☐

: Weekend (\$

) :

TOTAL

Auto Insure Pte. Ltd
6 Marsiling Lane
739145



Insurer Reference: SKL3618E
Repairer Reference: M6021/SKL3618E
Date calculated: 30/08/2022 10:34 AM

Full Report
Registration: SKL3618E
Printed: 30/08/2022 10:34 AM

Summary Information

Claim

Location:	Singapore (SG)	Work Provider:	China Taiping Insurance (Singapore) Pte Ltd
Printed by:	Marvyn Chua	Currency:	SGD
Claim Reference:	SKL3618E	Date of Incident:	25/08/22
Estimated Repair Time:	5	Hire Car Start:	
Actual Repair Days:	5	Hire Car End:	

Vehicle Details

Vehicle

Manufacturer:	JAGUAR
Model:	XF (X250)
Sub Model:	BASE MODEL
Model Sheet Number:	29 21 01
Registration:	SKL3618E
VIN number:	SAJAC0565DDU00869
Odometer:	0

Model Specs

FROM U 13911/T 01220	ACOUSTIC WINDSCREEN	ELECTRIC DOOR MIRROR	ELEC INTERIOR MIRROR
KEYLESS ENTRY/START	FOLDING DOOR MIRRORS	D/MIRROR WITH MEMORY	BLUETOOTH INTERFACE
RADIO WITH CD	REARVIEW CAMERA	XENON HEADLAMP	DAYTIME RUNNING LIGH
L/6-WAY SEAT ADJUSTM	R/6-WAY SEAT ADJUSTM	PEDESTRIAN PROTECT	FRONT PARKING SYSTEM
DESIGN RADIAT GRILLE	FRT BUMPER MLDG CHR	REAR PARKING SYSTEM	2.2 LTR 140KW
REAR WHEEL DRIVE	8-GEAR AUTOMATIC	CRUISE CONTROL	TYRES 245/45 R18..W
EMERGENCY WHEEL 18"	WHEELS 8.5J X 18 ALU	SALOON	PREPARE OFF VEHICLE
TWO COAT PEARL/MICA			

Vehicle Condition

Vehicle Status


Pre-Accident Damage:

Date of Inspection:

Damage Areas

All ☐

Underbody ☒

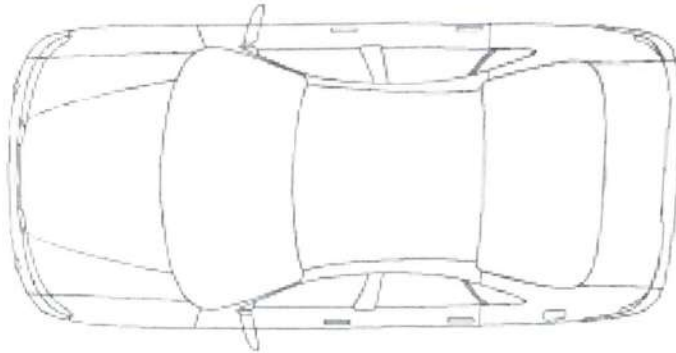

Tyres Condition

Tyre Brand	Tread (Left Middle), mm	Tread (Left Outer), mm	Tread (Left Inner), mm	Tread (Right Inner), mm	Tread (Right Outer), mm	Tread (Right Middle), mm	Condition
------------	----------------------------	---------------------------	---------------------------	----------------------------	----------------------------	-----------------------------	-----------

Spare Tyre Brand	Tread (Spare), mm
------------------	-------------------

Labour

Code	Description	Time Base 10 WU/h	Price = 42.00 SGD/h	
			WU	Price SGD
10-10-10	PREPARATION TIME		2.0	8.40
76-11-41	R + R LOWER ENGINE PROTECTION		2.0	8.40
76-11-42)	R + R L/LOWER ENGINE PROTECTOR		4.0	16.80
76-11-43)	R + R R/LOWER ENGINE PROTECTOR		4.0	16.80
44-24-04)	R + R GEARBOX OIL PAN AND/OR GASKET		14.0	58.80
12-29-93	R + R ENGINE COVER		2.0	8.40
76-11-46	R + R FRONT SILENCER HEAT SHIELD		2.0	8.40
30-10-18	R + R FRONT EXHAUST		6.0	25.20
Labour Cost				
Panel / Mechanical Labour		Hrs	WU	
		3.60	36.0	151.20
Total of Labour				151.20

Final Calculation

	SGD	SGD
Parts	10,690.00	
Total Parts		10,690.00
Labour Time Base 10 WU/h		
Total 36.0 WU X 42.00 SGD/h	151.20	
Total of Labour		151.20
Paint Work Time Base 10 WU/h		
Labour Cost 23.0 WU X 42.00 SGD/h	96.60	
Material Cost	27.82	
Total Paint Including Material		124.42
Repair Cost Excludes GST		10,965.62
GST (+7.00%)		767.59
Repair Cost Included GST		11,733.21
Deductions (Excludes GST)		
Deduction For Excess	-1,000.00	
Total Of Deductions (Excludes GST)		-1,000.00
Grand Total Excludes GST		9,965.62
GST (+7.00%)		697.59
Grand Total Included GST		10,663.21

Comments

- * - USER SUPPLIED DATA
- NN - NO MANUFACTURERS CODE EXISTS
-) - WU PARTIAL INCL IN OTHER POSITIONS

Assessment Note

No assessment notes entered.

LKK Auto Consultants hence notify the Repairer of the following:

- To resurvey before/after spray painting
- To display damaged part(s) during resurvey
- Parts prices are subject to confirmation
- Third party survey is on a "Without Prejudice" basis
- No illegal modification(s) is allowed
- Supplementary item(s) must be resurveyed and is subject to final approval from Insurance Company

Acknowledged by Repairer
Signature:
Date:

Panel
Ap 900000 GS
3 days
45
EXCESS: TBA
REVERT
30/08/22 @ 1700
Reev after repair

Paint

Paint Work

SYSTEM AZT

Time Basis 10 WU/h

Code	Description - TWO COAT PEARL/MICA	WU	Price SGD
	ENGINE PROTECTION SURFACE PAINT	4.0	
	L/F ENGINE PROT PNL SURFACE PAINT	4.0	
	R/F ENGINE PROT PNL SURFACE PAINT	4.0	

Paint Material Per Part

Code	Description	Price SGD
8780	ENGINE PROTECTION SURFACE PAINT	3.74
8781	L/F ENGINE PROT PNL SURFACE PAINT	2.99
8782	R/F ENGINE PROT PNL SURFACE PAINT	2.99

Labour Cost - Paint

Factor	42.00 SGD/h	Hrs	WU	Price SGD
Time Paint			12.0	
Preparation Main Work Metal		1.10	11.0	46.20
Total	10 WU/h	2.30	23.0	96.60

Material Cost - Paint

	Price SGD
Surface-/Blend Paint	9.72
Material-constant Metal	18.10
Total	27.82

Spare Parts

Code	Description	Part Number	Part Source	prices as at 2001-01-01	Price SGD
8380	CENTRE ENGINE COVER	C2Z27834	Original torn ✓		580.00
8793	CTR HEAT SHIELD	C2Z4312	Original ?		390.00
8780	ENGINE PROTECTION	C2Z29109	Original ?		720.00
8781	L/F ENGINE PROT PNL	C2Z26070	Original ?		490.00
8782	R/F ENGINE PROT PNL	C2Z29103	Original ?		710.00
8892	SUMP CPL	C2Z30601	Original ?		7,800.00
Savings					0.00
Subtotal					10,690.00
Total					10,690.00

f: OEM Parts
n: Non-OEM Parts
u: Used parts

Radiator Air Guide Kn...
17
Radiator Hose

SINGAPORE ACCIDENT STATEMENT

IMPORTANT NOTICE

1. Please report correctly the details of the accident to speed up the claims process.
2. This Form must be completed by the Policyholder and/or the Actual Driver.
3. Information provided must be as truthful and accurate as possible. Any wilful misrepresentation or withholding of material facts may allow insurance companies to repudiate policy liability.
4. The issue and acceptance of this Form by insurance companies is not an admission of policy liability on the part of the insurance companies.
5. Any false reporting may be referred to the Police for investigation.
6. This report will be forwarded by the insurers of the GIA Records Management Centre established by the General Insurance Association of Singapore (GIA) for archiving and that copies of this report will, for a fee, be made available upon application by interested parties.
7. By the lodgement of this report to the insurers, you hereby consent to the archiving of this report at the centre and to copies of the report being made available aforesaid.

ACCIDENT STATEMENT

Date of Submission	26/08/2022 14:08 (SGT)
Reported by	Driver
Date of Accident	25/08/2022 20:00 (SGT)
Exact Location of Accident	PIE, Singapore
Additional Location Information	ALONG PIE TWRDS TUAS
Country/State of Loss	Singapore

DETAILS OF OWN VEHICLE

Vehicle Registration Number	SKL3618E
INSURED/POLICYHOLDER	
Is company?	No
Name Of Registered Owner	CHEONG SHI YA SHEENA
NRIC No	SXXXX614B
Email Address	cheongcl_88@gmail.com
Mobile Phone No	(Phone) +65-93678238
Alternative Phone No	-

VEHICLE PARTICULARS

Manufacturer	Jaguar
Model	Xf
Variant	2.2 I4D AUTO ABS D/AB 2WD 4DR HID TC
Exact purpose for which vehicle was being used at time of accident	Private use
Are you claiming under your own insurance policy for repair to your vehicle?	Yes
Vehicle Category	Private car
Transmission	Auto
CC	2179

INSURANCE COMPANY

Name of Insurance Company	China Taiping Insurance (Singapore) Pte. Ltd.
Policy Number / Cover Note Number	DMPCSNA00214662101

DRIVER

Name of Driver	CHEONG CHEE LEONG
NRIC No	SXXXX177Z
Date Of Birth	11/08/1950
Occupation	Indoor

Bonnet Hinge n° 1
Bonnet Hinge LH
30

Date Of Driving Pass 12/07/1973
 Driving experience 49 YEARS AND 1 MONTH
 Gender Male
 Mobile Number (Phone) +65-92389690
 Alt. Phone Number -
 Email Address cheongcl_88@gmail.com
 Address 3 JALAN ANAK BUKIT #14-05
 Address complement -
 Postcode 588998
 Is the driver the policyholder? No
 If No, Relationship of the Driver with the Insured Parent
 Does Driver Own Other Vehicles? No
 Vehicle Registration Number of Other Vehicle Owned by Driver -
 Insurance Company of Other Vehicle Owned by Driver -

GENERAL INFORMATION OF THE ACCIDENT

Type of Accident Fire, explosion or lightning
 Weather Conditions Clear
 Road Surface Dry

OTHER INFORMATION

Was any foreign vehicle involved in the accident? No
 Number of vehicles involved in the accident 1
 Was anybody injured in the Accident? No
 Was any injured conveyed to hospital by ambulance? -
 Was any other vehicle or property damaged? No
 Number of Passengers (Including Driver) 1
 Has the driver been approached by unknown person(s) soliciting/offering accident claims assistance? No
 Translator's name -
 Translator's ID -
 Translator's phone number -
 Translator's email -
 Original language used in the statement -

DETAILS OF POLICE ACTION

Was the accident reported to the police? No
 Was notice of intended Prosecution given? No
 If yes, against whom? -


CIRCUMSTANCES OF ACCIDENT

ON 25/8/22 AT ABT 2000HRS I WAS TRAVELLING ALONG PIE TWRDS TUAS. AS I WAS DRIVING SUDDENLY THE VEHICLE WAS ON FIRE.

ATTACHMENT(S)

Are accident photos available for attachment? Yes
 Was there any video captured by Car Camera? No

12	Front Bumper Lower Grille - 5310233190	7.50	\$	1,091.40
13	Front Grille Clips	1.00	\$	1,091.40

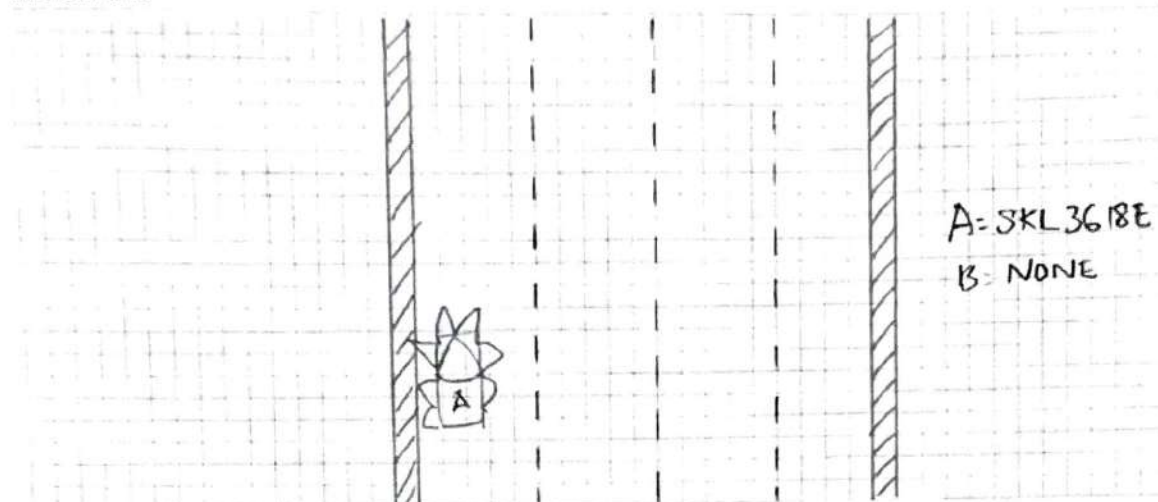

On 25/8/22 at abt 2000Hrs I was travelling Along PIE twrds Tuas.
As I was driving suddenly the vehicle was on fire.

I/We declare the foregoing particulars are true in every respect.

Reporting Centre Personnel's Signature
Name: _____
NRIC/FIN No.: _____

> Back to OneMotoring

Enquire PARF/COE Rebate for Registered Vehicle

Vehicle Owner Particulars

Owner ID Type:

Singapore NRIC

Owner ID:

614B

Vehicle Details

Vehicle No.:

SKL3618E

Vehicle to be Exported:

No

Intended Deregistration Date:

29 Aug 2022

Vehicle Make:

JAGUAR

Vehicle Model:

XF 2.2 I4D AUTO ABS D/AB 2WD 4DR HID TC

Primary Colour:

Grey

Manufacturing Year:

2013

Engine No.:

4032177224DT

Chassis No.:

SAJAC0565DDU00869

Maximum Power Output:

147.0 kW (197 bhp)

Open Market Value:

\$47,497.00

Original Registration Date:

30 Oct 2013

First Registration Date:

30 Oct 2013

Transfer Count:

2

Actual ARF Paid:

\$48,496.00

Intended PARF Rebate Details

PARF Eligibility:

Yes

PARF Eligibility Expiry Date:

29 Oct 2023

PARF Rebate Amount:

\$26,672.00

Intended COE Rebate Details

COE Expiry Date:

29 Oct 2023

COE Category:

E - Open Category

COE Period(Years):

10

QP Paid:

\$92,289.00

COE Rebate Amount:

\$10,256.00

Total Rebate Amount:

\$36,928.00

The information contained herein is correct as at 29 Aug 2022

OK