

ASS. REC. BY:

REF:

GAZ/

Kenneth

ASSIGNMENT

From:

Date:

Estimated Cost:

OD/TP/WS/TP RES/OD RES/EVA/INV/MV

To Inspect Vehicle No:

at Workshop m/s

of

Insured:

Policy No.

Claims No.

Sum Insured:

Excess:

(Client's Record)

Make of Veh:

(Policy Condition)

Remark: The veh had commenced its repair at the time of inspection.

Bal. or Market Value:

IDAC Accident Rpt:

Consistent? : Yes or No

GIA / PR Seen:

Consistent? : Yes or No

Est. Repairs:

05 days

Res.: Yes or No

Lum Sum:

20 %

3 Val.: Yes or No

CA / REV / REP. / 24 HRS

Date:

Person Contacted:

Vehicle: IN / OUT

Veh No:

SEA 830

Yr Regn:

12, 16

Type: M.Car / M.Cycle / Bus / Van / Lorry / Taxi / Prime Mover /

Truck / Trailer or

Make:

Honda Vezel

c.c.

1498

Colour

M. D. Blue

A/C:

Insured / Std / NI / NA

Sp. Reading

28682

T/Radio:

Insured / Std / NI / NA

Eng/No:

C/No:

RUI

1203716

Gen. Cond: Good / Fair / Poor / Burnt

Steering: In order / Jammed / Leaked / Burnt or

Brake: In order / Jammed / Leaked / Burnt or

Modl: NII / S/Rlm / STD / Rlm or

Tyre Size:

F:

215/60R16

R:

BS / DUN / EXNOVA / GY / FS / LIZA / MIC / OHTSU / PIR / SUMI /

TOYO / YOKO or

Front

Rear

R/Bal.

7

mm

R/Bal.

P

mm

L/Bal.

7

mm

L/Bal.

P

mm

D.O.A.

9/9/22

D.O.I.

13/9/2022

Survey held at

Des. of Damages: Frt / Rear / O/S / N/S / U/C / Rooftop or

The U/C / Chassis frame / Body Structure affected due to collision.

Date / Time

Action / Instruction

Date/Time, File Pass to?

☐

: Prell. Report

1)

☐

: Final Report

Date/Time, File Return to?

2)

Days Of Repair:

Resurvey No. of Trlp:

Survey Fee:

Transportation:

Add Fee:

☐

: Site Insp (\$

☐

: Interview (\$

☐

: Tech Invs (\$

☐

: Weekend (\$

) \$ + RS. \$

) P. & S.

) Others

)

Report Format :

Lump Sum / I.B.I: (\$

TOTAL

Cheng Hoe Motor Pte Ltd

Blk 1019, Yishun Industrial Park A #01-374/382, Singapore 768761
TEL: 67556142 (YIS) FAX: 67557719 (YIS) Email: chmotor@singnet.com.sg
GST:201001158E RCB NO:201001158E

SCA83U

OD/GA

M/S: GREAT AMERICAN INSURANCE COMPANY
3 TEMASEK AVE,
16-01 CENTENNIAL TOWER
SINGAPORE 039190

TEL: 68046037

FAX: 62353354

ATTN: Motor Claim Department

Claim No: ES2290934

Estimate No: ES2290934/YISHUN

Date: 13 Sep 2022

Policy No: MOMVP000004867-00-00

Veh Reg No: SCA83U.1

Make/Model: HONDA HONDA VEZEL
1.5X CVT

Chassis No: RU11203716

Engine No: L15B4403716

Reg. Date: 27/12/2016

WS Ref: OD/GA

Claim Type: Own Damage

Accident Date: 09/09/2022

Not Noted

11 Pump B

Running After Rain

Ex TBA

Estimate Repair Cost to Vehicle No : SCA83U.1

Description	U/Price	Quantity	Cost	Amount
			S\$	S\$
Cost Plus				
1 FRONT BUMPER	210.00	1 PC	210.00	✓
2 FRONT BUMPER LOWER GRILLE	55.00	1 PC	55.00	✓
3 FRONT BUMPER LOWER SKIRT	130.00	1 PC	130.00	✓
4 FRONT BUMPER LH FOG LAMP GARNISH	15.00	1 PC	15.00	✓
5 FRONT BUMPER RH FOG LAMP GARNISH	15.00	1 PC	15.00	X
6 FRONT BUMPER REINFORCEMENT	178.00	1 PC	178.00	✓
7 FRONT BUMPER REINFORCEMENT TOP TRIM LH	18.00	1 PC	18.00	✓
8 FRONT BUMPER REINFORCEMENT TOP TRIM RH	18.00	1 PC	18.00	✓
9 FRONT BUMPER REINFORCEMENT TOP TRIM CLIPS	2.00	6 PCS	12.00	✓
10 FRT SUPPORT PANEL	290.00	1 PC	290.00	✓
11 FRONT GRILLE UPPER	160.00	1 PC	160.00	✓
12 FRONT GRILLE EMBLEM	15.00	1 PC	15.00	✓
13 FRONT GRILLE CHROME MOULDING	50.00	1 PC	50.00	✓
14 FRONT GRILLE CLIPS	2.00	4 PCS	8.00	✓
15 FRONT GRILLE LH BRACKET	12.00	1 PC	12.00	✓
16 FRONT GRILLE RH BRACKET	12.00	1 PC	12.00	✓
17 LH HEADLAMP	920.00	1 PC	920.00	✓
18 RH HEADLAMP	920.00	1 PC	920.00	✓
19 HEADLAMP LOWER BRACKETS	24.00	2 PCS	48.00	✓
20 FRONT LH FENDER ARCH TRIM	50.00	1 PC	50.00	✓
21 FRONT RH FENDER ARCH TRIM	50.00	1 PC	50.00	X
22 BONNET	390.00	1 PC	390.00	✓
23 BONNET LOCK	65.00	1 PC	65.00	✓
24 BONNET FRONT RUBBER SEAL LH	15.00	1 PC	15.00	✓
25 BONNET FRONT RUBBER SEAL RH	15.00	1 PC	15.00	✓
26 BONNET SIDE RUBBER SEAL LH	16.00	1 PC	16.00	✓
27 BONNET SIDE RUBBER SEAL RH	16.00	1 PCS	16.00	✓
28 BONNET INSULATOR CLIPS	2.00	6 PCS	12.00	✓
29 BONNET HINGES	30.00	2 PCS	60.00	✓
30 BONNET LOCK BRACKET	24.00	1 PC	24.00	✓
31 BONNET LOCK BRACKET CLIPS	2.00	4 PCS	8.00	✓
32 FRONT AIR DUCT CLIPS	2.00	4 PCS	8.00	✓
33 FRONT SUPPORT TOP COVER	50.00	1 PC	50.00	X
34 FRT SUPPORT TOP COVER CLIPS	2.00	8 PCS	16.00	✓
35 AIR-CON CONDENSER	320.00	1 PC	320.00	✓
36 HORN	45.00	1 PC	45.00	✓

Cheng Hoe Motor Pte Ltd

Blk 1019, Yishun Industrial Park A #01-374/382, Singapore 768761
TEL: 67556142 (YIS) FAX: 67557719 (YIS) Email: chmotor@singnet.com.sg
GST:201001158E RCB NO:201001158E

M/S : GREAT AMERICAN INSURANCE COMPANY
3 TEMASEK AVE,
16-01 CENTENNIAL TOWER
SINGAPORE 039190

TEL: 68046037 FAX: 62353354

ATTN: Motor Claim Department

WS Ref: OD/GA
Claim Type: Own Damage
Accident Date: 09/09/2022

Claim No: ES2290934
Estimate No: ES2290934/YISHUN
Date: 13 Sep 2022
Policy No: MOMVP000004867-00-00
Veh Reg No: SCA83U.1
Make/Model: HONDA HONDA VEZEL
1.5X CVT
Chassis No: RU11203716
Engine No: L15B4403716
Reg. Date: 27/12/2016

Estimate Repair Cost to Vehicle No : SCA83U.1

Description	U/Price	Quantity	Cost	Amount
			<u>S\$</u>	<u>S\$</u>
			4,246.00	
	Add 10%		424.60	4,670.60
Special Net				
37 FRONT NUMBER PLATE	35.00	1 PC <i>cm</i>	35.00 ✓	35.00
Labour				
38 REMOVE DAMAGED PARTS & ATTACHMENTS,PANEL BEAT & REPAIR FRT FENDERS,FRT SUPPORT PANEL,SIDE INNER FRAME PANELS	850.00	1 LA	850.00 <i>600</i>	
39 REMOVE AND REFIX AIRCON,CHECK,VACUUM & REFILL GAS	100.00	1 LA	100.00 ✓	
40 PAINTING - FRT BUMPER,BONNET,HINGES,FRT FENDERS,SUPPORT PANEL,INNER PANEL,FRT BUMPER REINFORCEMENT	900.00	1 LA	900.00 <i>800</i>	
				1,850.00

Total S\$ 6,555.60

Add GST @ 7% 458.89

Total Amount payable S\$ 7,014.49

LKK Auto Consultants hence notify the Repairer of the following:

- To resurvey before/after spray painting
- To display damaged part(s) during resurvey
- Parts prices are subject to confirmation
- Third party survey is on a "Without Prejudice" basis
- No illegal modification(s) is allowed
- Supplementary item(s) must be resurveyed and is subject to final approval from Insurance Company

Acknowledged by Repairer

Signature:

Date:

For Cheng Hoe Motor Pte Ltd

[Signature]
AUTHORISED SIGNATURE

> Back to OneMotoring

Enquire PARF/COE Rebate for Registered Vehicle

Vehicle Owner Particulars

Owner ID Type:	Singapore NRIC
Owner ID:	619B

Vehicle Details

Vehicle No.:	SCA83U
Vehicle to be Exported:	No
Intended Deregistration Date:	12 Sep 2022
Vehicle Make:	HONDA
Vehicle Model:	VEZEL 1.5X CVT
Primary Colour:	Blue
Manufacturing Year:	2016
Engine No.:	L15B4403716
Chassis No.:	RU11203716
Maximum Power Output:	96.0 kW (128 bhp)
Open Market Value:	\$22,217.00
Original Registration Date:	27 Dec 2016
First Registration Date:	27 Dec 2016
Transfer Count:	1
Actual ARF Paid:	\$13,104.00

Intended PARF Rebate Details

PARF Eligibility:	Yes
PARF Eligibility Expiry Date:	26 Dec 2026
PARF Rebate Amount:	\$9,172.00

Intended COE Rebate Details

COE Expiry Date:	26 Dec 2026
COE Category:	A - Car up to 1600cc & 97kW (130bhp)
COE Period(Years):	10
QP Paid:	\$39,690.00
COE Rebate Amount:	\$20,580.00
Total Rebate Amount:	\$29,752.00

The information contained herein is correct as at 12 Sep 2022

OK

SINGAPORE ACCIDENT STATEMENT

IMPORTANT NOTICE

1. Please report correctly the details of the accident to speed up the claims process.
2. This Form must be completed by the Policyholder and/or the Actual Driver.
3. Information provided must be as truthful and accurate as possible. Any wilful misrepresentation or withholding of material facts may allow insurance companies to repudiate policy liability.
4. The issue and acceptance of this Form by insurance companies is not an admission of policy liability on the part of the insurance companies.
5. Any false reporting may be referred to the Police for investigation.
6. This report will be forwarded by the insurers of the GIA Records Management Centre established by the General Insurance Association of Singapore (GIA) for archiving and that copies of this report will, for a fee, be made available upon application by interested parties.
7. By the lodgement of this report to the insurers, you hereby consent to the archiving of this report at the centre and to copies of the report being made available aforesaid.

ACCIDENT STATEMENT

Date of Submission 12/09/2022 17:10 (SGT)
Reported by Both
Date of Accident 09/09/2022 18:30 (SGT)
Exact Location of Accident Malaysia
Additional Location Information M'SIA JOHOR BAHRU CAUSEWAY
Country/State of Loss Singapore

DETAILS OF OWN VEHICLE

Vehicle Registration Number SCA83U

INSURED/POLICYHOLDER

Is company? No
Name Of Registered Owner KOAY SWEE HENG
NRIC No SXXXX619B
Email Address james_koay@esgroup.com.sg
Mobile Phone No (Phone) +65-91394551
Alternative Phone No -

VEHICLE PARTICULARS

Manufacturer Honda
Model VEZEL 1.5X CVT
Variant -
Exact purpose for which vehicle was being used at time of accident Private use
Are you claiming under your own insurance policy for repair to your vehicle? Yes
Vehicle Category Private car
Transmission Auto
CC 1496

INSURANCE COMPANY

Name of Insurance Company Great American Insurance Company
Policy Number / Cover Note Number MOMVP000004867-00-000

DRIVER

Name of Driver KOAY SWEE HENG
NRIC No SXXXX619B
Date Of Birth 25/12/1968
Occupation Indoor

Describe Circumstance of the Accident


NOTE: PLEASE TAKE NOTE THAT YOUR INSURER HAVE 14 DAYS TIME FRAME for you to submit OWN DAMAGE Claim under your Own Comprehensive policy. Pls check your policy for more information.

☒ Claim Own Policy

☐ Claim Third party

☐ Claim OD/ TP at other workshop ☐ Reporting Only

Sketch Plan

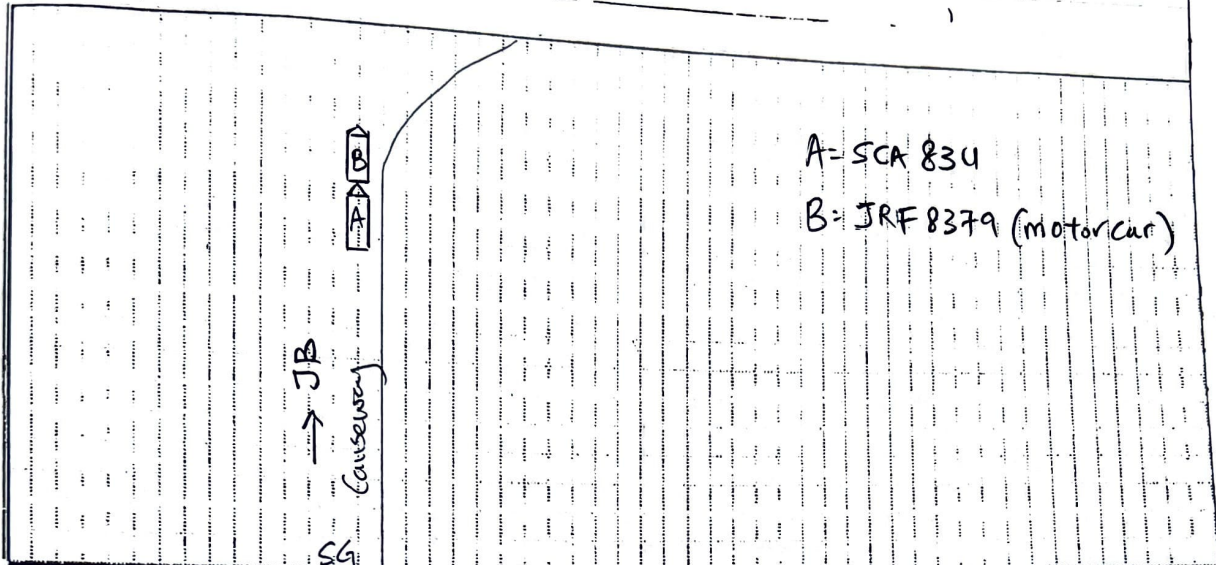

On 9/9/2022 at about 1830 hrs, i was driving motorcar no. SCA 83 U, Type Honda Vezel from Singapore to Johor Bahru. While i was driving at Johor Bahru causeway (m'sia side), suddenly a motorcar in front no. JRF 8379 brakes, i can't stop in time and hit into the rear part of the motorcar. There was no injury during the accident. The damage to my motorcar was the front part, bumper, panel, engine cover, left+right light, sensor, water tank and other damage which is not determine yet.

Also refer to m'sia police report.

Declaration

I/We declare the foregoing particulars are true in every respect.

Policyholder's Signature / Date & Time

Driver's Signature (if driver is not the policyholder) / Date & Time

Witnessed by Reporting Centre Personnel
(Name as in NRIC/ID card)

(45)