

Case Details

Case Reference Number : TAX/09/22/2029
Type of Repair : Accident Repair
Vehicle Registration Number : SHB1178J

Company Type : Strides Taxi Pte Ltd
Estimation ID : EST-19358-ID
Assigned By : Taxi Claims Manager Team

Insurance Company Name : AIG Asia Pacific Insurance Pte Ltd
Accident Date and Time : 02/09/2022 09:00 AM
Vehicle Age(In Months) : -

Documents / Photographs

View Documents / Photographs

Total Documents: 0

Estimation Details

Spare Part's Cost Detail

BOM Type	Costing Type	Portion	Material Number	SMRT Recommendation					Surveyor Approval					Remarks
				Part Name	Qty	List Price Per Unit(\$)	List Price(\$)	Dis(%)	Final Price(\$)	Repair/ Replace	Surveyor Quantity	Surveyor Final Price(\$)	Repair/Replace	
One Time Key In	Main			CABLE ASM-HOOD PRIM LAT REL	1	9.75	9.75	10.00	8.78	Replace	1	8.78	Replace	bt/
One Time Key In	Main			BRACKET-F/FDR FRT LWR - LH	1	15.81	15.81	10.00	14.23	Replace	1	14.23	Replace	ne/
Standard	Main			NUMBER PLATE	1	35.00	35.00	0.00	35.00	Replace	1	35.00	Replace	bt/
Standard	Main			NUMBER PLATE FRAME	1	25.00	25.00	0.00	25.00	Replace	1	25.00	Replace	cm/
Standard	Main			HOOD ASM	1	2,407.29	2,407.29	10.00	2,166.56	Replace	1	2,166.5	Replace	buc/
Standard	Main			HINGE ASM-HOOD - RH	1	54.81	54.81	10.00	49.33	Replace	0	0	Not Give	Xn/
Standard	Main			HINGE ASM-HOOD - LH	1	54.81	54.81	10.00	49.33	Replace	0	0	Not Give	Xn/
Standard	Main			WEATHERSTRIP ASM-HOOD RR	1	20.80	20.80	10.00	18.72	Replace	1	18.72	Replace	ne/
Standard	Main			BUMPER-HOOD	4	6.00	24.00	10.00	21.60	Replace	4	21.60	Replace	de/
Standard	Main			HOOD INSULATOR-F/CMPT	1	70.92	70.92	10.00	63.83	Replace	1	63.83	Replace	de/
Standard	Main			HOOD INSULATOR CLIP-F/CMPT INSL	12	0.31	3.72	10.00	3.35	Replace	12	3.35	Replace	ne/
Standard	Main			PLUG-HOOD	2	0.42	0.84	10.00	0.76	Replace	2	0.76	Replace	ne/
Standard	Main			LATCH ASM-HOOD	1	80.70	80.70	10.00	72.63	Replace	1	72.63	Replace	bt/
Standard	Main			FENDER ASM-FRT - L	1	379.81	379.81	10.00	341.83	Replace	1	341.83	Replace	buc/

Total Spare Part Cost 15,061.93

Surveyor Total 10,034.25

Lump Sum Discount (%) 0.00

Lump Sum Dis (%) 0

Final Spare Part Cost 15,061.93

Final Sur Total 10,034.25

BOM Type	Costing Type	Portion	Material Number	SMRT Recommendation							Surveyor Approval				Costing Type	Standard	Main
				Part Name	Qty	List Price Per Unit(\$)	List Price(\$)	Dis(%)	Final Price(\$)	Repair/ Replace	Surveyor Quantity	Surveyor Final Price(\$)	Repair/Replace	Remarks			
Standard	Main			BRACKET-F/FDR FRT LWR -LH	1	15.80	15.80	10.00	14.22	Replace	1	14.22	Replace	✓	✓		
Standard	Main			INSULATOR ASM-F/FDR -LH	1	29.22	29.22	10.00	26.30	Replace	0	0	Check	✓	?		
Standard	Main			INSULATOR ASM-F/FDR MID -LH	1	8.94	8.94	10.00	8.05	Replace	0	0	Check	✓	?		
Standard	Main			FENDER ASM-FRT-RH	1	379.81	379.81	35.00	246.88	Replace	1	0	Repair	✓	R		
Standard	Main			BRACKET-F/FDR FRT LWR - RH	1	15.81	15.81	35.00	10.28	Replace	0	0	Not Give	✓	X		
Standard	Main			INSULATOR ASM-F/FDR-RH	1	29.22	29.22	10.00	26.30	Replace	0	0	Not Give	✓	X		
Standard	Main			INSULATOR ASM-F/FDR MID - RH	1	8.94	8.94	10.00	8.05	Replace	0	0	Not Give	✓	X		
Standard	Main			DOOR ASM-FRT SI - LH	1	2,338.76	2,338.76	10.00	2,104.88	Replace	1	0	Repair	✓	R		
Standard	Main			STICKER STRIDES TAXI (DOOR)	1	60.00	60.00	0.00	60.00	Replace	1	60.00	Replace	✓	✓		
Standard	Main			MODULE-FRT END	1	295.26	295.26	10.00	265.73	Replace	1	265.73	Replace	✓	✓		
Standard	Main			BRACKET ASM-HDLP UPP - LH	1	22.57	22.57	10.00	20.31	Replace	1	20.31	Replace	✓	✓		
Standard	Main			BRACKET ASM-HDLP UPP - RH	1	22.57	22.57	10.00	20.31	Replace	1	20.31	Replace	✓	✓		
Standard	Main			BAR ASM-DA PNL UPR CR - LH	1	198.22	198.22	10.00	178.40	Replace	1	0	Repair	✓	R		
Standard	Main			LINER ASM-FRT W/H - LH	1	125.22	125.22	10.00	112.70	Replace	1	112.70	Replace	✓	cut		
Standard	Main			DEFLECTOR-U/B FRT	1	169.72	169.72	10.00	152.75	Replace	1	152.75	Replace	✓	✓		
Standard	Main			FASCIA-FRT BPR	1	721.66	721.66	10.00	649.49	Replace	1	649.49	Replace	✓	✓		
Standard	Main			GRILLE-FRT BPR FASCIA LOWER	1	149.03	149.03	10.00	134.13	Replace	1	134.13	Replace	✓	✓		
Standard	Main			FINISHER-FRT BPR LOWER - LH	1	20.38	20.38	10.00	18.34	Replace	0	0	Check	✓	?		
Standard	Main			FINISHER-FRT BPR - RH	1	20.38	20.38	10.00	18.34	Replace	0	0	Check	✓	?		
Standard	Main			COVER-FRT FOG LP - LH	1	40.25	40.25	10.00	36.23	Replace	1	36.23	Replace	✓	✓		
Standard	Main			COVER-FRT FOG LP - RH	1	40.25	40.25	10.00	36.23	Replace	1	36.23	Replace	✓	✓		
Standard	Main			FINISHER-FRT FOG LP CVR - LH	1	47.32	47.32	10.00	42.59	Replace	1	42.59	Replace	✓	✓		

Total Spare Part Cost 15,061.93

Surveyor Total 10,034.25

Lump Sum Discount (%) 0.00

Lump Sum Dis (%) 0

2 PM

SMRT Recommendation

Surveyor Approval

Costing Type	Portion	Material Number	Part Name	Qty	List Price Per Unit(\$)	List Price(\$)	Dis(%)	Final Price(\$)	Repair/ Replace	Surveyor Quantity	Surveyor Final Price(\$)	Repair/Replace	Remarks
Standard	Main		FINISHER-FRT FOG LP CVR - RH	1	47.32	47.32	10.00	42.59	Replace	1	42.59	Replace	scu
Standard	Main		BRACKET-FRT BPR FASCIA - LH	1	23.09	23.09	10.00	20.78	Replace	1	20.78	Replace	scu
Standard	Main		BRACKET-FRT BPR FASCIA - RH	1	23.09	23.09	10.00	20.78	Replace	1	20.78	Replace	scu
Standard	Main		COVER-FRT BPR FASCIA TOWG	1	17.78	17.78	10.00	16.00	Replace	0	0	Not Give	X??
Standard	Main		FINISHER-FRT BPR - RH	1	98.80	98.80	10.00	88.92	Replace	1	88.92	Replace	scu
Standard	Main		SUPPORT-FRT BPR FASCIA UPR	1	172.33	172.33	10.00	155.10	Replace	0	0	Check	?
Standard	Main		BOLT/SCREW-FRT BPR FASCIA	21	0.15	3.15	10.00	2.84	Replace	21	2.83	Replace	scu
Standard	Main		BOLT/SCREW-FRT BPR IMP BAR	5	0.73	3.65	10.00	3.29	Replace	5	3.29	Replace	scu
Standard	Main		NUT-RAD GRL	4	2.18	8.72	10.00	7.85	Replace	4	7.85	Replace	scu
Standard	Main		BOLT/SCREW-FRT BPR FASCIA	4	0.15	0.60	10.00	0.54	Replace	4	0.54	Replace	scu
Standard	Main		CLIP-FRT BPR FASCIA BRKT	2	1.95	3.90	10.00	3.51	Replace	2	3.51	Replace	scu
Standard	Main		PANEL ASM-LEG CTHR	1	131.04	131.04	10.00	117.94	Replace	1	117.94	Replace	bt
Standard	Main		BAR ASM-FRT BPR IMP	1	624.00	624.00	10.00	561.60	Replace	1	561.60	Replace	bt
Standard	Main		BOLT/SCREW-FRT BPR IMP BAR	10	1.66	16.60	10.00	14.94	Replace	10	14.94	Replace	scu
Standard	Main		GRILLE ASM-RAD	1	978.02	978.02	10.00	880.22	Replace	1	880.22	Replace	scu
Standard	Main		BRACKET-F/CMPT TR PLT	1	55.33	55.33	10.00	49.80	Replace	0	0	Not Give	X??
Standard	Main		BRACKET-F/CMPT TR PLT	1	44.51	44.51	10.00	40.06	Replace	0	0	Not Give	X??
Standard	Main		COVER-F/CMPT ORNA	1	217.67	217.67	10.00	195.90	Replace	1	195.90	Replace	scu
One Time Key In	Main		RIVET-F/CMPT ORNA CVR	10	1.25	12.50	10.00	11.25	Replace	10	11.25	Replace	scu
One Time Key In	Main		BOLT/SCREW-F/CMPT ORNA CVR	6	0.52	3.12	6.00	2.93	Replace	6	2.93	Replace	scu
Standard	Main		HEADLAMP ASM - LH	1	1,098.86	1,098.86	10.00	988.97	Replace	1	988.97	Replace	scu
Standard	Main		HEADLAMP ASM - RH	1	1,098.86	1,098.86	10.00	988.97	Replace	1	988.97	Replace	scu

Total Spare Part Cost 15,061.93

Surveyor Total 10,034.25

Lump Sum Discount (%) 0.00

Lump Sum Dis (%) 0

Final Spare Part Cost 15,061.93

Final Sur Total 10,034.25

SMRT Recommendation													Surveyor Approval	Costing	Man	Total
BOM Type	Costing Type	Portion	Material Number	Part Name	Qty	List Price Per Unit(\$)	List Price(\$)	Dis(%)	Final Price(\$)	Repair/ Replace	Surveyor Quantity	Surveyor Final Price(\$)	Repair/Replace			
Standard	Main			SOCKET-CHRG	1	2,036.74	2,036.74	10.00	1,833.07	Replace	0	0	Check	?		
Standard	Main			FAN ASM-ENG CLG	1	881.09	881.09	10.00	792.98	Replace	1	792.98	Replace	?		
Standard	Main			INSULATOR-RAD UPR	2	10.92	21.84	10.00	19.65	Replace	0	0	Check	?		
Standard	Main			RADIATOR ASM	1	547.87	547.87	10.00	493.08	Replace	1	493.08	Replace	?		
Standard	Main			COOLANT	1	12.30	12.30	0.00	12.30	Replace	1	12.30	Replace	?		
Standard	Main			INSULATOR-RAD LWR	2	3.95	7.90	10.00	7.11	Replace	0	0	Check	?		
Standard	Main			CONDENSER ASM-A/C	1	516.78	516.78	10.00	465.10	Replace	1	465.10	Replace	?		
Standard	Main			SHROUD ASM-RAD CLG - RH	1	14.77	14.77	10.00	13.29	Replace	0	0	Check	?		
Standard	Main			SHROUD ASM-RAD CLG	1	12.79	12.79	10.00	11.51	Replace	0	0	Check	?		
Standard	Main			SHROUD ASM-RAD CLG	1	12.79	12.79	10.00	11.51	Replace	0	0	Check	?		
Standard	Main			SHROUD ASM-RAD CLG	1	14.77	14.77	10.00	13.29	Replace	0	0	Check	?		
Standard	Main			LINER ASM-FRT W/H - RH	1	125.32	125.32	10.00	112.79	Replace	0	0	Check	?		
Total Spare Part Cost									15,061.93	Surveyor Total		10,034.25				
Lump Sum Discount (%)									0.00	Lump Sum Dis (%)		0				
Final Spare Part Cost									15,061.93	Final Sur Total		10,034.25				

Labour's Cost Detail

S.No.	Costing Type	Job Scope	SMRT Recommendation(\$)	Surveyor Adjustment(\$)	Remarks
1	Main	TO REPAIR FRONT PORTION	3,600.00	1,500.00	
Total:			3,600.00	1,500.00	

Spray Cost Detail

S.No.	Costing Type	Job Scope	SMRT Recommendation(\$)	Surveyor Adjustment(\$)	Remarks
1	Main	TO RESPRAY FRONT BUMPER	428.00	220.00	
2	Main	TO RESPRAY FRONT HOOD	428.00	220.00	
3	Main	TO RESPRAY FRONT FENDER RH	428.00	220.00	
4	Main	TO RESPRAY FRONT FENDER LH	428.00	220.00	
Total:			2,370.00	1,250.00	

Approval
Repair/Replace
Remarks

2 PM

Costing Type	Job Scope	SMRT Recommendation(\$)	Surveyor Adjustment(\$)	Remarks
Main	TO RESPRAY FRT MEMBER,LH	230.00	150.00	
6 Main	TO RESPRAY FRONT DOOR LH	428.00	220.00	
Total:		2,370.00	1,250.00	

Other Cost Detail

S.No.	Costing Type	Job Scope	SMRT Recommendation(\$)	Surveyor Adjustment(\$)	Remarks
1	Main	TOWING CHARGE	112.00	0 <i>X 11?</i>	request invoice
2	Main	TO WASH AND VACUUM	60.00	0 <i>X 11</i>	
3	Main	TO CHECK WIRING AND SYSTEM FUNCTION	120.00	40.00	
4	Main	TO APPLY RUST-PROOFING ON AFFECTED AREA	100.00	80.00	
5	Main	TO REPLACE SUNDRY PARTS	100.00	0 <i>X 11</i>	
6	Main	TO CHECK & RESET SYSTEM FUNCTION	350.00	150.00	
7	Main	ISOLATED OF (EV) (NET)	150.00	150.00	
8	Main	TO TOP UP A/C GAS	120.00	100.00	
9	Main	TO CONDUCT RADIATOR PRESSURE CHECK	120.00	50.00	
Total:			1,232.00	570.00	

Summary

	Estimator Assesment(\$)	Surveyor Assesment(\$)
Total Spare Part Detail	15,061.93	10,034.25
Total Labour Cost	3,600.00	1,500.00
Total Spray Painting	2,370.00	1,250.00
Other	1,232.00	570.00
Overall Total	22,263.93	13,354.25
Lump Sum Repair Option		☐
Lump Sum Total	0.00	13,354.25
Surveyor Approved Amount		13,354.25
No of Repair Days*	12	10

9/14/22, 5:12 PM

https://vacswb.smrt.com.sg/Estimation.aspx

9/14/22, 5:12 PM

Estimator Assessment(\$)

Surveyor Assessment(\$)


Remarks

part by part / Before paint photo , After repair photo
CHECK ITEM and REPLACE ITEM PLEASE CALL
CUSTOMER SERVICE / 02-0001 0050

Surveyor Name

Rasul

Signature

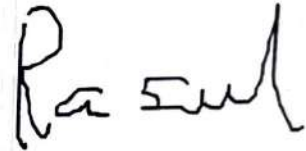

Save

Clear

Survey Date

14/09/2022

LKK Auto Consultancy hereby notify
the Repairer of the following:

- To resurvey before/after spray painting
- To display damaged part(s) during resurvey
- Parts prices are subject to confirmation
- Third party survey is on a "Without Prejudice" basis
- No illegal modification(s) is allowed
- Supplementary item(s) must be resurveyed and is subject to final approval from Insurance Company

Acknowledged by Repairer

Signature:

Date:

SINGAPORE ACCIDENT STATEMENT

IMPORTANT NOTICE

1. Please report correctly the details of the accident to speed up the claims process.
2. This Form must be completed by the Policyholder and/or the Actual Driver
3. Information provided must be as truthful and accurate as possible. Any wilful misrepresentation or withholding of material facts may allow insurance companies to repudiate policy liability.
4. The issue and acceptance of this Form by insurance companies is not an admission of policy liability on the part of the insurance companies.
5. Any false reporting may be referred to the Police for investigation.
6. This report will be forwarded by the insurers of the GIA Records Management Centre established by the General Insurance Association of Singapore (GIA) for archiving and that copies of this report will, for a fee, be made available upon application by interested parties.
7. By the lodgement of this report to the insurers, you hereby consent to the archiving of this report at the centre and to copies of the report being made available aforesaid.

ACCIDENT STATEMENT

Date of Submission	13/09/2022 13:47 (SGT)
Reported by	Driver
Date of Accident	02/09/2022 17:00 (SGT)
Exact Location of Accident	Yishun Ring Rd, Singapore
Additional Location Information	YISHUN RING ROAD / YISHUN AVE 3
Country/State of Loss	Singapore

DETAILS OF OWN VEHICLE

Vehicle Registration Number	SHB1178J
-----------------------------	----------

INSURED/POLICYHOLDER

Is company?	Yes
Name Of Registered Owner	Strides Taxi Pte Ltd
Company Reg No	1XXXXX369K
Email Address	AUTO-SVCS-TARC@SMRT.COM.SG
Mobile Phone No	(Phone) +65-68662671
Alternative Phone No	-

VEHICLE PARTICULARS

Manufacturer	MG
Model	MG 5
Variant	-
Exact purpose for which vehicle was being used at time of accident	-
Are you claiming under your own insurance policy for repair to your vehicle?	No - Claiming third party
Vehicle Category	Taxi
Transmission	Auto
CC	1

INSURANCE COMPANY

Name of Insurance Company	MS First Capital Insurance Ltd
Policy Number / Cover Note Number	D-22099115MFSH

DRIVER

Name of Driver	ABDUL RAHMAN BIN SHARIFF
NRIC No	SXXXX763H
Date Of Birth	31/08/1957
Occupation	Outdoor

Date Of Driving Pass	14/07/2009
Driving experience	13 YEARS AND 2 MONTHS
Gender	Male
Mobile Number	(Phone) +65-68662672
Alt. Phone Number	-
Email Address	AUTO-SVCS-TARC@SMRT.COM.SG
Address	11
Address complement	-
Postcode	-
Is the driver the policyholder?	No
If No, Relationship of the Driver with the Insured	Hirer
Does Driver Own Other Vehicles?	No
Vehicle Registration Number of Other Vehicle Owned by Driver	-
Insurance Company of Other Vehicle Owned by Driver	-

GENERAL INFORMATION OF THE ACCIDENT

Type of Accident	Side Swipe
Weather Conditions	Clear
Road Surface	Dry

OTHER INFORMATION

Was any foreign vehicle involved in the accident?	No
Number of vehicles involved in the accident	2
Was anybody injured in the Accident?	Yes
Was any injured conveyed to hospital by ambulance?	Yes
Was any other vehicle or property damaged?	Yes
Number of Passengers (Including Driver)	2
Has the driver been approached by unknown person(s) soliciting/offering accident claims assistance?	No
Translator's name	-
Translator's ID	-
Translator's phone number	-
Translator's email	-
Original language used in the statement	-

PASSENGER 1

Name	JJAGDISH
Gender	Male

DETAILS OF POLICE ACTION

Was the accident reported to the police?	Yes
Police Station Name	Bukit Panjang Neighbourhood Police Centre
Police Station Address	No.1 Segar Road #01-05 Singapore 677738
Was notice of intended Prosecution given?	No
If yes, against whom?	-

CIRCUMSTANCES OF ACCIDENT

REFER TO POLICE REPORT - T/20220903/2096

ATTACHMENT(S)

Are accident photos available for attachment?	Yes
Was there any video captured by Car Camera?	Yes
Reasons for not uploading a video of the accident	FILE TOO BIG

DETAILS OF OTHER VEHICLE PROPERTY 1

SLX9781B

Accident
Vehicle Registration
Manufacturer
Model
Variant
Vehicle Colour
Vehicle Category
Name of Driver
Contact Number
Address
Address complement
Postcode
Insurance Company Name
Nature Of Damage
Details of property damaged in accident
No. Of Passenger (Including Driver)

Private car

INJURED PERSONS DETAILS

INJURED 1

Name of injured person	ABDUL RAHMAN
Gender	Male
Phone No	-
Address	-
Address Complement	-
Post Code	-
Approximate Age Years Old	-
Injuries Sustained	-
Injured person in which vehicle?	SHB1178J
Were seat belts worn?	-
Was this injured conveyed to hospital by ambulance?	Yes

INJURED 2

Name of injured person	JAGDISH
Gender	Male
Phone No	-
Address	-
Address Complement	-
Post Code	-
Approximate Age Years Old	-
Injuries Sustained	-
Injured person in which vehicle?	SHB1178J
Were seat belts worn?	-
Was this injured conveyed to hospital by ambulance?	No

SKETCH PLAN

IMPORTANT NOTICE

1. Please report correctly the details of the accident to speed up the claims process.
2. This Form must be completed by the Policyholder and/or the Actual Driver.
3. Information provided must be as truthful and accurate as possible. Any wilful misrepresentation or withholding of material facts may allow insurance companies to reputate policy liability.
4. The issue and acceptance of this Form by insurance companies is not an admission of policy liability on the part of the insurance companies.
5. **Any false reporting may be referred to the Traffic Police Department for investigation.**
6. This report will be forwarded by the insurers to the GIA Records Management Centre established by the General Insurance Association of Singapore (GIA) for archiving and that copies of this report will for a fee be made available upon application by interested parties.
7. By the lodgement of this report to the insurers, you hereby consent to the archiving of this report at the centre and to copies of the report being made available aforesaid.

8. Consent under the Personal Data Protection Act (PDPA)

I understand, acknowledge, agree and consent that:

- (a) My insurer, my workshop and the General Insurance Association of Singapore ("GIA") may/are permitted to collect, use, disclose and/or process my personal data/personal information set out in this [form] and any other personal information provided by me or possessed by my insurer (collectively the "Personal Information") and disclose and transfer such Personal Information to all insurer(s) who have insured vehicle(s) involved in this accident (all insurer(s) who have insured vehicle(s) involved in this accident shall be collectively referred to as the "Insurers"), the Insurers' lawyers/law firms, the Monetary Authority of Singapore and any relevant government agency/authority (such as the police), for the purpose(s) of:
- (i) processing, handling and/or dealing with my claims including the settlement of the claims and any necessary investigations relating to the claims;
- (ii) investigating the accident and/or my claims;
- (iii) carrying out and/or dealing with my instructions or responding to any enquiries by me;
- (iv) administering my claims (including the mailing of correspondence, statements, invoices, reports or notices to me, which could involve disclosure of certain personal data about me to bring about delivery of the same as well as on the external cover of envelopes/mail packages); and/or
- (v) complying with applicable law in administering, processing, handling and/or dealing with my claims.
- (collectively the "Purposes")

- (b) all insurer(s) who have insured vehicle(s) involved in this accident and the Insurers' lawyers/law firms, may/are permitted to collect, use, disclose and/or process my Personal Information for one or more of the above Purposes, and
- (c) my Personal Information may/can be disclosed by any of the Insurers and/or GIA to their third-party service providers or agents (including their lawyers/law firms), which may be sited outside of Singapore, for one or more of the above Purposes.




Policyholder's Signature / Date & Time

Actual Driver's Signature (if driver is not the policyholder) / Date & Time

Witnessed by Reporting Centre Personnel
(Name as in NRIC/ID card)

Sketch Plan

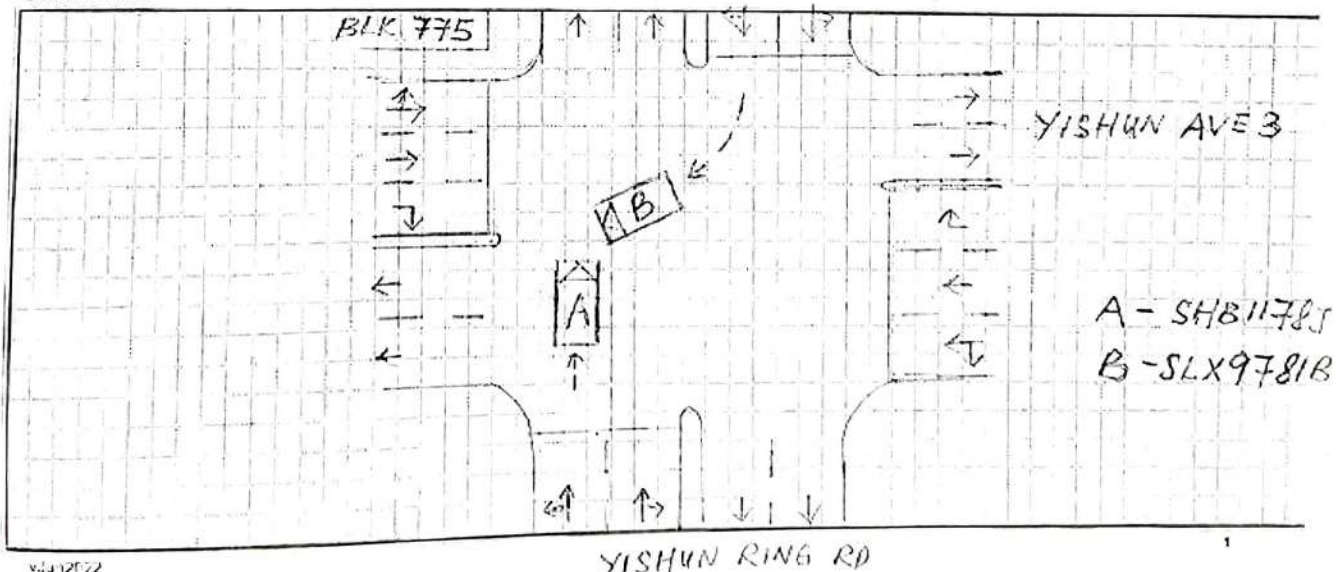

Describe Circumstance of the Accident

Lined area for describing the accident circumstances.

Declaration

I/We declare the foregoing particulars are true in every respect.



Policyholder's Signature / Date & Time

[Signature] 22/9/22

Actual Driver's Signature (if driver is not the policyholder) / Date & Time

[Signature] 13.9.2022

Witnessed by Reporting Centre Personnel (Name as in NRIC/ID card)

> Back to OneMotoring

Enquire PARF/COE Rebate for Registered Vehicle

Owner ID Type:	Company
Owner ID:	369K
Vehicle No.:	SHB1178J
Vehicle to be Exported:	No
Intended Deregistration Date:	15 Sep 2022
Vehicle Make:	M.G.
Vehicle Model:	MG5 EV EXCITE T
Primary Colour:	Green
Manufacturing Year:	2021
Engine No.:	-
Chassis No.:	LSJE24035MG051362
Maximum Power Output:	120.0 kW (160 bhp)
Open Market Value:	\$29,058.00
Original Registration Date:	23 Sep 2021
First Registration Date:	23 Sep 2021
Transfer Count:	0
Actual ARF Paid:	\$5,000.00
PARF Eligibility:	Yes
PARF Eligibility Expiry Date:	22 Sep 2029
PARF Rebate Amount:	\$3,750.00
COE Expiry Date:	22 Sep 2029
COE Category:	A - Car up to 1600cc & 97kW (130bhp)
COE Period(Years):	8
PQP Paid:	\$37,364.00
COE Rebate Amount:	\$32,784.00
Total Rebate Amount:	\$36,534.00

Please note that the 8-year COE for this vehicle cannot be further renewed. The vehicle must be de-registered upon COE expiry or when the vehicle reaches its statutory lifespan (if applicable), whichever is earlier.

The information contained herein is correct as at 15 Sep 2022

OK