

ASS. REC. BY:

REP:

CS/CT22009762/Anyz

ASSIGNMENT

From: _____ Date: _____

Estimated Cost: _____

OD / TP / WS / TP RES / OD RES / EVA / INV / MV

To Inspect Vehicle No: _____

at Workshop m/s _____

of _____

Insured: _____

Policy No. _____

Claims No. _____

Sum Insured: _____ Excess: _____

(Client's Record)

Make of Veh: _____

(Policy Condition)

Remark: The veh had commenced its
repair at the time of inspection.

N/S	O/S

Bal. or Market Value: _____

IDAC Accident Rpt: _____ Consistent? : Yes or No

GIA / PR Seen: _____ Consistent? : Yes or No

Est. Repairs: 18 days Res.: Yes or No

Lum Sum: _____ % 3 Val.: Yes or No

CA / REV / REP. / 24 HRS

Vehicle: IN / OUT

Date: _____ Person Contacted: _____

Veh No: SML8374B Yr Regn: 2019, June

Type: M.Car / M.Cycle / Bus / Van / Lorry / Taxi / Prime Mover /

Truck / Trailer or

Make: Kia Creta c.c. 1591

Colour: Red A/C: Insured / Std / NI / NA

Sp. Reading: 45077 T/Radio: Insured / Std / NI / NA

Eng/No: _____

C/No: KNA F5416 MK 5031561

Gen. Cond: Good / Fair / Poor / Burnt

Steering: Inorder / Jammed / Leaked / Burnt or

Brake: Inorder / Jammed / Leaked / Burnt or

Modi: Nil / S/Rim / STD A/Rim or

Tyre Size: F: 225/45R17

R: 225/45R16

BS / DUN / EXNOVA / GY / FS / LIZA / MIC / OHTSU / PIR / SUMI /

TOYO / YOKO or

Front _____ Rear _____

R/Bal. 06 mm R/Bal. 06 mm

L/Bal. 06 mm L/Bal. 06 mm

D.O.A. _____ D.O.I. 04/10/22

Survey held at HS

Des. of Damages: Frt / Rear / O/S / N/S / U/C / Rooftop or

The U/C / Chassis frame / Body Structure affected due to collision.

Date / Time	Action / Instruction
	<u>TP Churn</u>
<u>7/2/23</u>	<u>Adrian finalised LS \$26,800; 18 days with repairer. (Red. 25,359.67, 48%)</u>
	<u>MV: 80K</u>
	<u>PV: 36-3K</u>
	<u>Nett: 43.7K</u>

Date/Time, File Pass to?



: Prel. Report



: Final Report

1)

Date/Time, File Return to?

2)

Days Of Repair: 18

Resurvey No. of Trip: _____

Survey Fee:

Transportation:

Photos

Others

Add Fee:



: Site Insp (\$



: Interview (\$



: Tech. Insp (\$

Report Format:

Report Format: _____

> Back to OneMotoring

Enquire PARF/COE Rebate for Registered Vehicle

Vehicle Owner Particulars	
Owner ID Type:	Singapore NRIC
Owner ID:	196I
Vehicle Details	
Vehicle No.:	SML8374B
Vehicle to be Exported:	No
Intended Deregistration Date:	06 Oct 2022
Vehicle Make:	KIA
Vehicle Model:	CERATO 1.6(A) SUNROOF
Primary Colour:	Red
Manufacturing Year:	2018
Engine No.:	G4FGJH723254
Chassis No.:	KNAF5416MK5031561
Maximum Power Output:	93.8 kW (125 bhp)
Open Market Value:	\$18,844.00
Original Registration Date:	07 Jun 2019
First Registration Date:	07 Jun 2019
Transfer Count:	0
Actual ARF Paid:	\$18,844.00
Intended PARF Rebate Details	
PARF Eligibility:	Yes
PARF Eligibility Expiry Date:	06 Jun 2029
PARF Rebate Amount:	\$14,133.00
Intended COE Rebate Details	
COE Expiry Date:	06 Jun 2029
COE Category:	A - Car up to 1600cc & 97kW (130bhp)
COE Period(Years):	10
QP Paid:	\$33,199.00
COE Rebate Amount:	\$22,132.00
Total Rebate Amount:	\$36,265.00

The information contained herein is correct as at 06 Oct 2022

OK



Kia Cerato 1.6A LX | **\$80,888** | \$11,210 /yr | 11-Jun-2019 | 1,591 cc | 56,038 km | Sedan | **Available**

CARRO Certified Pre-Owned - All our vehicles undergo a strict 160-point inspection to ensure No Major Accident, and No Mileage Tampering. Every CARRO Certified Pre-Owned car comes with 12 months Engine and Gearbox warranty with a 5-day Money Back Guarantee...

Carro

★ Posted: 26-Sep-2022

PREMIUM AD



Kia Cerato 1.6A LX | **\$80,800** | \$11,170 /yr | 17-Jun-2019 | 1,591 cc | 62,178 km | Sedan | **Available**

1 Owner Unit. Vehicle Fully Maintained By Agent C&C Since Day 1 And Come With 5 Years Warranty Valid Till Jun 2019. Engine 10 Years Warranty Valid Till Jun 2029. Well Known For It's Stylish External, Reliability, Exceptional Fuel Efficiency, Excellent Driving Dynamics, Exc...

Mayfair Motoring Pte Ltd

★ Posted: 03-Oct-2022

PREMIUM AD



Kia Cerato 1.6A LX | **\$90,800** | \$12,610 /yr | 26-Jun-2019 | 1,591 cc | 80,000 km | Sedan | **Available**

United Motoring Pte Ltd

★ Posted: 27-Sep-2022

PREMIUM AD



Kia Cerato 1.6A SX Sunroof | **\$92,800** | \$12,380 /yr | 02-Jul-2019 | 1,591 cc | 46,890 km | Sedan | **Available**

Peace of mind with C&C certified pre-owned. Strict inspection process done to qualify as a cpo. Call for an exclusive viewing. Low interest rate. You will be the second proud owner to own this beauty.

Republic Auto

★ Posted: 06-Sep-2022



Sell your Car for the Best Price

Want to sell your car but don't know what it's worth? Sgcarmart Quotz guarantees you the highest price. If we are not the highest offer, we'll give you \$100.

Find out more!



Kia Cerato 1.6A EX | **\$83,800** | \$11,290 /yr | 19-Jul-2019 | 1,591 cc | 122,534 km | Sedan | **Available**

1 owner + full agent service. come with 5 years agent warranty coverage valid till 18 July 2024. Nothing to be repaired, considered like brand new! Gear transmission smooths like butter! View to believe, 100% accident free! 100% loan, trade in available! Confident buying...

1axis

★ Posted: 19-Sep-2022

PREMIUM AD



Kia Cerato 1.6A EX | **\$154,000** | \$21,540 /yr | 29-Jul-2019 | 1,591 cc | 63,459 km | Sedan | **Available**

1 owner only! Original blue paintwork kept till date! Fully maintained by C&C since first register in 2019! Still under C&C warranty till Jul 2024! 100% major accident free unit with perfect chassis! We have helped thousands of customers to get their ideal car at just \$1,000 d...

★ Posted: 13-Sep-2022

PREMIUM AD



Kia Cerato 1.6A SX Sunroof | **\$94,800** | \$12,530 /yr | 02-Aug-2019 | 1,591 cc | 48,912 km | Sedan | **Available**

1 Owner Unit! Serviced And Maintained By C&C Since Day 1! High Spec SX Model! Most Popular Kia Sedan In The Market And On The Road! Immaculate Condition! Must View To Believe! Trade In Welcome! Flexible Loan Schemes Available Here With Hassle Free Procedure...

Benefit Auto Enterprise Pte Ltd

★ Posted: 03-Oct-2022

PREMIUM AD



Kia Cerato 1.6A LX | **\$88,999** | \$12,070 /yr | 21-Aug-2019 | 1,591 cc | 36,162 km | Sedan | **Available**

One 60 year old uncle owner! Original low mileage with full servicing records, free 3 more servicing with Cycle & Carriage included. Stock condition! Well maintained like new, view to believe. No dealers or consignment please.

★ Posted: 11-Aug-2022

DIRECT OWNER



Kia Cerato 1.6A LX | **\$87,888** | \$11,840 /yr | 03-Sep-2019 | 1,591 cc | 62,100 km | Sedan | **Available**

Capable \$0 drive away, own her now, pearly white with sporty black making car extra outstanding, 5 years agent's warranty. Contact our sales manager for a non obligation discussion today.

Wunder Auto Pte Ltd

★ Posted: 02-Oct-2022

Available




Kia Cerato 1.6A GT Line Sunroof | **\$96,800** | \$12,560 /yr | 13-Sep-2019 | 1,591 cc | 53,950 km | Sedan | **Available**

1 owner with low mileage. KIA Cerato GT Line offers you tremendous value for money. High specs with many functional features. Beautiful paintwork with 1 owner. 5 years unlimited mileage warranty from Agent. Smart entry smart trunk access. Call us for viewing now.

Sime Darby Auto Selection

★ Posted: 22-Sep-2022

Available



Kia Cerato 1.6A EX | **\$90,800** | \$11,930 /yr | 03-Oct-2019 | 1,591 cc | 26,533 km | Sedan | **Available**

Brand New Condition. 1 Owner, Fully Agent (C&C) Since Day One, With 10 Years Agent Warranty Coverage. View To Believe, 100% Accident Free! 100% Loan, Trade In Available! Confident Buying From A Sgcarmart Premium Dealer! Call For More Info!

1axis

Available

SHORTLISTED HISTORY

Compare

SINGAPORE ACCIDENT STATEMENT

IMPORTANT NOTICE

1. Please report correctly the details of the accident to speed up the claims process.
2. This Form must be completed by the Policyholder and/or the Actual Driver.
3. Information provided must be as truthful and accurate as possible. Any wilful misrepresentation or withholding of material facts may allow insurance companies to repudiate policy liability.
4. The issue and acceptance of this Form by insurance companies is not an admission of policy liability on the part of the insurance companies.
5. Any false reporting may be referred to the Police for investigation.
6. This report will be forwarded by the insurers of the GIA Records Management Centre established by the General Insurance Association of Singapore (GIA) for archiving and that copies of this report will, for a fee, be made available upon application by interested parties.
7. By the lodgement of this report to the insurers, you hereby consent to the archiving of this report at the centre and to copies of the report being made available aforesaid.

ACCIDENT STATEMENT

Date of Submission	30/09/2022 12:07 (SGT)
Reported by	Both
Date of Accident	29/09/2022 06:50 (SGT)
Exact Location of Accident	SLE, Singapore
Additional Location Information	SLE TOWARDS BKE
Country/State of Loss	Singapore

DETAILS OF OWN VEHICLE

Vehicle Registration Number	SML8374B
-----------------------------	----------

INSURED/POLICYHOLDER

Is company?	No
Name Of Registered Owner	EWE CHUN QIANG,ALVIN (YOU JUNQIANG)
NRIC No	S8725196I
Email Address	ALVINEWE.87@GMAIL.COM
Mobile Phone No	(Phone) +65-94889663
Alternative Phone No	-

VEHICLE PARTICULARS

Manufacturer	Kia
Model	Cerato
Variant	-
Exact purpose for which vehicle was being used at time of accident	Private use
Are you claiming under your own insurance policy for repair to your vehicle?	No - Claiming third party
Vehicle Category	Private car
Transmission	Auto
CC	1591

INSURANCE COMPANY

Name of Insurance Company	AIG Asia Pacific Insurance Pte. Ltd.
Policy Number / Cover Note Number	1900105977-02

DRIVER

Name of Driver	EWE CHUN QIANG,ALVIN (YOU JUNQIANG)
NRIC No	S8725196I
Date Of Birth	16/08/1987
Occupation	Indoor

Date Of Driving Pass	08/08/2007
Driving experience	15 YEARS AND 1 MONTH
Gender	Male
Mobile Number	(Phone) +65-94889663
Alt. Phone Number	-
Email Address	ALVINEWE.87@GMAIL.COM
Address	BLK 175 LOMPANG ROAD #06-45
Address complement	-
Postcode	670175
Is the driver the policyholder?	Yes
If No, Relationship of the Driver with the Insured	-
Does Driver Own Other Vehicles?	No
Vehicle Registration Number of Other Vehicle Owned by Driver	-
Insurance Company of Other Vehicle Owned by Driver	-

GENERAL INFORMATION OF THE ACCIDENT

Type of Accident	Collision - Change/cross lane
Weather Conditions	Raining
Road Surface	Wet

OTHER INFORMATION

Was any foreign vehicle involved in the accident?	No
Number of vehicles involved in the accident	3
Was anybody injured in the Accident?	Yes
Was any injured conveyed to hospital by ambulance?	Yes
Was any other vehicle or property damaged?	Yes
Number of Passengers (Including Driver)	1
Has the driver been approached by unknown person(s) soliciting/offering accident claims assistance?	No
Translator's name	-
Translator's ID	-
Translator's phone number	-
Translator's email	-
Original language used in the statement	-

DETAILS OF POLICE ACTION

Was the accident reported to the police?	Yes
Police Station Name	Traffic Police
Police Station Phone No	(Phone) +65-65470000
Alt. Police Station Phone No	(Fax) +65-65474900
Police Station Address	10 Ubi Avenue 3 Singapore 408865
Was notice of intended Prosecution given?	No
If yes, against whom?	-

CIRCUMSTANCES OF ACCIDENT

REFER TO ATTACHMENT

ATTACHMENT(S)

Are accident photos available for attachment?	No
Was there any video captured by Car Camera?	Yes
Reasons for not uploading a video of the accident	VEHICLE AND SD CARD WITH TRAFFIC POLICE

DETAILS OF OTHER VEHICLE PROPERTY 1

Vehicle Registration Number	GZ5157D
Vehicle Manufacturer	-
Vehicle Model	-

Vehicle Variant	-
Vehicle Colour	-
Vehicle Category	Commercial vehicle
Name of Driver	-
Contact Number	-
Address	-
Address complement	-
Postcode	-
Insurance Company Name	China Taiping Insurance (Singapore) Pte. Ltd.
Nature Of Damage	-
Details of property damaged in accident	-
No. Of Passenger (Including Driver)	-

DETAILS OF OTHER VEHICLE PROPERTY 2

Vehicle Registration Number	SLV7330T
Vehicle Manufacturer	-
Vehicle Model	-
Vehicle Variant	-
Vehicle Colour	-
Vehicle Category	Private car
Name of Driver	-
Contact Number	-
Address	-
Address complement	-
Postcode	-
Insurance Company Name	-
Nature Of Damage	-
Details of property damaged in accident	-
No. Of Passenger (Including Driver)	-

INJURED PERSONS DETAILS

INJURED 1

Name of injured person	EWE CHUN QIANG,ALVIN (YOU JUNQIANG)
Gender	Male
Phone No	(Phone) +65-94889663
Address	-
Address Complement	-
Post Code	-
Approximate Age Years Old	-
Injuries Sustained	LEG & NECK INJURY.HEARING LOSS
Injured person in which vehicle?	SML8374B
Were seat belts worn?	Yes
Was this injured conveyed to hospital by ambulance?	Yes

SKETCH PLAN

IMPORTANT NOTICE


1. Please report correctly the details of the accident to speed up the claims process.
2. This Form must be completed by the Policyholder and/or the Authorised Driver.
3. Information provided must be as truthful and accurate as possible. Any willful misrepresentation or withholding of material facts may allow insurance companies to repudiate policy liability.
4. The issue and acceptance of this Form by insurance companies is not an admission of policy liability on the part of the insurance companies.
5. Any false reporting may be referred to the Police for investigation.
6. The report will be forwarded by the insurers of the GIA Records Management Centre established by the General Insurance Association of Singapore (GIA) for archiving and that copies of this report will for a fee be made available upon application by interested parties.
7. By the lodgement of this report to the insurers, you hereby consent to the archiving of this report at the centre and to copies of the report being made available aforesaid.
8. **Consent under the Personal Data Protection Act (PDPA)**
I understand, acknowledge, agree and consent that:
(a) My insurer, my workshop and the General Insurance Association of Singapore ("GIA") may/are permitted to collect, use, disclose and/or process my personal data/personal information set out in this form and any other personal information provided by me or possessed by my insurer (collectively the "Personal Information") and disclose and transfer such Personal Information to all insurer(s) who have insured vehicle(s) involved in this accident (all insurer(s) who have insured vehicle(s) involved in this accident shall be collectively referred to as the "Insurers"), the Insurers' lawyers/law firms, the Monetary Authority of Singapore and any relevant government agency/authority (such as the police), for the purpose(s) of:
(i) processing, handling and/or dealing with my claims including the settlement of the claims and any necessary investigations relating to the claims;
(ii) investigating the accident and/or my claims;
(iii) carrying out and/or dealing with my instructions or responding to any enquiries by me;
(iv) administering my claims (including the mailing of correspondence, statements, invoices, reports or notices to me, which could involve disclosure of certain personal data about me to bring about delivery of the same as well as on the external cover of envelopes/mail packages); and/or
(v) complying with applicable law in administering, processing, handling and/or dealing with my claims.
(collectively the "Purposes")
(b) all insurer(s) who have insured vehicle(s) involved in this accident and the Insurers' lawyers/law firms, may/are permitted to collect, use, disclose and/or process my Personal Information for one or more of the above Purposes; and
(c) my Personal Information may/can be disclosed by any of the Insurers and/or GIA to their third party service providers or agents (including their lawyers/law firms), which may be sited outside of Singapore, for one or more of the above Purposes.

Policyholder's Signature / Date & Time

Driver's Signature (if driver is not the policyholder) / Date & Time

Witnessed by Reporting Centre Personnel

Sketch Plan

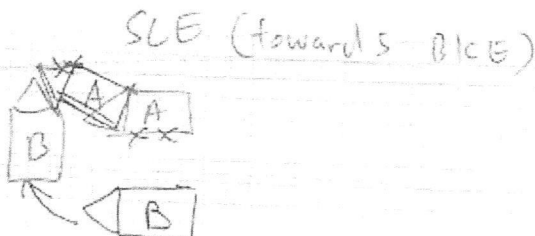


Describe Circumstances of the Accident


vehicle driving along SLB. Lorry swerved right to lane 1.
 straight on impact collision and lorry rear hit vehicle left
 side vehicle then collide with divider.

Declaration

We declare the foregoing particulars are true in every respect.

 29/9/22
 Policyholder's Signature / Date &
 Time

Driver's Signature (if driver is not the policyholder) / Date
 & Time


 Witnessed by Reporting Centre
 Personnel



HS AUTOMOTIVES PTE LTD

Blk 2 KAKI BUKIT AVE 2 @ KAKI BUKIT AUTOHUB #02-25 SINGAPORE 417921.

TEL: 6538 1368 FAX: 6538 1367 EMAIL: HSAUTOMOTIVESPL@GMAIL.COM

ROC: 201907812C

TPChin

Celine

INDEPENDENT SURVEYOR

DIRECT SETTLEMENT

WORK SHOP REPAIRER ESTIMATE

Date: 4.10.22

Vehicle No :

8ML8374B

Make/Model :

KIA CERATO GT/KINE

CHASSIS NO :

KNAF5416MK5031561

Estimate cost of repair to the above mentioned

MARKING

UNIT \$

AMOUNT (\$\$)

NO. QTY List Items

1	1	LH FRONT DOOR Distorted	✓	\$	-	✓	\$ 1278.30
2	1	LH FRONT DOOR HANDLE Dmg	✓	\$	-	✓	\$ 148.00
3	1	LH FRONT DOOR LOCK Dmg	✓	\$	-	✓	\$ 360.80
4	1	LH FRONT DOOR INNER TRIM cracked	?	\$	-	✓	\$ 630.40
5	1	LH FRONT DOOR INNER TRIM CLIP M	✓	\$	-	✓	\$ 45.00
6	1	LH FRONT DOOR TOP MOULDING M	✓	\$	-	✓	\$ 64.13
7	1	LH FRONT DOOR STICKER M	✓	\$	-	✓	\$ 58.00
8	1	RH REAR DOOR Distorted	✓	\$	-	✓	\$ 1378.00
9	2	LH REAR DOOR HINGES TOP/BOTTOM	✓	\$	-	✓	\$ 58.00
10	1	LH REAR DOOR TOP MOULDING M	✓	\$	-	✓	\$ 69.30
11	1	LH REAR DOOR STICKER M	✓	\$	-	✓	\$ 53.00
12	1	LH FRONT FENDER Distorted	✓	\$	-	✓	\$ 387.30
13	1	LH FRONT FENDER INNER SHIELD TORN	✓	\$	-	✓	\$ 25.40
14	1	LH FRONT FENDER INNER SHIELD CLIP	✓	\$	-	✓	\$ 45.00
15	1	FRONT BONNET Distorted	✓	\$	-	✓	\$ 1610.00
16	1	FRONT BONNET HAT SHIELD cracked	✓	\$	-	✓	\$ 140.50
17	2	FRONT BONNET HINGES RIP Bent	✓	\$ 38.00	-	✓	\$ 76.00
18	1	FRONT BONNET HAT SHIELD CLIP M	✓	\$	-	✓	\$ 47.00
19	1	FRONT BONNET LOCK Dmg	✓	\$	-	✓	\$ 92.28
20	1	FRONT BONNET LOCK CABLE Dmg	✓	\$	-	✓	\$ 49.30

REMARKS:

NO OF DAYS:	
AGREED FIGURE/LUMP SUM:	\$ -
SURVEYOR NAME	CONTACT:
EMAIL ADD:	



HS AUTOMOTIVES PTE LTD

Blk 2 KAKI BUKIT AVE 2 @ KAKI BUKIT AUTOHUB #02-25 SINGAPORE 417921.

TEL: 6538 1368 FAX: 6538 1367 EMAIL: HSAUTOMOTIVESPL@GMAIL.COM

ROC: 201907812C

INDEPENDENT SURVEYOR

DIRECT SETTLEMENT

WORK SHOP REPAIRER ESTIMATE

Date: 4-10-22

Vehicle No :

2ML83743

Make/Model :

KIA CERATO GT/LINE

CHASSIS NO :

Estimate cost of repair to the above mentioned

MARKING

UNIT \$

AMOUNT (\$\$)

NO. QTY List Items

1	1	FRONT SUPPORT DANIEL Distal	✓	\$	-	✓	\$ 609.00
2	1	FRONT SUPPORT DANIEL TOP GARNISH Cured	✓	\$	-	✓	\$ 34.00
3	1	FRONT SUPPORT DANIEL TOP GARNISH CLIP	✓	\$	-	✓	\$ 45.00
4	1	FRONT BUMPER Distal	✓	\$	-	✓	\$ 634.00
5	2	FRONT BUMPER RETAINER AIR Duct	✓	\$	19.00	✓	\$ 39.62
6	1	FRONT BUMPER CLIP	✓	\$	-	✓	\$ 45.00
7	1	FRONT BUMPER TOP BRACKET Cured	✓	\$	-	✓	\$ 273.50
8	1	FRONT BUMPER (LOWER) Distal	✓	\$	-	✓	\$ 485.00
9	1	FRONT BUMPER LOWER SKIRT Distal	✓	\$	-	✓	\$ 315.00
10	1	FRONT BUMPER RADIATOR GRILLE Missing	✓	\$	-	✓	\$ 295.40
11	1	FRONT BUMPER LOWER GRILLE Cured	✓	\$	-	✓	\$ 487.50
12	1	FRONT BUMPER KOTO New	✓	\$	-	✓	\$ 32.50
13	1	FRONT BUMPER YOW COVER New	✓	\$	-	✓	\$ 9.00
14	1	FRONT BUMPER REINFORCEMENT Distal	✓	\$	-	✓	\$ 448.2
15	1	FRONT BUMPER SPONGE Cured	✓	\$	-	✓	\$ 75.00
16	2	FRONT BUMPER DAY LIGHT AIR KIT Cured	✓	\$	2,29.00	✓	\$ 258.00
17	2	FRONT BUMPER DAY LIGHT GARNISH AIR Cured	✓	\$	2,95.00	✓	\$ 390.00
18	1	FRONT BUMPER DAY LIGHT WIRE HARNESS	✓	\$	-	✓	\$ 379.50
19	1	FRONT BUMPER UNDER COVER (DUST COVER)	✓	\$	-	✓	\$ 175.40
20				\$	-		\$ -

REMARKS:

NO OF DAYS:

AGREED FIGURE/LUMP SUM:

\$ -

SURVEYOR NAME

CONTACT:

EMAIL ADD:



HS AUTOMOTIVES PTE LTD

Blk 2 KAKI BUKIT AVE 2 @ KAKI BUKIT AUTOHUB #02-25 SINGAPORE 417921.
TEL: 6538 1368 FAX: 6538 1367 EMAIL: HSAUTOMOTIVESPL@GMAIL.COM
ROC: 201907812C

INDEPENDENT SURVEYOR
DIRECT SETTLEMENT

WORK SHOP REPAIRER ESTIMATE

Vehicle No : 8ML83TAB
Make/Model : KIA GRAYO GT/LINE
CHASSIS NO : _____

Date: _____

Estimate cost of repair to the above mentioned

MARKING

UNIT \$

AMOUNT (\$\$)

NO. QTY List Items

1	1	FRONT RADIATOR	Disbled	✓	\$	-	\$ 582.00
2	1	FRONT RADIATOR FAN ASSEMBLY	could	✓	\$	-	\$ 591.12
3	1	FRONT AIR COND CONDENSATOR	Disbled	✓	\$	-	\$ 619.45
4	1	FRONT AIR INTAKE BOX (BOUNDR)	Disbled	✓	\$	-	\$ 156.20
5	1	FRONT AIR INTAKE HOSE	28200-613000 Disbled	✓	\$	-	\$ 183.60
6	1	FRONT AIR INTAKE AIR FILTER HOUSING	could	✓	\$	-	\$ 181.50
7	2	FRONT CHASSIS WHITE HOUSING	Disbled	✓	\$	-	\$ 485.01
8	1	FUSE BOX	could	✓	\$	-	\$ 191.00
9	1	FUSE BOX WIRE HARNESS	new	+	\$	-	\$ -
10	1	FRONT WINDSCREEN	could	✓	\$	-	\$ 821.13
11	1	FRONT WINDSCREEN MOLDING	2pc	✓	\$	-	\$ 118.50
12	1	FRONT WINDSCREEN SEALANT		✓	\$	-	\$ -
13	1	FRONT WINDSCREEN WIPER GARNISH	could	✓	\$	-	\$ 222.05
14	1	FRONT DRIVER SEAT BELT	3 Adjusted	✓	\$	-	\$ 717.00
15	1	FRONT PASSENGER SEAT BELT		✓	\$	-	\$ 693.00
16	1	FRONT DASH BOARD	toin	✓	\$	-	\$ 1279.44
17	1	FRONT PASSENGER AIR BAG	3 Adjusted	✓	\$	-	\$ 1275.00
18	1	FRONT DRIVER SEATING AIR BAG		✓	\$	-	\$ 922.30
19	1	AIR BAG CONTROL UNIT	Adjusted	✓	\$	-	\$ 1025.57
20	2	AIR BAG SENSOR	4P Adjusted	✓	\$	48.34	\$ 96.68

REMARKS:

NO OF DAYS:	
AGREED FIGURE/LUMP SUM:	\$ -
SURVEYOR NAME	CONTACT:
EMAIL ADD:	



HS AUTOMOTIVES PTE LTD

Blk 2 KAKI BUKIT AVE 2 @ KAKI BUKIT AUTOHUB #02-25 SINGAPORE 417921.

TEL: 6538 1368 FAX: 6538 1367 EMAIL: HSAUTOMOTIVESPL@GMAIL.COM

ROC: 201907812C

INDEPENDENT SURVEYOR

DIRECT SETTLEMENT

WORK SHOP REPAIRER ESTIMATE

Date: 4-10-22

Vehicle No :

QUL 837AB

Make/Model :

KIA CERATO GT/KINE

CHASSIS NO :

Estimate cost of repair to the above mentioned

MARKING

UNIT \$

AMOUNT (\$\$)

NO. QTY List Items

1	1	LH FRONT LOWER ARM Bent	7	\$	-	✓ \$ 258.00
2	1	LH FRONT WHEEL KNUCKLE d	7	\$	-	✓ \$ 316.00
3	1	LH FRONT WHEEL BEARING d	7	\$	-	✓ \$ 393.10
4	1	LH FRONT SHOCK ABSORBER Bent	7	\$	-	\$ 852.00
5	1	LH FRONT DRIVE SHAFT NEW	+	\$	-	X \$ 813.00
6	1	LH FRONT RORY RIM ct	✓	\$	-	✓ \$ 986.20
7	1	FRONT STEERING RACK AND PINION n	+	\$	-	X \$ 770.25
8				\$	-	\$ -
9				\$	-	\$ 2370
10	2	FRONT HEAD LAMP L/R LH only, RH n	2	\$	5370.00	\$ 5740.00
11	2	FRONT HEAD LAMP LOWER BRACKET L/R LH only	2	\$	-	\$ -
12		25638.19		\$	S.N. 251	\$ -
13		SUPPLEMENTARY ITEM (1)		\$	-	\$ -
14	1	ENGINE WIRE HARNESS Damaged.	✓	\$	-	✓ \$ 1945.00
15				\$	-	\$ -
16		Supplementary (1)		\$	-	\$ -
17				\$	-	\$ -
18		1945		\$	-	\$ -
19		1750.50		\$	-	\$ -
20				\$	-	\$ -

REMARKS:

NO OF DAYS:

AGREED FIGURE/LUMP SUM:

\$ -

SURVEYOR NAME

CONTACT:

EMAIL ADD:



HS AUTOMOTIVES PTE LTD

Blk 2 KAKI BUKIT AVE 2 @ KAKI BUKIT AUTOHUB #02-25 SINGAPORE 417921.

TEL: 6538 1368 FAX: 6538 1367 EMAIL: HSAUTOMOTIVESPL@GMAIL.COM

ROC: 201907812C

INDEPENDENT SURVEYOR

DIRECT SETTLEMENT

WORK SHOP REPAIRER ESTIMATE

Date:

Vehicle No :

8UL837AB

Make/Model :

KIA CERATO GT/LINE

CHASSIS NO :

Estimate cost of repair to the above mentioned

MARKING

UNIT \$

AMOUNT (\$\$)

NO. QTY List Items

2200 2000

1	1	PANEL BEAT	\$	-	\$ 5000
2	2	SPRAY PAINT	\$	1400	\$ 2800
3	3	REMOVE / REFIX UNDERCARRIAGE	\$	220	\$ 440
4	4	REMOVE / REFIX FRONT WINDSCREEN	\$	120	\$ 240
5	5	REMOVE / REFIX DASH BOARD	\$	220	\$ 440
6	6	REMOVE / REFIX AIR BAG / SHAT BELT AND	\$	300	\$ 600
7		CONTROL UNIT	\$	-	\$ -
8	7	REMOVE / REFIX RADIATOR / A/C CONDENSER	\$	120	\$ 240
9	8	WHEEL ALIGNMENT	\$	80	\$ 160
10	9	REPROGRAMME AFR B76 SYSTEM (BRS)	\$	300	\$ 600
11	10	AIR COND MAS.	\$	40	\$ 80
12	11	RADIATOR COOLANT	\$	40	\$ 80
13	12	RUST PROOF	\$	120	\$ 240
14	13	TO REMOVE AND REFIX ENGINE	\$	450	\$ 900
15	14	AUTO TRANSMISSION FLUID	\$	120	\$ 240
16	15	TO RE-WIRING SYSTEM FOR FRONT PORTION	\$	120	\$ 240
17	16	TO STRAIGHTEN UP FRONT CHASSIS.	\$	350	\$ 700
18			\$	-	\$ -
19			\$	-	\$ -
20			\$	-	\$ -

Admin
1/5 04/10/22

REMARKS:

NO OF DAYS:

AGREED FIGURE / LUMP SUM:

SURVEYOR NAME

EMAIL ADD:

LKK Auto Consultants hence notify the Repairer of the following:

• To resurvey before/after spray painting

• To display damaged part(s) during resurvey

• Parts prices are subject to confirmation

• Third party survey is on a "Without Prejudice" basis

• No illegal modification(s) is allowed

• Supplementary item(s) must be resurveyed and

is subject to final approval from Insurance Company

Acknowledged by Repairer

Signature:

Date:

CONTACT:

18 Days

Supplementary 1 : 1750.00

Supplementary 2 : 2050.04

Total: 33508.91

4/5: 26.8K

26.8K



HS AUTOMOTIVES PTE LTD

Blk 2 KAKI BUKIT AVE 2 @ KAKI BUKIT AUTOHUB #02-25 SINGAPORE 417921.

TEL: 6538 1368 FAX: 6538 1367 EMAIL: HSAUTOMOTIVESPL@GMAIL.COM

ROC: 201907812C

Vehicle No: QML837AB

Make/Model: KIA CRAYO

CHASSIS NO: _____

Date: _____

Estimate cost of repair to the above mentioned

SUPPLEMENTARY ITEMS. (2)

NO. QTY LIST ITEMS

MARKING

UNIT \$

AMOUNT (\$\$)

1	1	LH GEAR BOX MOUNTING		X	\$ 184.00
2	1	FRONT CYLINDER BLOCK KNOCK SENSOR		X	\$ 96.70
3	1	FRONT ENGINE CRANK SENSOR		X	\$ 98.00
4	1	FRONT ENGINE MAIN FLOW Deformed		✓	\$ 906.30
5	2	FRONT BUMPER SIDE AIR GUIDE BRACKET			\$ 27.40 \$ 54.80
6	1	FRONT SUPPORT PANEL LOWER BRACKET		X	\$ 137.50
7	1	WASHER PANK Deformed.		✓	\$ 130.25
8	1	FRONT PASSENGER DRAWER Cured.		✓	\$ 97.30
9	2	FRONT BUMPER FOOT LIGHT			\$ 273.20 \$ 546.40
10	1	FRONT BUMPER PARKING SENSOR 99310-46000			\$ 147.00 \$ 588.00
11	2	FRONT FOOT LIGHT SPARKING LH Dmd			\$ 97.30 \$ 194.60
12	2	FRONT SUPPORT PANEL AIR GUARD Deformed			\$ 30.60 \$ 61.20
13	1	BATTERY JAIL 66 Dmg			\$ 270.00
14	1	ENGINE AIR TEMP SENSOR Not Rel		X	\$ 96.50
15	1	BATTERY BASE TRAY 37150-46100			\$ 73.55
16	1	LH FRONT FENDER INSULATOR 84116-46000		X	\$ 25.00
17	1	FRONT STIFFENER. FRONT BUMPER 86571-46000		✓	\$ 102.10
18	2	FRONT BUMPER SIDE AIR DUCT 86571-46000			\$ 27.00 \$ 54.00
19	2	FRONT HORN Not Rel			\$ 66.00 \$ 132.00
20	1	FRONT ENGINE UNDERCOVER Deformed			\$ 105.15

REMARKS:

NO OF DAYS:	
AGREED FIGURE/LUMP SUM:	
SURVEYOR NAME	CONTACT:
EMAIL ADD:	

205560 S.N. LW

185004

Supplementary 2:205004