

008/1/13) Wef

ASS. REC. BY: WMC

REF:

CS/CTI 22010/60/Rgy3

065W

# ASSIGNMENT

From: \_\_\_\_\_ Date: \_\_\_\_\_

Estimated Cost: \_\_\_\_\_

OD/TP/WS/TP RES/OD RES/EVA/INV/MV

To/Inspect Vehicle No: SNC 5216E

at Workshop no/s PERFORMANCE

of 303, ALEXANDRA RD

Insured: CTI

Policy No. \_\_\_\_\_

Claims No. \_\_\_\_\_


Sum Insured: \_\_\_\_\_ Excess: \_\_\_\_\_

(Client's Record)

Make of Veh: \_\_\_\_\_

(Policy Condition)

Remark: The veh had commenced its repair at the time of inspection.

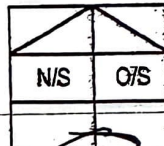

Bal. or Market Value: 190K

IDAC Accident Report: Consistent? : Yes or No

GIA / PR Seen: Consistent? : Yes or No

Est. Repairs: 5 days Res.: Yes or No

Lum Sum: \_\_\_\_\_ % 3 Val.: Yes or No

CA / REV / REP. / 24 HRS

Date: \_\_\_\_\_ Person Contacted: \_\_\_\_\_

Vehicle: IN/OUT

Date / Time Action / Instruction

REPAIR UNIT - 92K

Finalised final fig \$8903.60, 5 days. (Red \$3918.80, 31%)

Veh No: SNC 5216E Yr Regn: 2021 10CT

Type: ☒ M/Car ☐ M/Cycle ☐ Bus ☐ Van ☐ Lorry ☐ Tractor ☐ Prime Mover

Truck/Trailer or

Make: B.M.W X15DRIVE 182 HL cc 1499

Colour: BLACK A/C: ☒ Insured ☐ Std ☐ Nil ☐ NA

Sp/Reading 21168 T/Radio: ☒ Insured ☐ Std ☐ Nil ☐ NA

Eng No: \_\_\_\_\_

C/No: WBA32AA0X05427326

Gen. Cond: ☒ Good ☐ Fair ☐ Poor ☐ Burnt

Steering: ☒ In order ☐ Jammed ☐ Leaked ☐ Burnt or

Brake: ☒ In order ☐ Jammed ☐ Leaked ☐ Burnt or

Mod: ☒ Nil ☐ STD ☐ AIR or

Tyre Size: F: 225/SR18

R: \_\_\_\_\_

BS/DUN/EXNOVA/GY/FS/LIZA/MIC/OHTSU/PIR/SUMI

TOYO/YOKO or

Front

R/Bal. 6 mm

L/Bal. 6 mm

D.O.A. 05/10/22

Survey held at PERFORMANCE

Des. of Damages: ☒ Fnt ☐ Rear ☐ O/S ☐ N/S ☐ U/C ☐ Rooftop or

The U/C / Chassis frame / Body Structure affected due to collision.

Date/Time, File Pass to?

1) 17/01 Typist

Date/Time, File Return to?

2) \_\_\_\_\_

Report Format : MER-TP

Lump Sum / I.B.I: (\$ 8903.60)

Days Of Repair: 5

Resurvey No. of Trip: \_\_\_\_\_

Survey Fee:

Transportation:

Add Fee:

☐ Site Insp (\$

☐ Interview (\$

☐ Tech. Invs (\$

☐ Weekend (\$

S + RS SI

☐ Photos

☐ Others

303, Alexandra Road  
Sime Darby Performance Centre  
Singapore 159941  
Fax. 64747770

280, Kampong Arang Road  
East Coast Centre  
Singapore 438180  
Fax. 63449773

315, Alexandra Road  
Sime Darby Business Centre  
Singapore 159944  
Fax. 64796601 (AfterSales)  
64796624 (Motorrad)

GST REG. NO : M2 - 0020081 - X

# ESTIMATE

10 OCT 2022

Estimate No. : b1 63581  
Date Estimated : 07/10/2022  
Prepared By : Yap Mee Key

Page No. : 1 of 5

- ESTIMATE REPAIR FOR -  
Sime Darby Services Private Limited  
305 Alexandra Road  
#02-01 Vantage Automotive Centre  
Singapore 159942

- ACCOUNT - 135  
China Taiping Insurance (S) Pte Ltd  
3 Anson Road  
#16-00 Springleaf Tower  
Singapore 079909

REGN. NO.	CHASSIS NO.	REGN. DATE	MODEL	MILEAGE
SNC5216E	WBA32AA0X05U27326	27/10/2021	X1 sDrive18i	10686

DESCRIPTION	VALUE
To replace rear bootlid, rear bumper including attachments caused by accident	1700 2,550.00
To respray rear bootlid and rear bumper.	1972 2,076.00
To remove and replace rear windscreen glass to facilitate repair.	545 574.00
To carry out body cavity preservation rear bootlid	118.00
To check electrical wiring system and lighting at the rear section for proper function.	168 177.00
To remove old PDC assembly, replace damaged parts and reconnect to new bumper including conduct check for proper function.	168 177.00
To supply rear windscreen solar film.	504? 531.00
Sundries.	80 150.00
Total Labour 1:	6,353.00

DESCRIPTION	QTY	PRIC	VALUE
BOOTLID 51	1	1,298.95	1,298.95
REAR BUMPER TRIM PANEL (X LINE) de	1	226.95	226.95
REAR LH BUMPER MOUNT ?	1	166.90	166.90
REAR RH BUMPER MOUNT ?	1	166.90	166.90
MOUNTING SMART OPENER ?	1	47.00	47.00
REAR TRIM UNDERRIDE PROTECTION (X L) sea	1	151.10	151.10
RR BUMPER LH CORNER MOUNTING ?	1	147.50	147.50
RR BUMPER RH CORNER MOUNTING ?	1	147.50	147.50
REAR BUMPER PANEL PRIMED de	1	907.80	907.80
REAR BUMPER MIDDLE TRIM PANEL (PDC) de	1	266.90	266.90
REAR WINDOW (ESG) ? photo	1	815.55	815.55
SET ADHESIVE PADS FOR ACE 2.0 an	1	37.35	37.35



GST REG. NO : M2 - 0020081 - X

E S T I M A T E

Estimate No. : b1 63581  
Date Estimated : 07/10/2022  
Prepared By : Yap Mee Key

Page No. : 2 of 5

REGN. NO.	CHASSIS NO.	REGN. DATE	MODEL	MILEAGE
SNC5216E	WBA32AA0X05U27326	27/10/2021	X1 sDrive18i	10686

DESCRIPTION	QTY	PRIC	VALUE
(DG) CLEANER R1 (100ML) ✓	1	26.15	26.15
(DG/SL) WINDSCREEN SEALANT (2 X KLE ✓	2	175.35	350.70
(DG/SL) ADHESIVE PRIMER VP 206 (30ML) ✓	1	27.85	27.85
Total Parts :			4,785.10

Claims OD / 3rd Party / Uninsured losses / Direct Settlement

Regn No. \_\_\_\_\_ Claim No. \_\_\_\_\_

Date & Time 29/11/22 @ 1100 Excess S\$ \_\_\_\_\_

Surveyor's Name RASUL Sign \_\_\_\_\_

Surveyor's Tel 90010088 Authorised Yes / No \_\_\_\_\_

Authorised Date \_\_\_\_\_ Time \_\_\_\_\_

RESURVEY PARTS PHOTO BY SURVEYOR Yes / No PML Yes / No \_\_\_\_\_

Surveyor's E-mail \_\_\_\_\_

No. of Working Days Recommend 5 days

LKK Auto Consultants hence notify  
the Repairer of the following:

- To resurvey before/after spray painting
- To display damaged part(s) during resurvey
- Parts prices are subject to confirmation
- Third party survey is on a "Without Prejudice" basis
- No illegal modification(s) is allowed

• Supplementary item(s) must be resurveyed and  
is subject to final approval from Insurance Company

Acknowledged by Repairer

Signature:

Date:

Labour 1	:	6,353.00
Parts	:	4,785.10
Labour 2	:	0.00
Excess	:	0.00
Total GST @ 7%	:	779.67
Grand Total	:	11,917.77



\*\* THIS ESTIMATE IS VALID FOR A PERIOD OF 30 DAYS ONLY\*\*  
\*\* PRICE FOR PARTS ARE SUBJECTED TO CHANGE WITHOUT PRIOR NOTICE \*\*

# SINGAPORE ACCIDENT STATEMENT

## IMPORTANT NOTICE

1. Please report correctly the details of the accident to speed up the claims process.
2. This Form must be completed by the Policyholder and/or the Actual Driver
3. Information provided must be as truthful and accurate as possible. Any wilful misrepresentation or withholding of material facts may allow insurance companies to repudiate policy liability.
4. The issue and acceptance of this Form by insurance companies is not an admission of policy liability on the part of the insurance companies.
5. Any false reporting may be referred to the Police for investigation.
6. This report will be forwarded by the insurers of the GIA Records Management Centre established by the General Insurance Association of Singapore (GIA) for archiving and that copies of this report will, for a fee, be made available upon application by interested parties.
7. By the lodgement of this report to the insurers, you hereby consent to the archiving of this report at the centre and to copies of the report being made available aforesaid.

## ACCIDENT STATEMENT

Date of Submission	05/10/2022 18:39 (SGT)
Reported by	Driver
Date of Accident	05/10/2022 09:28 (SGT)
Exact Location of Accident	Singapore
Additional Location Information	KPE RIGHTTEST LANE BEFORE PIE EXIT
Country/State of Loss	Singapore

## DETAILS OF OWN VEHICLE

Vehicle Registration Number	SNC5216E
-----------------------------	----------

### INSURED/POLICYHOLDER

Is company?	Yes
Name Of Registered Owner	Sime Darby Services Pte Ltd
Company Reg No	1XXXXX065W
Email Address	lieu@cjp.com.sg
Mobile Phone No	(Phone) +65-96664542
Alternative Phone No	-

### VEHICLE PARTICULARS

Manufacturer	BMW
Model	X1
Variant	-
Exact purpose for which vehicle was being used at time of accident	Private use
Are you claiming under your own insurance policy for repair to your vehicle?	No - Claiming third party
Vehicle Category	Private car
Transmission	Auto
CC	1499

### INSURANCE COMPANY

Name of Insurance Company	MSIG Insurance (Singapore) Pte. Ltd.
Policy Number / Cover Note Number	-

### DRIVER

Name of Driver	LIEW ENG LENG
NRIC No	SXXXX965Z
Date Of Birth	03/10/1964
Occupation	Indoor



Date Of Driving Pass .....	29/03/2021
Driving experience .....	1 YEAR AND 7 MONTHS
Gender .....	Male
Mobile Number .....	(Phone) +65-96664542
Alt. Phone Number .....	-
Email Address .....	lieu@cjp.com.sg
Address .....	10A HOUGANG STREET 11 #15-36
Address complement .....	-
Postcode .....	534079
Is the driver the policyholder? .....	No
If No, Relationship of the Driver with the Insured .....	Hirer
Does Driver Own Other Vehicles? .....	No
Vehicle Registration Number of Other Vehicle Owned by Driver .....	-
Insurance Company of Other Vehicle Owned by Driver .....	-

#### GENERAL INFORMATION OF THE ACCIDENT

Type of Accident .....	Collision - Head to Rear
Weather Conditions .....	Clear
Road Surface .....	Dry

#### OTHER INFORMATION

Was any foreign vehicle involved in the accident? .....	No
Number of vehicles involved in the accident .....	2
Was anybody injured in the Accident? .....	No
Was any injured conveyed to hospital by ambulance? .....	-
Was any other vehicle or property damaged? .....	Yes
Number of Passengers (Including Driver) .....	3
Has the driver been approached by unknown person(s) soliciting/offering accident claims assistance? .....	No
Translator's name .....	-
Translator's ID .....	-
Translator's phone number .....	-
Translator's email .....	-
Original language used in the statement .....	-

#### PASSENGER 1

Name .....	LIEW XUE MIN
Gender .....	Female

#### PASSENGER 2

Name .....	LIEW XUE YI
Gender .....	Female

#### DETAILS OF POLICE ACTION

Was the accident reported to the police? .....	No
Was notice of intended Prosecution given? .....	No
If yes, against whom? .....	-

#### CIRCUMSTANCES OF ACCIDENT

#### REFER TO SKETCH PLAN

#### ATTACHMENT(S)


Are accident photos available for attachment? .....	Yes
Was there any video captured by Car Camera? .....	Yes

#### DETAILS OF OTHER VEHICLE PROPERTY 1

Vehicle Registration Number	SLJ1873X
Vehicle Manufacturer	Toyota
Vehicle Model	-
Vehicle Variant	-
Vehicle Colour	-
Vehicle Category	Private car
Name of Driver	LIM BOON PIN VICTOR
Contact Number	(Phone) +65-83233588
Address	-
Address complement	-
Postcode	-
Insurance Company Name	China Taiping Insurance (Singapore) Pte. Ltd.
Nature Of Damage	-
Details of property damaged in accident	-
No. Of Passenger (Including Driver)	-



# SKETCH PLAN

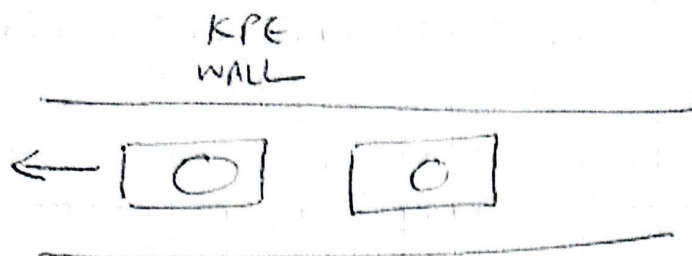

## DESCRIBE CIRCUMSTANCES OF THE ACCIDENT

I was driving along KPE-tunnel. Just ~~before~~ A car from rear  
lost control and hit my rear. I stopped to check  
damage and ~~then~~ gave the detail of the driver of  
the rear car. Accident happens on 05 OCT 2022  
Time 09:27 hrs in the morning. Traffic was  
smooth and normal speed.

## DECLARATION

I/We declare the foregoing particulars are true in every respect.

Policyholder's Signature  
Date & Time:

Driver's Signature  
(if driver is not the policyholder)  
Date & Time: 5 OCT 2022  
12 22 HRS

PERFORMANCE MOTORS LIMITED  
313 Alexandra Road  
Sire Darby Performance Centre  
Singapore 159941  
Tel: 6319 0100 (Sales)  
6319 0111 (AfterSales)

Reporting Centre Personnel's Signature  
Name:  
NRIC/FIN No.:

## Vehicle Owner Particulars

Owner ID Type: Company

Owner ID: 065W

## Vehicle Details

Vehicle No.: SNC5216E

Vehicle to be Exported: No

Intended Deregistration Date: 04 Dec 2022

Vehicle Make: B.M.W.

Vehicle Model: X1 SDRIVE 18i LED HL XLINE

Primary Colour: Brown

Manufacturing Year: 2021

Engine No.: 41196545B38A15F

Chassis No.: WBA32AA0X05U27326

Maximum Power Output: 100.0 kW (134 bhp)

Open Market Value: \$39,508.00

Original Registration Date: 27 Oct 2021

First Registration Date: 27 Oct 2021

Transfer Count: 0

Actual ARF Paid: \$47,312.00

## Intended PARF Rebate Details

PARF Eligibility: Yes

PARF Eligibility Expiry Date: 26 Oct 2031

PARF Rebate Amount: \$35,484.00

## Intended COE Rebate Details

COE Expiry Date: 26 Oct 2031

COE Category: B - Car above 1600cc or 97kW (130bhp)

COE Period(Years): 10

QP Paid: \$70,200.00

COE Rebate Amount: \$62,425.00

**Total Rebate Amount: \$97,909.00**



# BMW X1 sDrive18i xLine

## Overview

[Financial](#)[Accessories](#)[Similar](#)[Research](#)[Photos](#)[Map](#)**Price****\$183,800****Depreciation** ?

\$18,720 /yr

[View models with similar depre](#)**Reg Date**

23-Jun-2021

(8yrs 6mths 18days COE left)

**Mileage**

8,500 km (5.9k /yr)

**Manufactured** ?

2021

**Road Tax** ?

\$684 /yr

**Transmission**

Auto

**Dereg Value** ?

\$81,627 as of today (change)

**OMV** ?

\$39,508

**COE** ?

\$62,000

**ARF** ?

\$47,312

**Engine Cap**

1,499 cc

**Power**

100.0 kW (134 bhp)

**Curb Weight** ?

1,435 kg

**No. of Owners** ?

1

**Type of Vehicle**

SUV