

Steve


AIG

ASSIGNMENT

From: _____ Date: _____
 Estimated Cost: _____
 DD / TP / WS / TP RES / OD RES / EVA / INV / MV
 To Inspect Vehicle No: _____
 at Workshop n/s _____
 of _____
 Insured: _____
 Policy No. _____
 Claims No. _____
 Sum Insured: _____ Excess: _____
 (Client's Record)
 Make of Veh: _____

(Policy Condition)

Remark: The veh had commenced its repair at the time of inspection.

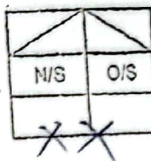

Bas. or Market Value: _____
 IDAC Accident Report: _____ Consistent? : Yes or No
 GIA / PR Seen: _____ Consistent? : Yes or No
 Est. Repairs: _____ days Res.: Yes or No
 Lum Sum: _____ % 3 Val.: Yes or No

QA / REV / REP. / 24 HRS

Date: _____ Person Contacted: _____

Vehicle: IN / OUT

Veh No: SHB 1278D Yr Regn: 26/12/19
 Type: M.Gar / M.Cycle / Bus / Van / Lorry / Truck / Prime Mover /
 Truck / Trailer or
 Make: Toyota Prius cc 1797
 Colour: Niagon A/C: Insured / Std / NI / NA
 Sp. Reading: 137668 T/Radio: Insured / Std / NI / NA
 Eng/No: _____
 C/No: JTD KB3P4003090697
 Gen. Cond: Good / Fair / Poor / Burnt
 Steering: Ins / reer / Jammed / Leaked / Burnt or
 Brake: Ins / der / Jammed / Leaked / Burnt or
 Modl: Nil / S/Rim / STD A/Rim or
 Tyre Size: F: 185/50R15
 R: 17
 BS / DUN / EXNOVA / GY / FS / LIZA / MIC / OHTSU / PIR / SUMI /
 TOYO / YOKO or -
 Front Rear
 R/Bal. 4 mm R/Bal. 0 mm
 L/Bal. 4 mm L/Bal. 4 mm
 D.O.A. 22/10/22 D.O.I. 25/10/22
 Survey held at SMRT
 Des. of Damages: Frt / Rear / O/S / N/S / UIC / Rooftop or
 The UIC / Chassis frame / Body Structure affected due to collision.

Date/Time / Action / Instruction

Date/Time, File Pass to?

☐ : Preli. Report
☐ : Final Report

Date/Time, File Return to?

2)

Report Format:

Lump Sum / L.B. (\$)

Days Of Repair:

Resurvey No. of Trip:

Add Fee: ☐ Site Insp (\$)
☐ Interview (\$)
☐ Tech. Insp (\$)
☐ Weekend (\$)

Survey Fee:

Transportation

\$ + RS. \$

Price

Others

TOTAL



Case Details

Case Reference Number : TAX/10/22/2070
 Type of Repair : Accident Repair
 Vehicle Registration Number : SHB1278D

Company Type : Strides Taxi Pte Ltd
 Estimation ID : EST-19671-JD
 Assigned By : Taxi Claims Manager Team

Insurance Company Name : AIG Asia Pacific Insurance Pte Ltd
 Accident Date and Time : 22/10/2022 05:20 AM
 Vehicle Age(In Months) :-

Documents / Photographs

View Documents / Photographs

Total Documents: 0

Estimation Details

Spare Part's Cost Detail

BOM Type	Costing Type	Portion	Material Number	SMRT Recommendation						Surveyor Approval				
				Part Name	Qty	List Price Per Unit(\$)	List Price(\$)	Dis(%)	Final Price(\$)	Repair/ Replace	Surveyor Quantity	Surveyor Final Price(\$)	Repair/Replace	Remarks
Standard	Main			REAR BUMPER REINFORCEMENT	1	360.10	360.10	25.00	270.08	Replace	1	270.08	Replace	/ BY
Standard	Main			COVER, RR BUMPER ASSY	1	525.40	525.40	25.00	394.05	Replace	1	394.05	Replace	/ BR
Standard	Main			PAD, RR BUMPER, RH & LH, 3	2	12.00	24.00	25.00	18.00	Replace	2	18.00	Replace	/ nec
Standard	Main			PAD, RR BUMPER, RH & LH, 2	2	4.30	8.60	25.00	6.45	Replace	2	6.45	Replace	/ noc
Standard	Main			PAD, RR BUMPER, RH & LH, 1	2	4.30	8.60	25.00	6.45	Replace	2	6.45	Replace	/ nec
Standard	Main			PAD, RR BUMPER, CTR	3	12.00	36.00	25.00	27.00	Replace	3	27.00	Replace	/ nec
Standard	Main			SEAL, RR BUMPER ARM, RH & LH	2	12.30	24.60	25.00	18.45	Replace	2	18.45	Replace	/ nec
Standard	Main			STOPPER, RR BUMPER, RH & LH	1	4.80	4.80	25.00	3.60	Replace	0	0	Check	?
Standard	Main			RETAINER, RR BUMPER, RH	1	143.60	143.60	25.00	107.70	Replace	1	107.70	Replace	/ BR
Standard	Main			SEAL, RR BUMPER, RH	1	128.00	128.00	25.00	96.00	Replace	1	96.00	Replace	/ BR CRU
Standard	Main			CLIPS PIECE, FRT & RR BUMPER	10	4.80	48.00	25.00	36.00	Replace	10	36.00	Replace	/ nec
Standard	Main			GUARD, RR BUMPER, LOWER	1	405.00	405.00	25.00	303.75	Replace	1	303.75	Replace	/ BR
Standard	Main			COVER, GUARD RR BUMPER LOWER	1	23.90	23.90	25.00	17.92	Replace	1	17.92	Replace	/ mis
Standard	Main			REAR BUMPER REFLECTOR ASSY, REFLEX, RH	1	42.20	42.20	25.00	31.65	Replace	1	31.65	Replace	/ CRU
									Total Spare Part Cost	13,302.94	Surveyor Total 4,204.40			
									Lump Sum Discount (%)	0	Lump Sum Dis (%) 0			
									Final Spare Part Cost	13,302.94	Final Sur Total 4,204.40			

SMRT Recommendation											Surveyor Approval			
BOM Type	Costing Type	Portion	Material Number	Part Name	Qty	List Price Per Unit(\$)	List Price(\$)	Dis(%)	Final Price(\$)	Repair/ Replace	Surveyor Quantity	Surveyor Final Price(\$)	Repair/Replace	Remarks
Standard	Main			REAR BUMPER GROMMET SCREW	1	2.20	2.20	25.00	1.65	Replace	1	1.65	Replace	✓ hee
Standard	Main			COVER, REAR FLOOR UNDER, RH	1	189.20	189.20	25.00	141.90	Replace	1	141.90	Replace	✓ / BR
Standard	Main			COVER, REAR FLOOR UNDER, LH	1	261.60	261.60	25.00	196.20	Replace	0	0	Not Give	✓ X nn
Standard	Main			COVER, REAR FLOOR UNDER CENTER	1	249.10	249.10	25.00	186.83	Replace	0	0	Check	✓ ?
Standard	Main			LENS & BODY, REAR COMBINATION LAMP, RH	1	367.30	367.30	10.00	330.57	Replace	0	0	Check	✓ ?
Standard	Main			LENS & BODY, REAR COMBINATION LAMP, LH	1	367.30	367.30	10.00	330.57	Replace	0	0	Not Give	✓ X nn
Standard	Main			COVER, REAR COMBINATION LAMP, RH	1	75.90	75.90	25.00	56.93	Replace	1	0.00	Replace	✓ X nn
Standard	Main			LENS & BODY, REAR COMBINATION LAMP, NO.2 RH	1	282.70	282.70	10.00	254.43	Replace	1	254.43	Replace	✓ / CUT
Standard	Main			LENS & BODY, REAR COMBINATION LAMP, NO.2 LH	1	282.70	282.70	10.00	254.43	Replace	0	0	Not Give	✓ X nn
Standard	Main			LAMP ASSY, REAR, RH	1	317.80	317.80	10.00	286.02	Replace	0	0	Check	✓ ?
Standard	Main			LAMP ASSY, REAR, LH	1	317.80	317.80	10.00	286.02	Replace	0	0	Not Give	✓ X nn
Standard	Main			SENSOR REVERSE	1	180.00	180.00	0.00	180.00	Replace	1	180.00	Replace	✓ / Shorted
Standard	Main			ANTENNA, ELECTRICAL KEY	1	78.00	78.00	10.00	70.20	Replace	0	0	Check	✓ ?
Standard	Main			PANEL SUB-ASSY, FENDER REAR RH	1	943.10	943.10	25.00	707.33	Replace	1	0	Repair	✓ X R
Standard	Main			PATCH, SIDE PANEL REAR END, RH & LH	1	37.70	37.70	25.00	28.28	Replace	0	0	Not Give	✓ X nn
Standard	Main			LINER, REAR FENDER, RH	1	151.10	151.10	25.00	113.32	Replace	0	0	Check	✓ ?
Standard	Main			END PANEL SUB-ASSY, BODY LOWER BACK	1	707.10	707.10	25.00	530.33	Replace	0	0	Check	✓ ?
Standard	Main			SPARE TYRE PANEL, PAN, REAR FLOOR	1	630.30	630.30	25.00	472.72	Replace	0	0	Check	✓ ?
Standard	Main			EXTENSION, REAR FLOOR SIDE PANEL, RH	1	84.40	84.40	25.00	63.30	Replace	0	0	Check	✓ ?
Standard	Main			BOX, DECK FLOOR, RH	1	338.90	338.90	25.00	254.17	Replace	0	0	Check	✓ ?

Total Spare Part Cost 13,302.94

Surveyor Total 4,204.40

Lump Sum Discount (%) 0

Lump Sum Dis (%) 0

Final Spare Part Cost 13,302.94

Final Sur Total 4,204.40

Item Type	Costing Type	Portion	Material Number	SMRT Recommendation				Surveyor Approval						
				Part Name	Qty	List Price Per Unit(\$)	List Price(\$)	Dis(%)	Final Price(\$)	Repair/Replace	Surveyor Quantity	Surveyor Final Price(\$)	Repair/Replace	Remarks
Standard	Main			PANEL ASSY, DECK TRIM SIDE, RH	1	385.10	385.10	25.00	288.83	Replace	1	288.83	Replace	✓ CRU
Standard	Main			BOX, DECK FLOOR, REAR	1	114.30	114.30	25.00	85.73	Replace	0	0	Check	?
Standard	Main			END PANEL, COVER, DECK TRIM, REAR	1	136.80	136.80	25.00	102.60	Replace	1	102.60	Replace	✓ CRU
Standard	Main			SEALANT SIKAFLEX	1	37.00	37.00	0.00	37.00	Replace	0	0	Check	?
Standard	Main			TAIL GATE PANEL SUB-ASSY, BACK DOOR	1	1,238.40	1,238.40	25.00	928.80	Replace	1	928.80	Replace	✓ DD
Standard	Main			TAIL GATE CUSHION, BACK DOOR LOWER STOPPER	1	26.50	26.50	25.00	19.88	Replace	0	0	Check	?
Standard	Main			TAIL GATE STOPPER, BACK DOOR, RH & LH	1	34.70	34.70	25.00	26.03	Replace	0	0	Check	?
Standard	Main			TAIL GATE STOPPER, BACK DOOR, RH & LH	1	34.70	34.70	25.00	26.03	Replace	0	0	Not Give	✗ nn
Standard	Main			TAIL GATE WEATHERSTRIP, BACK DOOR	1	402.50	402.50	25.00	301.88	Replace	0	0	Check	?
Standard	Main			TAIL GATE DAM, BACK DOOR GLASS UPPER ADHESIVE	1	31.30	31.30	25.00	23.48	Replace	1	23.48	Replace	✓ nec
Standard	Main			TAIL GATE GLASS SUB-ASSY, BACK DOOR	1	1,795.00	1,795.00	25.00	1,346.25	Replace	0	0	Not Give	✗ nn
Standard	Main			TAIL GATE MOULDING GLASS, BACK DOOR	1	38.50	38.50	25.00	28.88	Replace	1	28.88	Replace	✓ nec
Standard	Main			TAIL GATE LOWER GLASS SUB-ASSY, BACK DOOR	1	821.20	821.20	25.00	615.90	Replace	0	0	Not Give	✗ nn
Standard	Main			TAIL GATE BACK DOOR OUTSIDE GARNISH SUB-ASSY	1	992.30	992.30	25.00	744.22	Replace	1	744.22	Replace	✓ nec
Standard	Main			TAILGATE TRIM, UPPER	1	56.40	56.40	25.00	42.30	Replace	0	0	Not Give	✗ nn
Standard	Main			TAILGATE TRIM, RH	1	103.70	103.70	25.00	77.78	Replace	0	0	Not Give	✗ nr
Standard	Main			TAILGATE TRIM, LH	1	103.70	103.70	25.00	77.78	Replace	0	0	Not Give	✗ nn
Standard	Main			TAILGATE TRIM, LOWER	1	244.10	244.10	25.00	183.08	Replace	0	0	Check	?
Standard	Main			TAILGATE BOARD ASSY	1	280.20	280.20	25.00	210.15	Replace	0	0	Check	?
Standard	Main			TAIL GATE BACK DOOR HINGE ASSY, RH & LH	2	66.20	132.40	25.00	99.30	Replace	0	0	Check	?

Total Spare Part Cost 13,302.94

Lump Sum Discount (%) 0

Final Spare Part Cost 13,302.94

Surveyor Total 4,204.40

Lump Sum Dis (%) 0

Final Sur Total 4,204.40

SMRT Recommendation											Surveyor Approval			
BOM Type	Costing Type	Portion	Material Number	Part Name	Qty	List Price Per Unit(\$)	List Price(\$)	Dis(%)	Final Price(\$)	Repair/ Replace	Surveyor Quantity	Surveyor Final Price(\$)	Repair/Replace	Remarks
Standard	Main			TAIL GATE LOCK ASSY, BACK DOOR	1	505.50	505.50	10.00	454.95	Replace	0	0	Check	?
Standard	Main			TAIL GATE LOCK COVER, BACK DOOR	1	32.70	32.70	25.00	24.53	Replace	0	0	Check	?
Standard	Main			TAIL GATE STRIKER ASSY, BACK DOOR	1	28.00	28.00	25.00	21.00	Replace	0	0	Not Give	X ng
Standard	Main			EMBLEM SUB-ASSY REAR	1	77.40	77.40	25.00	58.05	Replace	1	58.05	Replace	/ nec
Standard	Main			NAME PLATE (HYBRID), LUGGAGE COMPARTMENT DOOR	1	59.10	59.10	25.00	44.33	Replace	1	44.33	Replace	/ nec
Standard	Main			NAME PLATE (PRIUS), LUGGAGE COMPARTMENT DOOR	1	59.10	59.10	25.00	44.33	Replace	1	44.33	Replace	/ nec
Standard	Main			SPOILER SUB-ASSY, REAR	1	1,704.20	1,704.20	25.00	1,278.15	Replace	0	0	Not Give	X ng
Standard	Main			STRIDES LOGO	1	7.80	7.80	0.00	7.80	Replace	1	7.80	Replace	/ nec
Standard	Main			STICKER DECAL 65558888	1	21.60	21.60	0.00	21.60	Replace	1	21.60	Replace	/ nec
Total Spare Part Cost									13,302.94	Surveyor Total 4,204.40				
Lump Sum Discount (%)									0	Lump Sum Dis (%) 0				
Final Spare Part Cost									13,302.94	Final Sur Total 4,204.40				

Labour's Cost Detail

S.No.	Costing Type	Job Scope	SMRT Recommendation(\$)	Surveyor Adjustment(\$)	Remarks
1	Main	TO REPAIR REAR PORTION	1,690.00	400.00	
Total:			1,690.00	400.00	

Spray Cost Detail

S.No.	Costing Type	Job Scope	SMRT Recommendation(\$)	Surveyor Adjustment(\$)	Remarks
1	Main	TO RESPRAY REAR BUMPER	378.00	200.00	
2	Main	TO RESPRAY REAR PANEL	180.00	0	
3	Main	TO RESPRAY BUMPER BEAM	180.00	0	
4	Main	TO RESPRAY FLOOR CORNER PANEL RH	180.00	0	
5	Main	TO RESPRAY REAR SPARE TYRE PANEL	180.00	0	
Total:			2,214.00	750.00	

Costing Type	Job Scope	SMRT Recommendation(\$)	Surveyor Adjustment(\$)	Remarks
6 Main	TO RESPRAY REAR FENDER RH	378.00	200	
7 Main	TO RESPRAY REAR SPOILER	180.00	0	
8 Main	TO RESPRAY TAILGATE OUTSIDE GARNISH	180.00	150	
9 Main	TO RESPRAY TAIL GATE	378.00	200	
Total:		2,214.00	750.00	

Other Cost Detail

S.No.	Costing Type	Job Scope	SMRT Recommendation(\$)	Surveyor Adjustment(\$)	Remarks
1	Main	TO WASH AND VACUUM	80.00	0	X nn
2	Main	TO CHECK WIRING AND SYSTEM FUNCTION	120.00	30	/ hpc
3	Main	TO APPLY RUST-PROOFING ON AFFECTED AREA	100.00	20	/ hpc
4	Main	TO TRANSFER REAR TAILGATE MECHANISM	120.00	30	/ hpc
5	Main	TO TEST AND REFIX REVERSE SENSOR SYSTEM	120.00	20	/ hpc
6	Main	TO REMOVE AND REFIX REAR WINDSCREEN	240.00	200	/ hpc
7	Main	TO REPLACE SUNDRY PARTS	100.00	20	/ hpc
Total:			860.00	320.00	

Summary

	Estimator Assessment(\$)	Surveyor Assessment(\$)
Total Spare Part Detail	13,302.94	4,204.40
Total Labour Cost	1,090.00	400.00
Total Spray Painting	2,214.00	750.00
Other	860.00	320.00
Overall Total	18,066.94	5,674.40
Lump Sum Repair Option		☐
Lump Sum Total	0.00	5,674.40
Surveyor Approved Amount		5,674.40
No of Repair Days*	8	4

Steve (LKK)
25/10/21, 5.00pm
with Pic
4 days

Resury Before Spry
P/P

	Estimator Assessment(\$)	Surveyor Assessment(\$)
Remarks		PART BY PART / BEFORE PAINT PHOTO FOR CHECK IT AND REPLACE ITEM PLEASE CALL SURVEYOR Steve Chen / KK / UN : 9232 9312 E-Mail: stevechen@lkk.com.sg
Surveyor Name		STEVE CHEN
Signature		
Survey Date	25/10/2022	Save Clear

LKK Auto Consultants hence notify
the Repairer of the following:

- To resurvey before/after spray painting
- To display damaged part(s) during resurvey
- Parts prices are subject to confirmation
- Third party survey is on a "Without Prejudice" basis
- No illegal modification(s) is allowed
- Supplementary item(s) must be resurveyed and
is subject to final approval from Insurance Company

Acknowledged by Repairer

Signature:

Date:

SINGAPORE ACCIDENT STATEMENT

IMPORTANT NOTICE

1. Please report **correctly** the details of the accident to speed up the claims process.
2. This Form must be **completed by the Policyholder and/or the Actual Driver**
3. Information provided must be as truthful and accurate as possible. Any wilful misrepresentation or withholding of material facts may allow insurance companies to repudiate policy liability.
4. The issue and acceptance of this Form by insurance companies is not an admission of policy liability on the part of the insurance companies.
5. **Any false reporting may be referred to the Police for investigation.**
6. This report will be forwarded by the insurers of the GIA Records Management Centre established by the General Insurance Association of Singapore (GIA) for archiving and that copies of this report will, for a fee, be made available upon application by interested parties.
7. By the lodgement of this report to the insurers, you hereby consent to the archiving of this report at the centre and to copies of the report being made available aforesaid.

ACCIDENT STATEMENT

Date of Submission	25/10/2022 10:43 (SGT)
Reported by	Owner
Date of Accident	22/10/2022 13:20 (SGT)
Exact Location of Accident	Jln Anak Bukit, Singapore
Additional Location Information	JALAN ANAK BUKIT BEFORE BUKIT TIMAH LINK
Country/State of Loss	Singapore

DETAILS OF OWN VEHICLE

Vehicle Registration Number SHB1278D

INSURED/POLICYHOLDER

Is company?	Yes
Name Of Registered Owner	Strides Taxi Pte Ltd
Company Reg No	1XXXXX369K
Email Address	AUTO-SVCS-TARC@SMRT.COM.SG
Mobile Phone No	(Phone) +65-68662671
Alternative Phone No	-

VEHICLE PARTICULARS

Manufacturer	Toyota
Model	Prius
Variant	-
Exact purpose for which vehicle was being used at time of accident	-
Are you claiming under your own insurance policy for repair to your vehicle?	No - Claiming third party
Vehicle Category	Taxi
Transmission	Auto
CC	1800

INSURANCE COMPANY

Name of Insurance Company	MS First Capital Insurance Ltd
Policy Number / Cover Note Number	D-22099115MFSH

DRIVER

Name of Driver	WILLY OW WEE BOON
NRIC No	SXXXX958I
Date Of Birth	11/06/1972
Occupation	Outdoor

Date Of Driving Pass	18/07/2006
Driving experience	16 YEARS AND 3 MONTHS
Gender	Male
Mobile Number	(Phone) +65-68662672
Alt. Phone Number	-
Email Address	AUTO-SVCS-TARC@SMRT.COM.SG
Address	11
Address complement	-
Postcode	-
Is the driver the policyholder?	No
If No, Relationship of the Driver with the Insured	Hirer
Does Driver Own Other Vehicles?	No
Vehicle Registration Number of Other Vehicle Owned by Driver	-
Insurance Company of Other Vehicle Owned by Driver	-

GENERAL INFORMATION OF THE ACCIDENT

Type of Accident	Collision - Head to Rear
Weather Conditions	Clear
Road Surface	Dry

OTHER INFORMATION

Was any foreign vehicle involved in the accident?	No
Number of vehicles involved in the accident	2
Was anybody injured in the Accident?	Yes
Was any injured conveyed to hospital by ambulance?	Yes
Was any other vehicle or property damaged?	Yes
Number of Passengers (Including Driver)	2
Has the driver been approached by unknown person(s) soliciting/offering accident claims assistance?	No
Translator's name	-
Translator's ID	-
Translator's phone number	-
Translator's email	-
Original language used in the statement	-

PASSENGER 1

Name	UNKNOWN
Gender	Female

DETAILS OF POLICE ACTION

Was the accident reported to the police?	Yes
Police Station Name	Bukit Panjang Neighbourhood Police Centre
Police Station Address	No.1 Segar Road #01-05 Singapore 677738
Was notice of intended Prosecution given?	No
If yes, against whom?	-

CIRCUMSTANCES OF ACCIDENT

REFER TO POLICE REPORT - T/20221022/2093

ATTACHMENT(S)

Are accident photos available for attachment?	Yes
Was there any video captured by Car Camera?	No

DETAILS OF OTHER VEHICLE PROPERTY 1

Vehicle Registration Number	SMU4676J
Vehicle Manufacturer	-

Vehicle Model	-
Vehicle Variant	-
Vehicle Colour	-
Vehicle Category	-
Name of Driver	Private car
Contact Number	-
Address	-
Address complement	-
Postcode	-
Insurance Company Name	-
Nature Of Damage	-
Details of property damaged in accident	-
No. Of Passenger (Including Driver)	-

INJURED PERSONS DETAILS

INJURED 1

Name of injured person	UNKNOWN
Gender	-
Phone No	-
Address	-
Address Complement	-
Post Code	-
Approximate Age Years Old	-
Injuries Sustained	-
Injured person in which vehicle?	SHB1278D
Were seat belts worn?	-
Was this injured conveyed to hospital by ambulance?	Yes

Jalan Arank Bukit

A

A- SHB1278D

B

B- SMU4676J

Large empty rectangular area for sketch plan details.

Declaration

(We declare the foregoing particulars are true in every respect)



Policyholder's Signature / Date & Time

[Signature]

Driver's Signature (if driver is not the policyholder) / Date & Time

[Signature] 25.10.2022

Witnessed by Reporting Centre Personnel
(Name as in NRIC card)

IMPORTANT NOTICE

SKETCH PLAN

1. Please report correctly the details of the accident to speed up the claims process.
2. This Form must be completed by the Policyholder and/or the Actual Driver.
3. Information provided must be as truthful and accurate as possible. Any wilful misrepresentation or withholding of material facts may allow insurance companies to reputate policy liability.
4. The issue and acceptance of this Form by insurance companies is not an admission of policy liability on the part of the insurance companies.
5. **Any false reporting may be referred to the Traffic Police Department for investigation.**
6. This report will be forwarded by the insurers to the GIA Records Management Centre established by the General Insurance Association of Singapore (GIA) for archiving and that copies of this report will for a fee be made available upon application by interested parties.
7. By the lodgement of this report to the insurers, you hereby consent to the archiving of this report at the centre and to copies of the report being made available aforesaid.

8. Consent under the Personal Data Protection Act (PDPA)

I understand, acknowledge, agree and consent that:

- (a) My insurer, my workshop and the General Insurance Association of Singapore (GIA) may/are permitted to collect, use, disclose and/or process my personal data/personal information set out in this [form] and any other personal information provided by me or possessed by my insurer (collectively the "Personal Information") and disclose and transfer such Personal Information to all insurer(s) who have insured vehicle(s) involved in this accident (all insurer(s) who have insured vehicle(s) involved in this accident shall be collectively referred to as the "Insurers"); the Insurers, lawyers/law firms, the Monetary Authority of Singapore and any relevant government agency/authority (such as the police), for the purpose(s) of:
- (i) processing, handling and/or dealing with my claims including the settlement of the claims and any necessary investigations relating to the claims;
 - (ii) investigating the accident and/or my claims;
 - (iii) carrying out and/or dealing with my instructions or responding to any enquiries by me;
 - (iv) administering my claims (including the mailing of correspondence, statements, invoices, reports or notices to me, which could involve disclosure of certain personal data about me to bring about delivery of the same as well as on the external cover of envelopes/mail packages); and/or
 - (v) complying with applicable law in administering, processing, handling and/or dealing with my claims (collectively the "Purposes")
- (b) all insurer(s) who have insured vehicle(s) involved in this accident and the Insurers, lawyers/law firms, may/are permitted to collect, use, disclose and/or process my Personal Information for one or more of the above Purposes; and
- (c) my Personal Information may/can be disclosed by any of the Insurers and/or GIA to their third-party service providers or agents (including their lawyers/law firms) which may be sited outside of Singapore, for one or more of the above Purposes.



Policyholder's Signature / Date & Time

Driver's Signature (if driver is not the policyholder) / Date & Time

Witnessed by Reporting Centre Personnel
(Name as in NR/GID card)

Sketch Plan