

ASS. REC. BY:

REF:

072/22011360/kw

C

Kenneth

ASSIGNMENT

From:

Date:

Estimated Cost:

OD/TP/WS/TP RES/OD RES/EVA/INV/MV

To Inspect Vehicle No:

at Workshop m/s

of

Insured:

Policy No.

Claims No.

Sum Insured:

Excess:

(Client's Record)

Make of Veh:

(Policy Condition)

Remark: The veh had commenced its
repair at the time of inspection.

Bal. or Market Value:

\$12K

IDAC Accident Rpt:

Consistent? : Yes or No

GIA / PR Seen:

Consistent? : Yes or No

Est. Repairs:

07 days

Res.: Yes or No

Lum Sum:

20 %

3 Val.: Yes or No

CA / REV / REP. / 24 HRS

12/23

Date:

Person Contacted:

Vehicle: IN / OUT

Veh No:

SMF 6803 A Yr Regn: 12, 08

Type: M.Car / M.Cycle / Bus / Van / Lorry / Taxi / Prime Mover /

Truck / Trailer or

Make:

Toy A1715 A

C.C.

1588

Colour

M. Silver

A/C:

Insured / Std / NI / NA

Sp. Reading

T/Radio: Insured / Std / NI / NA

Eng/No:

C/No:

MR0538EE106127768

Gen. Cond: Good / Fair / Poor / Burnt

Steering: In order / Jammed / Leaked / Burnt or

Brake: In order / Jammed / Leaked / Burnt or

Modl: Nil / S/Rlm / STD A/Rlm or

Tyre Size:

F:

205/55ZR16

R:

BS / DUN / EXNOVA / GY / FS / LIZA / MIC / OHTSU / PIR / SUMI /
TOYO / YOKO or

Front

Rear

R/Bal.

6

mm

R/Bal.

6

mm

L/Bal.

6

mm

L/Bal.

6

mm

D.O.A.

8/11/22

D.O.I.

14/11/2022

Survey held at

Des. of Damages: Frt / Rear / O/S / N/S / UIC / Rooftop or

The U/C / Chassis frame / Body Structure affected due to collision.

Date / Time

Action / Instruction

1

Battery flat.

19/12

11 Pm @ 4950h Car @ 07 days (Red \$5,508.65/53%)

Date/Time, File Pass to?

☐

: Prell. Report

1)

☐

: Final Report

Date/Time, File Return to?

2)

Days Of Repair:

Resurvey No. of Trip:

Add Fee:

☐

: Site Insp (\$

☐

: Interview (\$

☐

Tech Invs (\$

☐

Weekend (\$

Survey Fee:

Transportation

\$ + RS. \$

Fuel

Others

TOTAL

Report Format :

Lump Sum / I.B.I: (\$

Estimate Repair

Ding Auto Pte Ltd
Sin Ming Industrial Est. Sec C, Blk
10,#01-20
575645



Insurer Reference:
Repairer Reference: 054425
Date calculated: 10/11/2022 2:25 PM

Full Report
Registration: SMF6803A
Printed: 10/11/2022 2:25 PM

Summary Information

Claim			
Location:	Singapore (SG)	Work Provider:	China Taiping Insurance (Singapore) Pte Ltd
Printed by:	Ding Auto	Currency:	SGD
Claim Reference:		Date of Incident:	07/11/22
Estimated Repair Time:	21	Hire Car Start:	
Actual Repair Days:	21	Hire Car End:	

Vehicle Details

vehicle
 Manufacturer: TOYOTA
 Model: COROLLA E14
 Sub Model: ALTIS
 Model Sheet Number: 70 CM 13
 Registration: SMF6803A
 VIN number:
 Odometer: 0
Model Specs
 1.6 LTR 82 KW

Not Notified
6/11/22
Repair After Rain
Ex TBA
7 days

Labour

Code	Description	Time Base 10 WU/h	Price = 42.00 SGD/h	
			WU	Price SGD
NO NUMBER	ADJUST HEADLAMPS		3.0	12.60
M050 ZAX	R + R FRONT ASSEMBLIES		46.0	193.20
	INCLUDES: R + R WHEELS, ENGINE WITH GEARBOX AND ENGINE SUPPORT, DETACH + REFIT CONTROL ARMS, TIE RODS, UPPER SUSPENSION STRUTS, DRIVE SHAFTS, STABILIZER AND FRONT EXHAUST, BLEED BRAKE SYSTEM			
043233C	ADD: ADJUST FRONT TOE		1.0	4.20
043233	ALIGN VEHICLE CPL		12.0	50.40
043233D	ADJUST FRONT CAMBER (ADD/WORK)		5.0	21.00
B100	R + R LEFT WING		4.0	16.80
B100	R + R R/WING		4.0	16.80
B110)	RENEW R/F WING (REMOVED)		2.0	8.40
B140	RENEW FRONT PANEL CPL		9.0	37.80
NO NUMBER	R + R FRONT BUMPER REINFORCEMENT		2.0	8.40
B170)	RENEW R/F SIDEMEMBER (COMP-WORK)		24.0	100.80
NO NUMBER	RENEW L/F SIDE MEMBER FRONT SECTION		5.0	21.00
B010	R + R FRONT BUMPER		5.0	21.00
B020)	RENEW FRONT BUMPER (REMOVED)		9.0	37.80

Code	Description	WU	Price SGD
B040)	R + R LEFT HEADLAMP	1.0	4.20
B040)	R + R RIGHT HEADLAMP	1.0	4.20
B040)	RENEW HEADLAMP	1.0	4.20
NO NUMBER	RENEW FRONT NUMBER PLATE	2.0	8.40
B060	R + R BONNET	3.0	12.60
B070)	RENEW BONNET (REMOVED)	1.0	4.20
B080	R + R BONNET HINGES	1.0	4.20
851051)	R + R WASHER PUMP	2.0	8.40
B085	R + R FRONT SCREEN FRAME MOULDING	2.0	8.40
G010	R + R WINDSCREEN	31.0	130.20
B085)	R + R WATER BOX CLOSING PANEL	1.0	4.20
160401)	R + R FAN SHROUD / ENGINE	6.0	25.20
160101)	R + R UPPER RADIATOR HOSE	2.0	8.40
160111)	R + R LOWER RADIATOR HOSE	2.0	8.40
M020)	RENEW RADIATOR (RADIATOR REMOVED)	3.0	12.60
210061)	R + R THROTTLE BODY	3.0	12.60
170011)	R + R INTAKE MANIFOLD AND RENEW GASKET	6.0	25.20

Labour Cost	Hrs	WU	
Panel / Mechanical Labour	18.10	181.0	760.20
Alignment			
Measuring Work	1.80	18.0	75.60
Total of Labour			835.80

Paint

Code	Description	WU	Price SGD
Paint Work	SYSTEM AZT	Time Basis 10 WU/h	
	BONNET NEW PART PAINTING	19.0	
	R/F WING NEW PART PAINTING	10.0	
	LOCK CARRIER STRUT SURFACE PAINT	4.0	
	INNER FRT PANEL CPL SURFACE PAINT	6.0	
	R/F SIDE MEMBER CPL SURFACE PAINT	4.0	
	L/F SIDE MEMBER END SURFACE PAINT	4.0	
	FRONT BUMPER NEW PART PAINT K1R	11.0	
	GRILLE NEW PART PAINT K1R	3.0	

Paint Material Per Part

Code	Description	Price SGD
0471	BONNET NEW PART PAINTING	51.18
0742	R/F WING NEW PART PAINTING	16.52
0988	LOCK CARRIER STRUT SURFACE PAINT	0.88
1009	INNER FRT PANEL CPL SURFACE PAINT	9.86
1202	R/F SIDE MEMBER CPL SURFACE PAINT	3.52
1207	L/F SIDE MEMBER END SURFACE PAINT	0.88
0281	FRONT BUMPER NEW PART PAINT K1R	47.81
0410	GRILLE NEW PART PAINT K1R	3.49

Labour Cost - Paint

	Hrs	WU	Price SGD
Factor	42.00 SGD/h		
Time Paint		61.0	
Preparation Main Work Metal	0.80	8.0	33.60
Preparation Comp. Work Plastic	0.30	3.0	12.60
Total	10 WU/h	72.0	302.40

Material Cost - Paint

	Price SGD
New Part Painting	67.70
New Part Painting - Plastic K1R	51.30
Surface-/Blend Paint	15.14
Material-constant Metal	18.10
Material-constant Plastic	9.00
Total	161.24

Spare Parts

prices as at 2015-06-01/01				
Code	Description	Part Number	Part Source	Price SGD
51	LWR RADIATOR GRILLE	53112 02190	Original	Sm 60.00 X
0253	L/LOWER GRILLE	81482 02100	Original	Sm 65.00 X
0254	R/LOWER GRILLE	81481 02110	Original	Sm 65.00 X
0257	FRONT NUMBER PLATE	KNPL3	Original	Nu 30.00 ✓
0258	FRT NO PLATE REINF	KNPL0	Original	N/P 30.00 X
0281	FRONT BUMPER	52119 02850	Original	CM 300.00 ✓
0317	L/F BUMPER BRACKET	52116 02140	Original	CPL 30.00 X
0318	R/F BUMPER BRACKET	52115 02140	Original	CM 30.00 ✓
0340	BUMPER SUPPORT	52021 02101	Original	R 180.00 ✓
0410	GRILLE	53100 02310	Original	CM 185.00 ✓
0431	GRILLE BADGE	75301 02050	Original	Nu 50.00 ✓
0471	BONNET	53301 02230	Original	R 380.00 ✓
0475	L/F HINGE	53420 02060	Original	R 35.00 ✓
0476	R/F HINGE	53410 02060	Original	R 35.00 ✓
0481	BONNET INSULATION	53341 02190	Original	T 180.00 ✓
0493	BONNET LOCK	53510 02400	Original	R 75.00 ✓
0495	BONNET STAY	53440 02120	Original	R 40.00 X
0530	FRONT BONNET SEAL	53381 02140	Original	CM 45.00 ✓
0561	LEFT HEADLAMP ASSY	81170 02720	Original	my car 240.00 ✓
0562	RIGHT HEADLAMP ASSY	81130 02720	Original	R 240.00 ✓
0742	R/F WING	53811 02250	Original	R 220.00 ✓
0842	R/WHEELHOUSE SHELL	53875 02270	Original	CM 80.00 ✓
0844	R/WING COVER PANEL	53827 02120	Original	Sm 55.00 X
0988	LOCK CARRIER STRUT	53208 02120	Original	R 90.00 ✓
1009	INNER FRT PANEL CPL	53201 02270	Original	R 350.00 ✓
1202	R/F SIDE MEMBER CPL	57101 02908	Original	R 280.00 X
1207	L/F SIDE MEMBER END	57142 12100	Original	R 50.00 X
1391	L/COWL PANEL GRILLE	55709 02330	Original	Sm 260.00 X
1392	R/COWL PANEL GRILLE	55708 02450	Original	Sm 200.00 X
1401	WINDSCREEN	56101 02930	Original	CM 650.00 ✓
1410	LWR WINDSCREEN SEAL	56117 12300		0.00
1411	WINDSCREEN REP KIT	PZ49I 00C1131		0.00
1423	UPP WINDSCREEN MLDG	75531 02190	Original	Nu 65.00 ✓
1436	WASHER CONTAINER	85315 02470	Original	Sm 75.00 X
1437	WASHER PUMP	85330 0D100	Original	SK 100.00 X
7761	RADIATOR	16410 0D420	Original	R/Pu 550.00 ✓

Code	Description	Part Number	Part Source	Price SGD	
7767	RADIATOR SHROUD	16711 0D260	Original	CM 160.00	2
7768	UPP RADIATOR SHROUD	16712 0D191	Original	Sm 50.00	X
7773	LWR RADIATOR HOSE	16572 0D220	Original	Sm 105.00	X
7776	UPPER RADIATOR HOSE	16573 0D100	Original	Sm 125.00	X
7783	L/LWR RADIATOR BRKT	16535 0D160	Original	R 30.00	X
7784	R/LWR RADIATOR BRKT	16535 0D160	Original	Bj 30.00	✓
7785	L/RADIATOR BRACKET	16533 0D060	Original	Bj 35.00	✓
7786	R/RADIATOR BRACKET	16533 0D060	Original	R 35.00	X
7787	EXPANSION TANK	16470 0D050	Original	Sm 70.00	X
7793	COOLING FAN	16361 0D200	Original	Sm 70.00	X
7797	FAN MOTOR	16363 0M010	Original	Sm 120.00	2
8149	THROTTLE HOUSING	22030 0D050	Original	Sm 520.00	X
8221	INTAKE MANIFOLD	17120 0D070	Original	CM 380.00	2
8373	AIR FILTER RESONATOR	17893 22900	Original	Sm 110.00	X
8375	AIR INTAKE HOSE	17752 37070	Original	Sm 90.00	X
8391	AIR INTAKE ASSY	17700 0D220	Original	CAA 185.00	2
9631	BATTERY TRAY	74431 12060	Original	Sm 45.00	X
9646	HIGH TONE HORN	86510 48070	Original	Sm 55.00	X
1000	CONDENSOR ASSY CPL	CONDENSOR	Original	Bj 450.00	2
1001	FOG LAMP ASSY RH	FOG LAMP	Original	Sm 110.00	X
1002	FOG LAMP ASSY LH	FOG LAMP	Original	Sm 110.00	X
1003	SUCTION HOSE	HOSE	Original	Sm 145.00	X
1004	DISCHARGE HOSE	HOSE	Original	Sm 125.00	X
f: OEM Parts				Savings	0.00
n: Non-OEM Parts				Subtotal	8,475.00
u: Used parts				Total	8,475.00

Final Calculation

	SGD	SGD
Parts		
Total Parts	8,475.00	8,475.00
Labour Time Base 10 WU/h		
Total 181.0 WU X 42.00 SGD/h		
Alignment	760.20	
Measuring Work	75.60	424.20
Total of Labour		835.80
Paint Work Time Base 10 WU/h		
Labour Cost 72.0 WU X 42.00 SGD/h	302.40	268.80
Material Cost	161.24	156.84
Total Paint Including Material		463.64
Repair Cost Excludes GST		9,774.44
GST (+7.0%)		684.21
Repair Cost Included GST		10,458.65

LKK Auto Consultants hence notify the Repairer of the following:

- To resurvey before/after spray painting
- To display damaged part(s) during resurvey
- Parts prices are subject to confirmation
- Third party survey is on a "Without Prejudice" basis
- No illegal modification(s) is allowed
- Supplementary item(s) must be resurveyed and is subject to final approval from Insurance Company

Acknowledged by Repairer

Signature:

Date:

Comments

* - USER SUPPLIED DATA

NN - NO MANUFACTURERS CODE EXISTS

) - WU PARTIAL INCL IN OTHER POSITIONS

Assessment Note

No assessment notes entered.

Enquire Vehicle Transfer Fee

Vehicle Details

Vehicle No.
SMF6803A

Make / Model
TOYOTA / COROLLA ALTIS 1.6 AUTO

Vehicle Type :
P10 - Passenger Motor Car

Vehicle Scheme :
Normal

Propellant :
Petrol

Motor No. :
-

Power Rating :
-

Maximum Laden Weight :
1630 kg

Year Of Manufacture :
2008

Lifespan Expiry Date :
-

PQP Paid :
\$13,786.00

Road Tax Expiry Date :
25 Dec 2022

Inspection Due Date :
25 Dec 2022

CO2 Emission :
-

CO Emission :
-

NOx Emission :
-

Vehicle Attachment 1 :
No Attachment

Chassis No. :
MR053ZEE106127768

Engine No. :
3ZZ4826127

Engine Capacity :
1598 cc

Maximum Power Output :
80.0 kW (107 bhp)

Unladen Weight :
1195 kg

Original Registration Date :
26 Dec 2008

COE Category :
A - Car (1600cc & below)

COE Expiry Date :
25 Dec 2023

PARF Eligibility Expiry Date :
-

Intended Transfer Date :
09 Nov 2022

CEV/VES Rebate Utilised Amount :
-

HC Emission :
-

PM Emission :
-

SINGAPORE ACCIDENT STATEMENT

IMPORTANT NOTICE

1. Please report correctly the details of the accident to speed up the claims process.
2. This Form must be completed by the Policyholder and/or the Actual Driver
3. Information provided must be as truthful and accurate as possible. Any wilful misrepresentation or withholding of material facts may allow insurance companies to repudiate policy liability.
4. The issue and acceptance of this Form by insurance companies is not an admission of policy liability on the part of the insurance companies.
5. **Any false reporting may be referred to the Police for investigation.**
6. This report will be forwarded by the insurers of the GIA Records Management Centre established by the General Insurance Association of Singapore (GIA) for archiving and that copies of this report will, for a fee, be made available upon application by interested parties.
7. By the lodgement of this report to the insurers, you hereby consent to the archiving of this report at the centre and to copies of the report being made available aforesaid.

ACCIDENT STATEMENT

Date of Submission	09/11/2022 12:12 (SGT)
Reported by	Both
Date of Accident	07/11/2022 06:00 (SGT)
Exact Location of Accident	Jalan Tebrau, Johor Bahru, Johor, Malaysia
Additional Location Information	TEBRAU HIGHWAY TOWARDS JOHOR BAHRU
Country/State of Loss	Malaysia

DETAILS OF OWN VEHICLE

Vehicle Registration Number	SMF6803A
-----------------------------	----------

INSURED/POLICYHOLDER

Is company?	No
Name Of Registered Owner	OW MUI KHENG
NRIC No	SXXXX862A
Email Address	DAV_LIN@HAIS.COM.SG
Mobile Phone No	(Phone) +65-98154775
Alternative Phone No	-

VEHICLE PARTICULARS

Manufacturer	Toyota
Model	Corolla
Variant	-
Exact purpose for which vehicle was being used at time of accident	Employment
Are you claiming under your own insurance policy for repair to your vehicle?	Yes
Vehicle Category	Private car
Transmission	Auto
CC	1598

INSURANCE COMPANY

Name of Insurance Company	China Taiping Insurance (Singapore) Pte. Ltd.
Policy Number / Cover Note Number	DMPCSNW00006952200

DRIVER

Name of Driver	MAT TORMIZI BIN MOHAMMAD
NRIC No	SXXXX505G
Date Of Birth	11/09/1975
Occupation	Indoor

Date Of Driving Pass	18/04/2009
Driving experience	13 YEARS AND 7 MONTHS
Gender	Male
Mobile Number	(Phone) +65-97385288
Alt. Phone Number	-
Email Address	GG2EDA@GMAIL.COM
Address	BLK 744 WOODLANDS CIRCLE
Address complement	#05-758
Postcode	730744
Is the driver the policyholder?	No
If No, Relationship of the Driver with the Insured	Employee
Does Driver Own Other Vehicles?	No
Vehicle Registration Number of Other Vehicle Owned by Driver	-
Insurance Company of Other Vehicle Owned by Driver	-

GENERAL INFORMATION OF THE ACCIDENT

Type of Accident	Collision - Head to Rear
Weather Conditions	Raining
Road Surface	Wet

OTHER INFORMATION

Was any foreign vehicle involved in the accident?	Yes
Number of vehicles involved in the accident	2
Was anybody injured in the Accident?	No
Was any injured conveyed to hospital by ambulance?	-
Was any other vehicle or property damaged?	Yes
Number of Passengers (Including Driver)	1
Has the driver been approached by unknown person(s) soliciting/offering accident claims assistance?	No
Translator's name	-
Translator's ID	-
Translator's phone number	-
Translator's email	-
Original language used in the statement	-

FOREIGN VEHICLE 1

Vehicle Registration Number	JTC8141
Vehicle Category	Commercial vehicle

DETAILS OF POLICE ACTION

Was the accident reported to the police?	Yes
Police Station Name	Woodlands East Neighbourhood Police Centre
Police Station Phone No	(Phone) +65-18007679999
Police Station Address	3 Woodlands Drive 63 Singapore 737890
Was notice of intended Prosecution given?	No
If yes, against whom?	-

CIRCUMSTANCES OF ACCIDENT

REFER TO ATTACHED POLICE REPORT.

ATTACHMENT(S)

Are accident photos available for attachment?	Yes
Was there any video captured by Car Camera?	No

DETAILS OF OTHER VEHICLE PROPERTY 1


Vehicle Registration Number	JTC8141
-----------------------------------	---------


* Vehicle Manufacturer	Toyota
Vehicle Model	Hilux
Vehicle Variant	-
Vehicle Colour	-
Vehicle Category	Commercial vehicle
Name of Driver	-
Contact Number	-
Address	-
Address complement	-
Postcode	-
Insurance Company Name	-
Nature Of Damage	-
Details of property damaged in accident	-
No. Of Passenger (Including Driver)	-


SKETCH PLAN

IMPORTANT NOTICE

1. Please report correctly the details of the accident to speed up the claims process.
2. This Form must be completed by the Policyholder and/or the Authorised Driver.
3. Information provided must be as truthful and accurate as possible. Any willful misrepresentation or withholding of material facts may allow insurance companies to repudiate policy liability.
4. The issue and acceptance of this Form by insurance companies is not an admission of policy liability on the part of the insurance companies.
5. Any false reporting may be referred to the Police for investigation.
6. The report will be forwarded by the insurers of the GIA Records Management Centre established by the General Insurance Association of Singapore (GIA) for archiving and that copies of this report will for a fee be made available upon application by interested parties.
7. By the lodgement of this report to the insurers, you hereby consent to the archiving of this report at the centre and to copies of the report being made available aforesaid.
8. **Consent under the Personal Data Protection Act (PDPA)**
I understand, acknowledge, agree and consent that :
(a) My insurer, my workshop and the General Insurance Association of Singapore ("GIA") may/are permitted to collect, use, disclose and/or process my personal data/personal information set out in this [form] and any other personal information provided by me or possessed by my insurer (collectively the "Personal Information") and disclose and transfer such Personal Information to all insurer(s) who have insured vehicle(s) involved in this accident (all insurer(s) who have insured vehicle(s) involved in this accident shall be collectively referred to as the "Insurers"), the Insurers' lawyers/law firms, the Monetary Authority of Singapore and any relevant government agency/authority (such as the police), for the purpose(s) of :
(i) processing, handling and/or dealing with my claims including the settlement of the claims and any necessary investigations relating to the claims;
(ii) investigating the accident and/or my claims;
(iii) carrying out and/or dealing with my instructions or responding to any enquiries by me;
(iv) administering my claims (including the mailing of correspondence, statements, invoices, reports or notices to me, which could involve disclosure of certain personal data about me to bring about delivery of the same as well as on the external cover of envelopes/mail packages); and/or
(v) complying with applicable law in administering, processing, handling and/or dealing with my claims.
(collectively the "Purposes")
(b) all insurer(s) who have insured vehicle(s) involved in this accident and the Insurers' lawyers/law firms, may/are permitted to collect, use, disclose and/or process my Personal Information for one or more of the above Purposes; and
(c) my Personal Information may/can be disclosed by any of the Insurers and/or GIA to their third party service providers or agents (including their lawyers/law firms), which may be sited outside of Singapore, for one or more of the above Purposes.

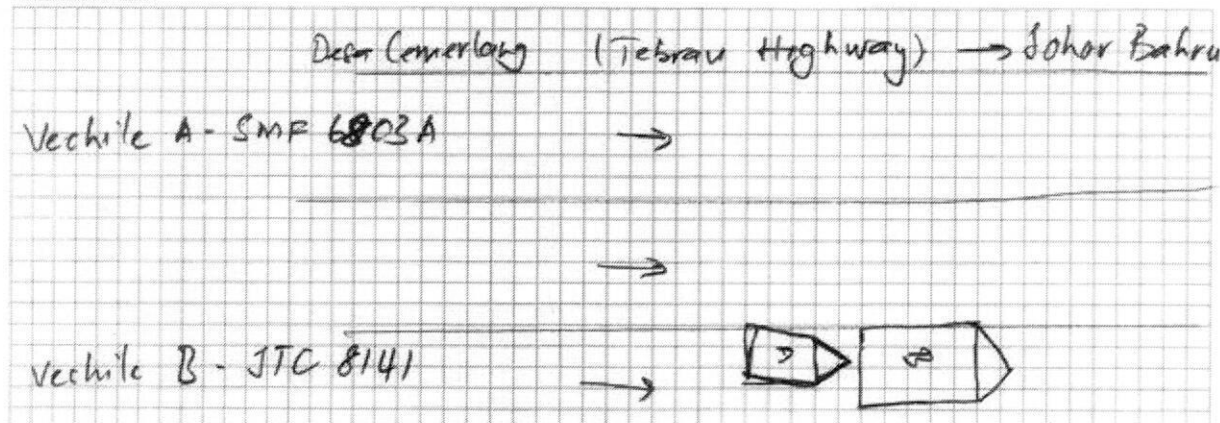

Policyholder's Signature / Date & Time


Driver's Signature (If driver is not the policyholder) / Date & Time


Witnessed by Reporting Centre Personnel



Sketch Plan



Describe Circumstances of the Accident

please refer to police report. = L/2022/108/2003.

Declaration

I/We declare the foregoing particulars are true in every respect.

Policyholder's Signature / Date &
Time

Driver's Signature (If driver is not the policyholder) / Date & Time

Witnessed by Reporting Centre
Personnel



> Back to OneMotoring

Enquire PARF/COE Rebate for Registered Vehicle

Vehicle Owner Particulars

Owner ID Type:	Singapore NRIC
Owner ID:	862A

Vehicle Details

Vehicle No.:	SMF6803A
Vehicle to be Exported:	Yes
Intended Deregistration Date:	18 Nov 2022
Vehicle Make:	TOYOTA
Vehicle Model:	COROLLA ALTIS 1.6 AUTO
Primary Colour:	Silver
Manufacturing Year:	2008
Engine No.:	3ZZ4826127
Chassis No.:	MR053ZEE106127768
Maximum Power Output:	80.0 kW (107 bhp)
Open Market Value:	\$16,084.00
Original Registration Date:	26 Dec 2008
First Registration Date:	26 Dec 2008
Transfer Count:	2
Actual ARF Paid:	\$16,084.00

Intended PARF Rebate Details

PARF Eligibility:	Forfeited
PARF Eligibility Expiry Date:	-
PARF Rebate Amount:	\$0.00

Intended COE Rebate Details

COE Expiry Date:	25 Dec 2023
COE Category:	A - Car (1600cc & below)
COE Period(Years):	5
PQP Paid:	\$13,786.00
COE Rebate Amount:	\$3,038.00
Total Rebate Amount:	\$3,038.00

Message

Please note that the 5-year COE for this vehicle cannot be further renewed. The vehicle must be de-registered upon COE expiry or when the vehicle reaches its statutory lifespan (if applicable), whichever is earlier.

The information contained herein is correct as at 14 Nov 2022

OK