

ASS. REC. BY:

REF:

C12/220113631/K9

Kenneth

ASSIGNMENT

From:

Date:

Estimated Cost:

OD/TP/WS/TP RES/OD RES/EVA/INV/MV

To inspect Vehicle No:

at Workshop m/s

of

Insured:

Policy No.

Claims No.

Sum Insured:

Excess:

(Client's Record)

Make of Veh:

(Policy Condition)

Remark: The veh had commenced its
repair at the time of inspection.

Bal. or Market Value:

IDAC Accident Report:

Consistent? : Yes or No

GIA / PR Seen:

Consistent? : Yes or No

Est. Repairs:

05 days

Res.: Yes or No

Lum Sum:

1.1.1 %

3 Val.: Yes or No

CA / REV / REP. / 24 HRS

Date:

Person Contacted:

Vehicle: IN / OUT

Veh No:

SDW 5T

Yr Regn:

08/16

Type: M.Car / M.Cycle / Bus / Van / Lorry / Taxi / Prime Mover /

Truck / Trailer or

Make:

M. A. B180

C.C.

1595

Colour

M. A. B180

Insured / Std / NI / NA

Sp. Reading

45926

T/Radio: Insured / Std / NI / NA

Eng/No:

C/No:

WDD 2482422J 390155

Gen. Cond: Good / Fair / Poor / Burnt

Steering: Inorder / Jammed / Leaked / Burnt or

Brake: Inorder / Jammed / Leaked / Burnt or

Modi: Nil / S/Rim / STD A/Rim or

Tyre Size:

F:

205/55R16

R:

BS / DUN / EXNOVA / GY / FS / LIZA / MIC / OHTSU / PIR / SUMI /

TOYO / YOKO or

Continental

Front

R/Bal.

8

mm

Rear

R/Bal.

8

mm

L/Bal.

8

mm

L/Bal.

8

mm

D.O.A.

5/11/22

D.O.I.

14/11/2022

Survey held at

Des. of Damages: Frt / Rear / O/S / N/S / U/C / Rooftop or

Rear O/S

The U/C / Chassis frame / Body Structure affected due to collision.

Date / Time

Action / Instruction

18/11 01 Rep @ 6600 (Rear @ 5639.77, 46%)

Date/Time, File Pass to?

☐

: Prel. Report

1) 17/11/2022

☐

: Final Report

Date/Time, File Return to?

2)

Days Of Repair:

5

Resurvey No. of Trip:

2

Survey Fee:

Transportation:

S - RS - SI

F - RS

Others

TOTAL

Add Fee:

☐

: Site Insp (\$

☐

: Interview (\$

☐

: Tech Invs (\$

☐

: Weekend (\$

Report Format:

MER-00

Lump Sum / I.B.I. (\$

6600

S&H Motor Pte Ltd
160 Sin Ming Drive #07-02
Sin Ming Autocity
Singapore 575722

Insurer Reference:
Repairer Reference: 054332
Date calculated: 11/11/2022 2:17 PM

Full Report
Registration: SDW5T
Printed: 11/11/2022 2:17 PM

Summary Information

Claim			
Location:	Singapore (SG)	Work Provider:	China Taiping Insurance (Singapore) Pte Ltd
Printed by:	SH Motor	Currency:	SGD
Claim Reference:		Date of Incident:	05/11/22
Estimated Repair Time:		Hire Car Start:	
Actual Repair Days:		Hire Car End:	

Vehicle Details

Vehicle
 Manufacturer: MERCEDES-BENZ
 Model: B-CLASS (W246)
 Sub Model: B 180
 Model Sheet Number: 03 A1 41
 Registration: SDW5T
 VIN number: WDD2462422J390155
 Odometer:

Model Specs

FROM J358956/N131237	CONTROL UNIT 3U1	KEYLESS IGNITION SYS	MODEL 2016
DYNAMIC SEL SWITCH	A/C THERMATIC	ELECT LUMBAR ADJUST	MIRROR PACKAGE
RAIN SENSOR	DIPPING DOOR MIRROR	COLLISION WARNER	ELECT FOLDING MIRROR
AUDIO SYSTEM 20 CD	DISPLAY 8"	ILLUMINAT AMBIENTE	LED HEADLAMP
LIGHT-/VIEW PACKAGE	LEATHER PAD ARTICO	PARTITION NET	S/WHEEL TIP SWITCHES
DRIVER SEAT MEMORY	PASS SEAT MEMORY	TRIM LINEAR OPTIC	SEAT COMFORT PACKAGE
MEDIA INTERFACE	ILLUM SUN VISOR	DRIVER SEAT TRAY	PASS SEAT ST/BOX
REARVIEW CAMERA	FRT SEAT LUGGAGE NET	POWER REDUCTION	SOCKET 12V
EMISSION STD EURO 6	STORAGE PACKAGE	CAMTRONIC	ECO START/STOP
TYRE PRESSURE SENSOR	CRUISE CONTROL	7 SPEED AUTOMATIC	TYRES 205/55 R16..H
WHEELS 6.5J X 16 ALU	TYRE W/FLAT RUNNING	MEASURE PACK	LOAD COMPART PACKAGE
KNEE AIRBAG	PARKTRONIC	COMPRESSOR VARIABLE	STYLE
LUGGAGE COMP COVER	TWO COAT METALLIC	PREPARE OFF VEHICLE	CLEAR COAT HARD

Not Attached
Ex TBA
Recovery B4 pain
5 days

Labour

Code	Description	Time Base 10 WU/h	Price = 42.00 SGD/h	
			WU	Price SGD
54-1011 01	SHORT TEST INCLUDES: CONNECT + DISCONNECT STAR DIAGNOSIS, PRINT DATA, DELETE ERROR MEMORY		3.0	12.60
54-7989 01	R + R BATTERY EARTH CABLE (WHEN DISCONNECTING ELECTRIC PLUG AND SOCKET CONNECTIONS)		2.0	8.40

Code	Description	WU	Price SGD
61-1018 01	R + R COMPL LWR ENGINE COMPARTMENT COVER	7.0	29.40
88-2531 ZAX	REPAIR OF R/FRONT-END DAMAGE INCLUDES: RENEW BUMPER, BONNET, RADIATOR COVER, FRONT WING AND FRONT LAMP UNIT, CONVERT ATTACHED PARTS, RENEW IF NECESSARY	28.0	117.60
88-1347 01	ADD TO RENEW FRONT BUMPER (VEHICLE WITH PARK ASSISTENT)	2.0	8.40
88-1153 01	ADDITION TO R + R FRONT BUMPER (VEHICLE WITH COLLISION WARN SYS)	1.0	4.20
88-1364 01	ADD FOR DIS + ASS FRONT BUMPER (VEHICLE WITH COLLISION WARN SYS)	1.0	4.20
88-2647 ZAX	R + R L/BONNET HINGE	3.0	12.60
88-2652 ZAX	R + R R/BONNET HINGE	3.0	12.60
60-1331 01	ATTACHED PARTS IN ENGINE COMPART R + R FOR RENEWAL OF THE FRONT MODULE INCLUDES: ALL ATTACHED PARTS IN REPAIR AREA REMOVE AND REFIT	11.0	46.20
62-1266 01	FRONT CROSS MEMBER AND BRACE BETWEEN THE WHEELHOUSES COMPLETE R + R	14.0	58.80
62-1236 01	R + R L/F CRASHBOX	1.0	4.20
62-1237 01	R + R R/F CRASHBOX	1.0	4.20
60-1234 01)	R + R RADIATOR	3.0	12.60
20-4000 02)	RENEW RADIATOR (REMOVED)	1.0	4.20
20-6461 01	R + R FAN UNIT	5.0	21.00
83-6541 ZAX	R + R CONDENSER	4.0	16.80
83-7805 ZAX	RENEW REFRIGERANT PIPE A	4.0	16.80
83-7810 ZAX	RENEW REFRIGERANT PIPE B	9.0	37.80
83-1762 01	AIR-CONDITIONING SYSTEM DRAIN FLUID, EXHAUST, REFILL, PRESSURE TEST (FOR ALL WORK ON THE SYSTEM)	6.0	25.20
82-1120 01	ADJUST HEADLAMPS	4.0	16.80
0741	L/F WING REPAIR	10 15.0*	63.00
Labour Cost		Hrs	WU
Panel / Mechanical Labour		12.80	128.0
Total of Labour			537.60

Paint

Paint Work	SYSTEM AZT	Time Basis 10 WU/h
Code	Description - TWO COAT METALLIC	WU Price SGD
	BONNET NEW PART PAINTING	21.0
	LEFT BONNET HINGE NEW PART PAINTING	5.0
	RIGHT BONNET HINGE NEW PART PAINTING	5.0
	R/F WING NEW PART PAINTING	10.0
	FRONT BUMPER COVER NEW PART PAINT K1G	23.0
	L/F CTR PARKING SENS NEW PART PAINT K1R	3.0
	L/F INNER SENSOR NEW PART PAINT K1R	3.0
	L/F WING REPAIR PAINTING <50%	11.0

Paint Material Per Part

Code	Description	Price SGD
0471	BONNET NEW PART PAINTING	66.05
0475	LEFT BONNET HINGE NEW PART PAINTING	0.52
0476	RIGHT BONNET HINGE NEW PART PAINTING	0.52
0742	R/F WING NEW PART PAINTING	20.12
0283	FRONT BUMPER COVER NEW PART PAINT K1G	74.28
0363	L/F CTR PARKING SENS NEW PART PAINT K1R	0.49
0365	L/F INNER SENSOR NEW PART PAINT K1R	0.49
0741	L/F WING REPAIR PAINTING <50%	12.60

Labour Cost - Paint

Factor	42.00 SGD/h	Hrs	WU	Price SGD
Time Paint			81.0	
Preparation Main Work Metal		2.50	25.0	105.00
Preparation Comp. Work Plastic		0.80	8.0	33.60
Total	10 WU/h	11.40	114.0	478.80

Material Cost - Paint

	Price SGD
New Part Painting	87.21
New Part Painting - Plastic K1R	0.98
New Part Painting - Plastic K1G	74.28
Repair Painting	12.60
Material-constant Metal Preparation	28.60
Material-constant Plastic	12.70
Total	216.37

Spare Parts

				prices as at 2015-06-01
Code	Description	Part Number	Part Source	Price SGD
0283	FRONT BUMPER COVER	246 880 4640 9999	Original	850.00 ✓
0287	L/F BUMPER BRACKET	246 885 1921	Original	35.00 X
0288	R/F BUMPER BRACKET	246 885 2021	Original	35.00 X
0289	L/BEARING BRKT REINF	246 885 0016	Original	30.00 X
0290	R/BEARING BRKT REINF	246 885 0116	Original	30.00 X
0305	FRONT BUMPER GRILLE	246 880 2400	Original	90.00 X
0336	FRONT IMPACT DAMPER	246 885 1037	Original	95.00 X
0340	FRT BUMPER C-MEMBER	246 885 0965	Original	120.00 X
0363	L/F CTR PARKING SENS	000 905 5504 9999	Original	160.00 X
0365	L/F INNER SENSOR	000 905 5504 9999	Original	160.00 X
0405	GRILLE	246 888 0460	Original	140.00 X
0409	FRONT GRILLE COVER	246 888 0173	Original	130.00 X
0411	L/UPPER GRILLE TRIM	246 888 1985	Original	50.00 X
0412	R/UPPER GRILLE TRIM	246 888 2085	Original	50.00 X
0413	L/LOWER GRILLE TRIM	246 888 2185	Original	50.00 X
0414	R/LOWER GRILLE TRIM	246 888 2285	Original	50.00 X
0432	STAR EMBLEM	218 817 0116	Original	55.00 X
0433	BASE PLATE	164 888 0411	Original	180.00 ✓
0471	BONNET	246 880 0057 64	Original	950.00 X
0475	LEFT BONNET HINGE	246 880 0328	Original	80.00 X
0476	RIGHT BONNET HINGE	246 880 0428	Original	80.00 X

Code	Description	Part Number	Part Source	Price SGD	
0561	LEFT HEADLAMP ASSY	246 906 3501	Original	my cm 1,600.00	✓
0562	RIGHT HEADLAMP ASSY	246 906 3601	Original	cm 1,600.00	✓
0742	R/F WING	246 881 0201	Original	R 420.00	✓
0930	CTR FRT REINF	246 620 0234 64	Original	R 650.00	✓
1001	FRONT CROSSMEMBER	246 620 1100	Original	R 230.00	✓
1007	L/F BUMP IMPACT DAMP	246 620 0195	Original	R 110.00	✓
1008	R/F BUMP IMPACT DAMP	246 620 0295	Original	cm R 110.00	✓
4465	AIR CON CONDENSER	246 500 0454	Original	sun R 680.00	✓
4481	COMPR/CONDENSER PIPE	246 830 3515	Original	sun 220.00	✓
4482	PIPE CONDEN/EXP VALV	246 830 2415	Original	sun 260.00	✓
7752	LOWER AIR GUIDE	246 505 1530	Original	sun 70.00	✓
7753	L/RADIATOR AIR GUIDE	246 505 0330	Original	sun 60.00	✓
7754	R/RADIATOR AIR GUIDE	246 505 0230	Original	sun cm 60.00	✓
7755	UPPER AIR GUIDE	246 505 1430	Original	sun cm 70.00	✓
7761	RADIATOR	246 500 1303	Original	sun 580.00	✓
7789	HEATER BLOWER	246 500 0093	Original	sun 350.00	✓

f: OEM Parts
n: Non-OEM Parts
u: Used parts

Savings	0.00
Subtotal	10,490.00
Fixed Sundry Parts Price	100.00
Total	10,590.00

Extras

Code	Description	Price SGD	
1000	ECU diagnostic ECU diagnostic	sun 150.00*	✓
1001	Electrical work Electrical work	25.00*	2 of ✓
1002	Engine coolant Engine coolant	sun 25.00*	✓
1003	Air con coolant Air con	sun 50.00*	✓
1004	Front number plate Number Plate	R 35.00*	✓
1005	Audatex fees Audatex fees	42.00*	✓
Total Extras		327.00	

LKK Auto Consultants hence notify the Repairer of the following:

- To resurvey before/after spray painting
- To display damaged part(s) during resurvey
- Parts prices are subject to confirmation
- Third party survey is on a "Without Prejudice" basis
- No illegal modification(s) is allowed
- Supplementary item(s) must be resurveyed and is subject to final approval from Insurance Company

Acknowledged by Repairer

Signature:

Date:

Final Calculation

	SGD	SGD
Parts		
Fixed Sundry Parts Price	10,490.00	
Total Parts	100.00	10,590.00
Labour Time Base 10 WU/h		
Total 128.0 WU X 42.00 SGD/h	537.60	
Total of Labour		537.60
Total Of Extras		327.00
Paint Work Time Base 10 WU/h		
Labour Cost 114.0 WU X 42.00 SGD/h	478.80	
Material Cost	216.37	
Total Paint Including Material		695.17
Repair Cost Excludes GST		12,149.77
GST (+7.0%)		850.48
Repair Cost Included GST		13,000.25

Comments

* - USER SUPPLIED DATA
NN - NO MANUFACTURERS CODE EXISTS
) - WU PARTIAL INCL IN OTHER POSITIONS

Assessment Note

No assessment notes entered.

> Back to OneMotoring

Enquire PARF/COE Rebate for Registered Vehicle

Vehicle Owner Particulars	
Owner ID Type:	Singapore NRIC
Owner ID:	364Z
Vehicle Details	
Vehicle No.:	SDW5T
Vehicle to be Exported:	Yes
Intended Deregistration Date:	07 Nov 2022
Vehicle Make:	MERCEDES BENZ
Vehicle Model:	B180 STYLE (R16 LED)
Primary Colour:	Grey
Manufacturing Year:	2016
Engine No.:	27091030921384
Chassis No.:	WDD2462422J390155
Maximum Power Output:	90.0 kW (120 bhp)
Open Market Value:	\$26,179.00
Original Registration Date:	22 Aug 2016
First Registration Date:	22 Aug 2016
Transfer Count:	1
Actual ARF Paid:	\$23,651.00
Intended PARF Rebate Details	
PARF Eligibility:	Yes
PARF Eligibility Expiry Date:	21 Aug 2026
PARF Rebate Amount:	\$15,373.00
Intended COE Rebate Details	
COE Expiry Date:	21 Aug 2026
COE Category:	A - Car up to 1600cc & 97kW (130bhp)
COE Period(Years):	10
QP Paid:	\$53,000.00
COE Rebate Amount:	\$20,074.00
Total Rebate Amount:	\$35,447.00

The information contained herein is correct as at 07 Nov 2022

OK

SINGAPORE ACCIDENT STATEMENT

IMPORTANT NOTICE

1. Please report correctly the details of the accident to speed up the claims process.
2. This Form must be completed by the Policyholder and/or the Actual Driver
3. Information provided must be as truthful and accurate as possible. Any wilful misrepresentation or withholding of material facts may allow insurance companies to repudiate policy liability.
4. The issue and acceptance of this Form by insurance companies is not an admission of policy liability on the part of the insurance companies.
5. Any false reporting may be referred to the Police for investigation.
6. This report will be forwarded by the insurers of the GIA Records Management Centre established by the General Insurance Association of Singapore (GIA) for archiving and that copies of this report will, for a fee, be made available upon application by interested parties.
7. By the lodgement of this report to the insurers, you hereby consent to the archiving of this report at the centre and to copies of the report being made available aforesaid.

ACCIDENT STATEMENT

Date of Submission	07/11/2022 16:02 (SGT)
Reported by	Driver
Date of Accident	05/11/2022 17:07 (SGT)
Exact Location of Accident	Bukit Timah Rd, Singapore
Additional Location Information	U turn from Bukit Timah Road to Dunearn Road
Country/State of Loss	Singapore

DETAILS OF OWN VEHICLE

Vehicle Registration Number	SDW5T
-----------------------------	-------

INSURED/POLICYHOLDER

Is company?	No
Name Of Registered Owner	Cheng Chee Kiow (inestate)
NRIC No	SXXXX364Z
Email Address	choo_zhan@hotmail.com
Mobile Phone No	(Phone) +65-96362933
Alternative Phone No	-

VEHICLE PARTICULARS

Manufacturer	Mercedes
Model	B180
Variant	-
Exact purpose for which vehicle was being used at time of accident	Private use
Are you claiming under your own insurance policy for repair to your vehicle?	Yes
Vehicle Category	Private car
Transmission	Auto
CC	1595

INSURANCE COMPANY

Name of Insurance Company	China Taiping Insurance (Singapore) Pte. Ltd.
Policy Number / Cover Note Number	DMPCSNA00039912103

DRIVER

Name of Driver	Choo Zhi Han
NRIC No	SXXXX875D
Date Of Birth	01/10/1988
Occupation	Indoor

Date Of Driving Pass	17/04/2015
Driving experience	7 YEARS AND 7 MONTHS
Gender	Male
Mobile Number	(Phone) +65-91798763
Alt. Phone Number	-
Email Address	choo_zhan@hotmail.com
Address	34 Watten Heights
Address complement	-
Postcode	287466
Is the driver the policyholder?	No
If No, Relationship of the Driver with the Insured	son-in-law
Does Driver Own Other Vehicles?	No
Vehicle Registration Number of Other Vehicle Owned by Driver	-
Insurance Company of Other Vehicle Owned by Driver	-

GENERAL INFORMATION OF THE ACCIDENT

Type of Accident	Collision - Head to Rear
Weather Conditions	Clear
Road Surface	Dry

OTHER INFORMATION

Was any foreign vehicle involved in the accident?	No
Number of vehicles involved in the accident	2
Was anybody injured in the Accident?	No
Was any injured conveyed to hospital by ambulance?	-
Was any other vehicle or property damaged?	Yes
Number of Passengers (Including Driver)	2
Has the driver been approached by unknown person(s) soliciting/offering accident claims assistance?	No
Translator's name	-
Translator's ID	-
Translator's phone number	-
Translator's email	-
Original language used in the statement	-

PASSENGER 1

Name	daughter
Gender	Female

DETAILS OF POLICE ACTION

Was the accident reported to the police?	No
Was notice of intended Prosecution given?	No
If yes, against whom?	-

CIRCUMSTANCES OF ACCIDENT

refer attached report.

ATTACHMENT(S)

Are accident photos available for attachment?	Yes
Was there any video captured by Car Camera?	No

DETAILS OF OTHER VEHICLE PROPERTY 1

Vehicle Registration Number	ES218E
Vehicle Manufacturer	Volkswagen
Vehicle Model	Touareg
Vehicle Variant	-

SKETCH PLAN

IMPORTANT NOTICE

1. Please report correctly the details of the accident to speed up the claims process.
2. This Form must be completed by the Policyholder and/or the Actual Driver.
3. Information provided must be as truthful and accurate as possible. Any wilful misrepresentation or withholding of material facts may allow insurance companies to impeach policy liability.
4. The issue and acceptance of this Form by insurance companies is not an admission of policy liability on the part of the insurance companies.
5. **Any false reporting may be referred to the Traffic Police Department for investigation.**
6. This report will be forwarded by the insurers to the GIA Records Management Centre established by the General Insurance Association of Singapore (GIA) for archiving and that copies of this report will for a fee be made available upon application by interested parties.
7. By the lodgement of this report to the insurers, you hereby consent to the archiving of this report at the centre and to copies of the report being made available aforesaid.

8. Consent under the Personal Data Protection Act (PDPA)

I understand, acknowledge, agree and consent that:

- (a) My insurer, my workshop and the General Insurance Association of Singapore ("GIA") may/are permitted to collect, use, disclose and/or process my personal data/personal information set out in this [form] and any other personal information provided by me or possessed by my insurer (collectively the "Personal Information") and disclose and transfer such Personal Information to all insurer(s) who have insured vehicle(s) involved in this accident (all insurer(s) who have insured vehicle(s) involved in this accident shall be collectively referred to as the "Insurers"), the Insurers' lawyers/law firms, the Monetary Authority of Singapore and any relevant government agency/authority (such as the police), for the purpose(s) of:
 - (i) processing, handling and/or dealing with my claims including the settlement of the claims and any necessary investigations relating to the claims;
 - (ii) investigating the accident and/or my claims;
 - (iii) carrying out and/or dealing with my instructions or responding to any enquiries by me;
 - (iv) administering my claims (including the mailing of correspondence, statements, invoices, reports or notices to me, which could involve disclosure of certain personal data about me to bring about delivery of the same as well as on the external cover of envelopes/mail packages); and/or
 - (v) complying with applicable law in administering, processing, handling and/or dealing with my claims.
 (collectively the "Purposes")
- (b) all insurer(s) who have insured vehicle(s) involved in this accident and the Insurers' lawyers/law firms, may/are permitted to collect, use, disclose and/or process my Personal Information for one or more of the above Purposes; and
- (c) my Personal Information may/can be disclosed by any of the Insurers and/or GIA to their third-party service providers or agents (including their lawyers/law firms), which may be sited outside of Singapore, for one or more of the above Purposes.


7 NOV 2022
2:07 PM

Policyholder's Signature / Date & Time

Driver's Signature (if driver is not the policyholder) / Date & Time

Witnessed by Reporting Centre Personnel
(Name as in NRIC ID card)

Sketch Plan

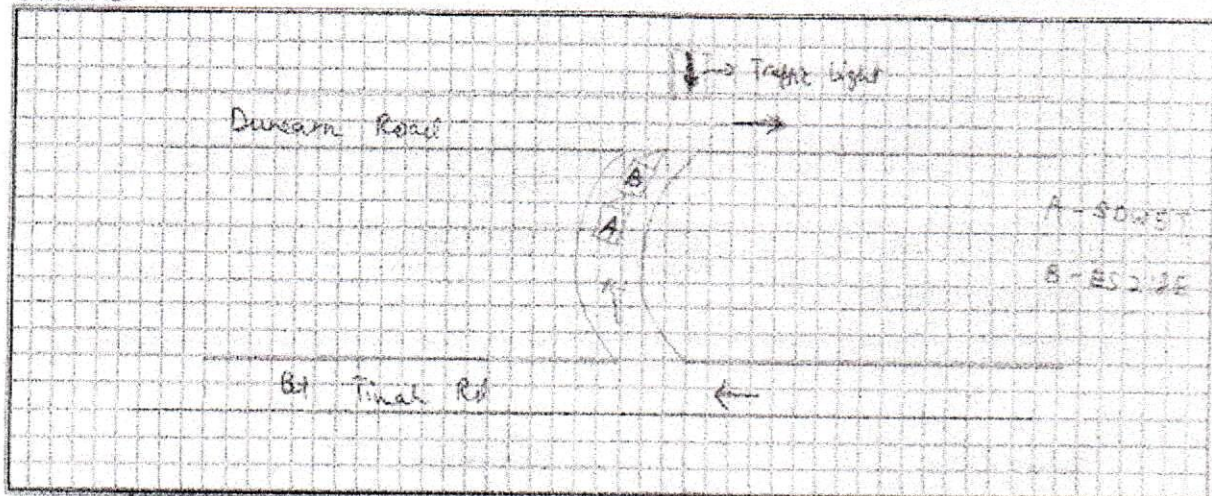

Describe Circumstance of the Accident

I WAS U-TURNING FROM BUKIT TEMAH RD TO
DUNERN RD.

THE CAR IN FRONT OF ME STARTED MOVING
WHEN THE GREEN ARROW CAME ON

HE THEN STOPPED WHICH I WAS NOT EXPECTING AND I WAS UNABLE TO STOP MY CAR IN TIME LEADING TO A COLLISION

Declaration

Declaration
We declare the foregoing particulars are true in every respect.

Policyholder's Signature / Date & Time

Driver's Signature (If driver is not the policyholder) / Date
& Time

Witnessed by Reporting Centre Personnel
(Name as in NRIC/ID card)