

ASS. REC.BY: T. G. J. M.

REF: CS/CT122011887/Twp3

**ASSIGNMENT**

WE 2028 June

From: \_\_\_\_\_ Date: \_\_\_\_\_

Estimated Cost: \_\_\_\_\_

OD / TP / MS / TP RES / OD RES / EVA / INV / MV

To Inspect Vehicle No: \_\_\_\_\_

at Workshop/s \_\_\_\_\_

of \_\_\_\_\_

Insured: \_\_\_\_\_

Policy No. \_\_\_\_\_

Claims No. \_\_\_\_\_

Sum Insured: \_\_\_\_\_ Excess: \_\_\_\_\_

(Client's Record)

Make of Veh: \_\_\_\_\_

(Policy Condition)

Remark: The veh had commenced its repair at the time of inspection.

N/S	O/S

Bal. or Market Value: 274K

IDAC Accident Report: \_\_\_\_\_ Consistent? : Yes or No

GIA / PR Seen: \_\_\_\_\_ Consistent? : Yes or No

Est. Repairs: \_\_\_\_\_ days Res.: Yes or No

Lum Sum: \_\_\_\_\_ % 3 Val.: Yes or No

CA / REV / REP. / 24 HRS

WP

Vehicle: IN / OUT

Date: \_\_\_\_\_ Person Contacted: \_\_\_\_\_

Veh No: SMX 9464E Yr Regn: 20081 July

Type: Car / M.Cycle / Bus / Van / Lorry / Taxi / Prime Mover /

Truck / Trailer or

Make: Volkswagen Golf GTI c.c. 1984

Colour: White A/C: Insured / Std / NI / NA

Sp. Reading: 365637 T/Radio: Insured / Std / NI / NA

Eng/No: \_\_\_\_\_

C/No: www 222 1K 28W 280769

Gen. Cond: Good / Fair / Poor / Burnt

Steering: In order / Jammed / Leaked / Burnt or

Brake: In order / Jammed / Leaked / Burnt or

Modi: Nil / S/Rim / STD A/Rim or

Tyre Size: F: 235/40R18

R: \_\_\_\_\_

BS / DUN / EXNOVA / GY / FS / LIZA / MIC / DHTSU / PIR / SUMI /

TOYO / YOKO or

Front

R/Bal. 6 mm

L/Bal. 6 mm

D.O.A. \_\_\_\_\_

Survey held at

Des. of Damages: Frt / Rear / O/S / N/S / U/C / Rooftop or

Rear

R/Bal. 6 mm

L/Bal. 6 mm

D.O.I. 28/11/22

At MCR Motor.

The U/C / Chassis frame / Body Structure affected due to collision.

Date / Time Action / Instruction

Date/Time, File Pass to?

☐ : Prel. Report

Days Of Repair: \_\_\_\_\_

1) \_\_\_\_\_  
Date/Time, File Return to?

☐ : Final Report

Resurvey No. of Trip: \_\_\_\_\_

2) \_\_\_\_\_

Report Format: \_\_\_\_\_

Lump Sum / L.Bk: ( )

Add Fee: ☐ : Site Insp (\$ \_\_\_\_\_)

☐ : Interview (\$ \_\_\_\_\_)

☐ : Tech. Invs (\$ \_\_\_\_\_)

☐ : Weekend (\$ \_\_\_\_\_)

Survey Fee: \_\_\_\_\_

Transportation: \_\_\_\_\_

S + RS. SI. \_\_\_\_\_

Photos \_\_\_\_\_

Others \_\_\_\_\_

TOTAL

# MCR Motors Pte Ltd

8 Kaki Bukit Ave 4 #01-49, Premier @ Kaki Bukit Singapore 415875

SJE : \_\_\_\_\_  
 Date of Survey : \_\_\_\_\_  
 Date of ReSurvey: \_\_\_\_\_  
 Contacts : \_\_\_\_\_

Vehicle Nos : **SMX 9464E**  
 Made : Volkswagen  
 Model : Golf GTI 2.0A  
 Chassis No : \_\_\_\_\_

## \* AGREED Cost Of Repair and Repair Day/s with SJE \*

Amount: \_\_\_\_\_

Working Day: \_\_\_\_\_

Nos.	PARTS	Qty	Unit S\$	TOTAL S\$
1	Rear Bumper Upper	1	\$ 1,280.00	\$ <i>de</i> 1,280.00
2	Rear Bumper Lower	1	\$ 648.00	\$ <i>de</i> 648.00
3	Rear Bumper Side Retainer RH	1	\$ 65.00	\$ <i>x</i> 65.00
4	Rear Bumper Side Retainer LH	1	\$ 65.00	\$ <i>x</i> 65.00
5	Rear Bumper Bracket RH	1	\$ 62.00	\$ <i>x</i> 62.00
6	Rear Bumper Bracket LH	1	\$ 62.00	\$ <i>x</i> 62.00
7	Rear Bumper Reflector RH	1	\$ 72.00	\$ <i>x</i> 72.00
8	Rear Bumper Reflector LH	1	\$ 72.00	\$ <i>x</i> 72.00
9	Rear Bumper Centre Guide	1	\$ 135.00	\$ <i>de</i> 135.00
10	Rear Bumper Tow Cover	1	\$ 78.00	\$ <i>x</i> 78.00
11	Rear Bumper Reinforcement	1	\$ 725.80	\$ <i>x</i> 725.80
12	Rear Bumper Lower Diffuser	1	\$ 372.10	\$ <i>de</i> 372.10
13	Rear Bumper Sensor	2	\$ 144.40	\$ <i>de</i> 577.60
14	Rear Bumper Sensor Bracket	4	\$ 39.60	\$ <i>de</i> 158.40
15	Rear Bumper Sensor O-Ring	4	\$ 1.70	\$ <i>de</i> 6.80
16	Rear Bumper Number Plate Lamp	1	\$ 39.00	\$ <i>de</i> 39.00 <i>RHX</i>
17	Rear Tailgate	1	\$ 1,930.00	\$ <i>de</i> 1,930.00
18	Rear Tailgate "GTI" Emblem	1	\$ 98.00	\$ <i>de</i> 98.00
19	Rear Tailgate Reflector Lamp RH	1	\$ 275.60	\$ <i>x</i> 275.60
20	Rear Tailgate Reflector Lamp LH	1	\$ 275.60	\$ <i>x</i> 275.60
21	Rear Tailgate Emblem	1	\$ 98.00	\$ <i>de</i> 98.00
22	Rear Tailgate Lock	1	\$ 305.00	\$ <i>x</i> 305.00
23	Rear Tailgate Lock Catch	1	\$ 110.00	\$ <i>x</i> 110.00
24	Rear Tailgate Weatherstrip	1	\$ 338.00	\$ <i>x</i> 338.00
25	Rear Tailgate Inner Trim Board	1	\$ 568.00	\$ <i>x</i> 568.00
26	Rear Taillamp Assembly RH	1	\$ 405.00	\$ <i>x</i> 405.00
27	Rear Taillamp Assembly LH	1	\$ 405.00	\$ <i>de</i> 405.00
28	Rear End Panel	1	\$ 825.00	\$ <i>de</i> 825.00
29	Rear End Panel Top Garnish	1	\$ 215.00	\$ <i>de</i> 215.00
30	Rear Spare Tyre Panel Top Board	1	\$ 252.00	\$ <i>x</i> 252.00
31	Rear Spare Tyre Panel Sponge Tools Tray	1	\$ 268.00	\$ <i>x</i> 268.00
32	Rear Fender RH	1	\$ 1,321.80	\$ <i>x</i> 1,321.80

33	Rear Fender LH	1	\$	1,321.80	\$ X	1,321.80
34	Rear Fender Inner Shield RH	1	\$	178.00	\$ X	178.00
35	Rear Fender Inner Shield LH	1	\$	178.00	\$ X	178.00
36	Rear Fender Inner Trim RH	1	\$	628.60	\$ X	628.60
37	Rear Fender Inner Trim LH	1	\$	628.60	\$ X	628.60
38	Rear Exhaust Heat Shield	1	\$	185.00	\$ X	185.00
39	Rear Exhaust Mounting	4	\$	35.00	\$ X	140.00

Parts Sub Total :	\$	15,407.70
10% Discount	\$	1,540.77
<b>PARTS TOTAL :</b>	<b>\$</b>	<b>13,866.93</b>

Nos.	SPECIAL NETT	Qty	Unit S\$	TOTAL S\$
1	Rear Number Plate	1	\$	50.00 \$ 40-30 50.00
2	Rear Bumper Clips - Set	1	\$	50.00 \$ 40-30 50.00
3	Rear Tailgate Inner Trim Clips - Set	1	\$	40.00 \$ X 40.00
4	Rear End Panel Top Garnish Clips - Set	1	\$	30.00 \$ 20-30 30.00
5	Rear Fender Inner Trim Clips - Set	1	\$	80.00 \$ X 80.00
6	Rear Fender Inner Shield Clips - Set	1	\$	60.00 \$ X 60.00
7	Rear Tailgate Windscreen Glass Sealant	1	\$	120.00 \$ 60-120 120.00
8	Rear Tailgate Sealant	1	\$	150.00 \$ X 150.00
9	Rear End Panel Sealant	1	\$	150.00 \$ 40 150.00
10	Rear Fender Sealant	2	\$	150.00 \$ X 300.00
11	Rear Bumper Reverse Camera	1	\$	550.00 \$ X 550.00
<b>SPECIAL NETT TOTAL :</b>				<b>\$ 1,580.00</b>

Nos.	LABOUR	S\$
1	To Panel Beat, Remove & Refix Parts	\$ 600 1,600.00
2	To Spray Paint Affected Areas	\$ 600 1,600.00
3	Wiring & Bulb Check	\$ 30 100.00
4	To Transfer Rear Tailgate Mechanism	\$ 60 150.00
5	To Remove & Refix Rear Tailgate Windscreen Glass	\$ 120 150.00
6	To Remove & Refix Rear Bumper Reverse Camera	\$ 30 150.00
7	To Remove & Refix Rear Bumper Reverse Sensor	\$ 30 120.00
8	To Remove & Refix Rear Exhaust Pipe	\$ X 150.00
9	To Remove & Refix Interior Upholstry to facilitate repairs	\$ 60 120.00
10	To apply anti rust on affected parts	\$ 30 120.00
11	To Send for Diagnostic and Reset Control Unit. Programming & Calibration	\$ X 480.00
12	To Conduct Water Leak Test	\$ X 100.00
<b>LABOUR TOTAL :</b>		<b>\$ 4,840.00</b>

PARTS TOTAL :	\$	13,866.93
SPECIAL NETT TOTAL :	\$	1,580.00
LABOUR TOTAL :	\$	4,840.00
<b>GRAND TOTAL :</b>	<b>\$</b>	<b>20,286.93</b>

LKK Auto Consultants hence notify the Repairer of the following:

- To resurvey before/after spray painting
- To display damaged part(s) during resurvey
- Parts prices are subject to confirmation
- Third party survey is on a "Without Prejudice" basis
- No illegal modification(s) is allowed
- Supplementary item(s) must be resurveyed and is subject to final approval from Insurance Company

Act as a repairer

Signature

Date

Tanji 9749 5749/6256 3561  
 WP 28/11/22 @ 2:15 pm  
 4/5 Resurvey after repair  
 Tanji C/LH auto-con

5 days  
 - To check consistency of accident  
 - To check part prices



Date of Accident : 24/11/22 Accident Time: 12340 (24-HR-FORMAT)  
Accident Place : Woodlands Ave 2  
Vehicle Reg. No (Car plate No.) : SMX 464 E CC: 2000 Vehicle Make/Model: Volvo S60 2.0  
Insurance Company : Allianz Policy No. \_\_\_\_\_  
Name of Registered Owner : Company / Individual Gilbert matheus de silva  
ID of Registered Owner : Co Reg No: \_\_\_\_\_ Owner's NRIC No: S14809240  
OWNER EMAIL ADDRESS: Shannandfab@gmail.com : Co Contact No: \_\_\_\_\_ Owner's Contact No: 9258 5920  
DRIVER'S Name : De silva Shannon Gilbert DRIVER'S NRIC No: T01136260  
DRIVER'S Date of Birth : 6/5/01 DRIVER'S License Pass Date 1/2/21  
Relationship bet. Owner & Driver : Spouse \ Parents \ Children \ Sibling \ Employee \ Others: \_\_\_\_\_  
DRIVER'S Address : 133 Edgefield Plains #18-42 SC820133  
DRIVER'S Contact No./ Alt No. : 1) 9025 2481 2) \_\_\_\_\_  
DRIVER'S Occupation : INDOOR \ OUTDOOR (eg. working inside or outside of an ofc)  
Email Address : shannandfab@gmail.com  
Weather & Road Surface : CLEAR & DRY \ RAINING & WET \ AFTER RAIN & WET  
Reporting Type : Reporting Only \ Claim Other Party \ Claim Own Insurance  
Number of Passengers (including Driver): 3 Name & Gender: Pahua Arumugam Male / Ajith Jeremiah Rudy Male  
Was the accident reported to the police? YES \ NO  
Was there any video Captured by car camera: YES \ NO  
Exact purpose for which vehicle was being used at the time of accident: Private use \ Work purpose  
Any injuries, if yes (name of the injured person) ALL

Other Party Driver's Particulars (if any)

Vehicle Reg No: <u>SLR 8682 S</u>	Vehicle Reg No: <u>SLT 30360</u>
Vehicle Make/Model: _____	Vehicle Make/Model: _____
Name DRIVER: _____	Name DRIVER: _____
IC No. DRIVER: _____	IC No. DRIVER: _____
DRIVER'S Contact & add: _____	DRIVER'S Contact & add: _____

REPORT FORM EXPLAINED IN : ENGLISH / CHINESE / MALAY / TAMIL OTHERS: \_\_\_\_\_

WHO REPORTED THE ACCIDENT : OWNER / DRIVER / BOTH

## SKETCH PLAN

### IMPORTANT NOTICE

1. Please report correctly the details of the accident to speed up the claims process.
2. This Form must be completed by the Policyholder and/or the Actual Driver.
3. Information provided must be as truthful and accurate as possible. Any wilful misrepresentation or withholding of material facts may allow insurance companies to repudiate policy liability.
4. The issue and acceptance of this Form by insurance companies is not an admission of policy liability on the part of the insurance companies.
5. Any false reporting may be referred to the Traffic Police Department for investigation.
6. This report will be forwarded by the insurers to the GIA Records Management Centre established by the General Insurance Association of Singapore (GIA) for archiving and that copies of this report will for a fee be made available upon application by interested parties.
7. By the lodgement of this report to the insurers, you hereby consent to the archiving of this report at the centre and to copies of the report being made available aforesaid.

### 8. Consent under the Personal Data Protection Act (PDPA)

I understand, acknowledge, agree and consent that:

(a) My insurer, my workshop and the General Insurance Association of Singapore ("GIA") may/are permitted to collect, use, disclose and/or process my personal data/personal information set out in this [form] and any other personal information provided by me or possessed by my insurer (collectively the "Personal Information") and disclose and transfer such Personal Information to all insurer(s) who have insured vehicle(s) involved in this accident (all insurer(s) who have insured vehicle(s) involved in this accident shall be collectively referred to as the "Insurers"), the Insurers' lawyers/law firms, the Monetary Authority of Singapore and any relevant government agency/authority (such as the police), for the purpose(s) of:

(i) processing, handling and/or dealing with my claims including the settlement of the claims and any necessary investigations relating to the claims;

(ii) investigating the accident and/or my claims;

(iii) carrying out and/or dealing with my instructions or responding to any enquiries by me;

(iv) administering my claims (including the mailing of correspondence, statements, invoices, reports or notices to me, which could involve disclosure of certain personal data about me to bring about delivery of the same as well as on the external cover of envelopes/mail packages); and/or

(v) complying with applicable law in administering, processing, handling and/or dealing with my claims.

(collectively the "Purposes")

(b) all insurer(s) who have insured vehicle(s) involved in this accident and the Insurers' lawyers/law firms, may/are permitted to collect, use, disclose and/or process my Personal Information for one or more of the above Purposes; and

(c) my Personal Information may/can be disclosed by any of the Insurers and/or GIA to their third-party service providers or agents (including their lawyers/law firms), which may be sited outside of Singapore, for one or more of the above Purposes.

*OS*


Policyholder's Signature / Date & Time

*Samman*

Driver's Signature (if driver is not the policyholder) / Date & Time

Witnessed by Reporting Centre Personnel  
(Name as in NRIC/ID card)

### Sketch Plan

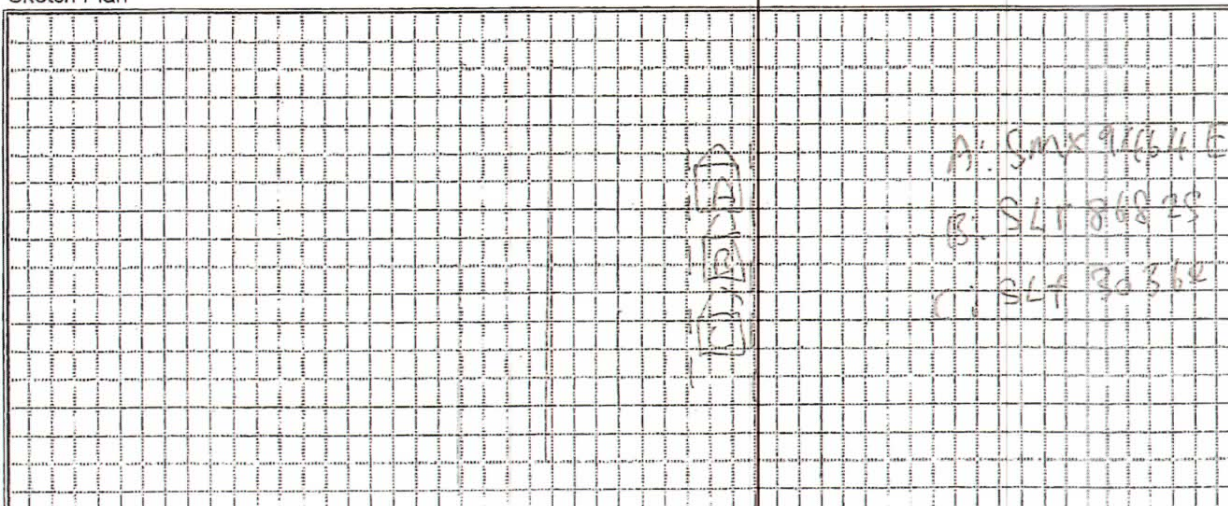
--

The sketch plan area contains a large grid. On the right side of the grid, there are handwritten notes in blue ink:

- A: SMK 9134 E
- B: SLT 8487S
- C: SLT 30362

There are also some small diagrams or symbols drawn on the grid, including what looks like a car or vehicle outline.



Describe Circumstance of the Accident


my car was stationary. suddenly, i felt a huge impact from the rear. i got down & realised 3 vehicles was involved.

Declaration

I/We declare the foregoing particulars are true in every respect.



Policyholder's Signature / Date & Time

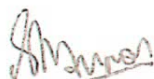

Driver's Signature (if driver is not the policyholder) / Date

Witnessed by Reporting Centre Personnel

> Back to OneMotoring

## Enquire PARF/COE Rebate for Registered Vehicle

### Vehicle Owner Particulars

Owner ID Type: Singapore NRIC  
Owner ID: 924D

### Vehicle Details

Vehicle No.: SMX9464E  
Vehicle to be Exported: Yes  
Intended Deregistration Date: 25 Nov 2022  
Vehicle Make: VOLKSWAGEN  
Vehicle Model: GOLF GTI 2.0 A  
Primary Colour: White  
Manufacturing Year: 2008  
Engine No.: BWA227907  
Chassis No.: WVVWZZZ1KZ8W280769  
Maximum Power Output: 147.0 kW (197 bhp)  
Open Market Value: \$23,086.00  
Original Registration Date: 01 Jul 2008  
First Registration Date: 01 Jul 2008  
Transfer Count: 3  
Actual ARF Paid: \$23,086.00

### Intended PARF Rebate Details

PARF Eligibility: Forfeited  
PARF Eligibility Expiry Date: -  
PARF Rebate Amount: \$0.00

### Intended COE Rebate Details

COE Expiry Date: 30 Jun 2028  
COE Category: B - Car (1601cc & above)  
COE Period(Years): 10  
PQP Paid: \$37,906.00  
COE Rebate Amount: \$21,216.00  
**Total Rebate Amount: \$21,216.00**

The information contained herein is correct as at 24 Nov 2022

OK

MV: \$ 74K.