

ASSIGNMENT

From: _____ Date: _____

Estimated Cost: _____

OD / TP / WS / TP RES / OD RES / EVA / INV / MV

To Inspect Vehicle No: _____

at Workshop m/s _____

of _____

Insured: _____

Policy No. _____

Claims No. _____

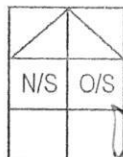
Sum Insured: _____

Excess: _____

(Client's Record)

Make of Veh: _____

(Policy Condition)

Remark: The veh had commenced its
repair at the time of inspection.

Bal. or Market Value: _____

\$115,000

IDAC Accident Rpt: _____

Consistent? : Yes or No

GIA / PR Seen: _____

Consistent? : Yes or No

Est. Repairs: _____

5

days

Res.: Yes or No

Lum Sum: _____

%

3 Val.: Yes or No

CA / REV / REP. / 24 HRS

Date: _____

Person Contacted: _____

Vehicle: IN / OUT

Veh No: SMK4244B A Yr Regn: 10/4/2019Type: M. Car / M. Cycle / Bus / Van / Lorry / Taxi / Prime Mover /

Truck / Trailer or

Make: M/Benz GLA 180C.C. 1595Colour White

A/C: Insured / Std / NI / NA

Sp. Reading 70464

T/Radio: Insured / Std / NI / NA

Eng/No: _____

C/No: WDC1569422J601464

Gen. Cond: Good / Fair / Poor / Burnt

Steering: Inorder / Jammed / Leaked / Burnt or

Brake: Inorder / Jammed / Leaked / Burnt or

Modi: Nil / S/Rim / STD A/Rim orTyre Size: F: 235/50 R18

R: _____

BS / DUN / EXNOVA / GY / FS / LIZA / MIC / OHTSU / PIR / SUMI /

TOYO / YOKO or

Continental

Front

Rear

R/Bal. 5 mmR/Bal. 5 mmL/Bal. 6 mmL/Bal. 6 mm

D.O.A. _____

D.O.I. 7/12/2022Survey held at DesktopDes. of Damages: Frt / Rear / O/S / N/S / U/C / Rooftop or

The U/C / Chassis frame / Body Structure affected due to collision.

Date / Time Action / Instruction

N.V. \$76,984.

Date/Time, File Pass to?

Date/Time, File Return to?

1)

2)

3)

4)

5)

6)

Prel. Report:

Final Report:

Part Prices Check:

IN

OUT

Survey Fee:

Date:

Basic & Add.

___ S + RS, ___ SI

Photos

Others

TOTAL

INSURER: **Allianz Insurance Singapore Pte. Ltd. (HQ)**

PARTICULARS OF CLAIM

Claim Type:	OD (Own Damage)	Ref. No:	M6928
Policy No:	SP2001491346	Date of Loss:	24/11/2022
Vehicle Reg. No.:	SMK4244B A	Driveable?	YES
Driver Age/Info:		Party At Fault:	UNKNOWN
TP Injury Involved?	NO	Third Party Involved?	YES
Insured/Claimant:	GEORDON ONG TA YONG		
Make/Model:	MERCEDES-BENZ GLA200, 1.6 URBAN (R18 LED) (A) 180	Vehicle Reg. Date:	10/04/2019
Vehicle Colour:	Metallic Pearl White	Gen Condition:	Fair
Engine No:	27091031837393	Chassis No:	WDC1569422J601464
Odometer:	69837 KM		
Paint Type:	Metallic 2K		
Total Loss?	NO		
Est. Duration of Repair (day)	5		
Present Location:	AUTO INSURE PTE LTD (HQ) (WOODLANDS)		

COST OF CLAIMS

	Amount
Parts	8,173.00
Miscellaneous Items	0.00
Labour	1,500.00
Paintwork Labour	800.00
Towing	0.00
Calculated Gross Total (S\$)	10,473.00
- Excess (S\$)	800.00
(S\$)	9,673.00
+ GST 7.00% (S\$)	677.11
Nett Amount (S\$)	10,350.11

This claim is handled by: **MARVYN CHUA HONG LENG**

REPAIR DETAILS

Reference

Part Source: MRM-SG **Version:** 1.0 (Last Synchronised: 08 Dec 2022)

Parts: M1-SUV **MERCEDES-BENZ GLA200 1.6 URBAN (R18 LED) (A)** (Catalogue:Merimen Singapore 1.0)

Labour: Repairer's (Price-denominated Standard List)

Print Code: Auto Insure Pte Ltd (HQ)/SMK4244B/08/12/2022 10:15

Validity: These estimates are valid only if they contain the print code (above) on all estimate pages, running page numbers with the END OF ESTIMATES marker on the last estimate page

Further Info: Items/values not in reference catalogue are prefixed with an asterisk *.

Estimates on Parts

No.	Qty	Part No.	Particulars	%Disc	%Depr	Amount
1	1		*REAR DOOR RH — BUC	0.00	0.00	*1,635.00 F
2	1		*REAR DOOR HINGE LOWER RH }?	0.00	0.00	*200.00 F
3	1		*REAR DOOR HINGE UPPER RH }	0.00	0.00	*200.00 F
4	1		*REAR FENDER RH X R	0.00	0.00	*2,185.00 F
5	1		*REAR WHEEL ARCH GARNISH RH CUT	0.00	0.00	*200.00 F
6	1		*REAR BUMPER X R	0.00	0.00	*1,060.00 F
7	1		*REAR BUMPER SIDE RETAINER RH ?	0.00	0.00	*30.00 F
8	1		*REAR WHEEL RIM RH — CUT	0.00	0.00	*830.00 F
9	1		*REAR LOWER CONTROL ARM RH ?	0.00	0.00	*75.00 F
10	1		*REAR DOOR HANDLE RH X R	0.00	0.00	*370.00 F
11	1		*REAR WHEEL HUB RH	0.00	0.00	*330.00 F
12	1		*REAR WHEEL BEARING RH }	0.00	0.00	-
13	1		*REAR CAMBER STRUT RH }	0.00	0.00	*115.00 F
14	1		*REAR UPPER CONTROL ARM RH }	0.00	0.00	*200.00 F

F=Franchise part.

Sub Total (S\$)	7,430.00
+ Margin on L,N Items 10.00% (S\$)	743.00
Total Parts (S\$)	8,173.00

Auto Insure Pte Ltd (HQ)/SMK4244B/08/12/2022 10:15. Not valid without Reference section.
Generated using Merimen e-Claims IEAS

Estimates on Miscellaneous Items

There are no new miscellaneous items selected.

Estimates on Labour

No	Particulars	Lab.Type	Amount
<u>Paintwork Labour</u>			
1	LABOUR FOR SPRAY PAINTING	New	800.00
<u>Labour Items</u>			
2	LABOUR FOR PANEL BEATING	New	1,000.00
3	LABOUR TO REMOVE & REFIT REAR DOOR MECHANISM RH	New	200.00
4	LABOUR TO REMOVE AND REFIT REAR SUSPENSION RH	New	200.00
5	LABOUR FOR ANALIGNMENT & BALANCING	New	100.00
Gross Labour Cost (S\$)			2,300.00

Auto Insure Pte Ltd (HQ)/SMK4244B/08/12/2022 10:15. Not valid without Reference section.

Generated using Merimen e-Claims IEAS

< END OF ESTIMATES >

P/P or L/S ?

P/P

5 days

> Back to OneMotoring

D.O.A. = 24/11/2022
Bal. = 6 yrs 4.5 mths
M.V. = \$115,000

Enquire PARF/COE Rebate for Registered Vehicle

Vehicle Owner Particulars	
Owner ID Type:	Singapore NRIC
Owner ID:	297H
Vehicle Details	
Vehicle No.:	SMK4244A
Vehicle to be Exported:	No
Intended Deregistration Date:	09 Dec 2022
Vehicle Make:	MERCEDES BENZ
Vehicle Model:	GLA180 URBAN (R18 LED)
Primary Colour:	White
Manufacturing Year:	2018
Engine No.:	27091031837393
Chassis No.:	WDC1569422J601464
Maximum Power Output:	90.0 kW (120 bhp)
Open Market Value:	\$27,705.00
Original Registration Date:	10 Apr 2019
First Registration Date:	10 Apr 2019
Transfer Count:	0
Actual ARF Paid:	\$30,787.00
Intended PARF Rebate Details	
PARF Eligibility:	Yes
PARF Eligibility Expiry Date:	09 Apr 2029
PARF Rebate Amount:	\$23,090.00
Intended COE Rebate Details	
COE Expiry Date:	09 Apr 2029
COE Category:	A - Car up to 1600cc & 97kW (130bhp)
COE Period(Years):	10
QP Paid:	\$23,568.00
COE Rebate Amount:	\$14,926.00
Total Rebate Amount:	\$38,016.00

The information contained herein is correct as at 07 Dec 2022

OK

16,000