

A.S. P.C. BY:

REF:

CC4/AIS 22012486/D³

ASSIGNMENT

From: _____ Date: _____

Estimated Cost: _____

OD / TP / WS / TP RES / OD RES / EVA / INV / MV

To inspect Vehicle No: _____

at Workshop m/s _____

of _____

Insured: _____

Policy No. _____

Claims No. _____


Sum Insured: _____ Excess: _____

(Client's Record)

Make of Veh: _____

(Policy Condition)

Remark: The veh had commenced its repair at the time of inspection.

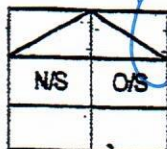

Bel. or Market Value: _____

IDAC Accident Report: _____ Consistent?: Yes or No

GIA / PR Seen: _____ Consistent?: Yes or No

Est. Repairs: 88 days Res.: Yes or NoLum Sum: 20 % 3 Val.: Yes or No

CA / REV / REP. / 24 HRS

Date: _____ Person Contacted: _____ Vehicle: IN / OUT

Veh No: SHA 27024 Yr Regn: Oct / 2017

Type: M.Car / M.Cycle / Bus / Van / Lorry / Taxi / Prime Mover /

Truck / Trailer or

Make: Toyota Prius c.c. 1798Colour: Blue A/C: Insured / Std / NI / NASp. Reading: 624147 T/Radio: Insured / Std / NI / NAEng/No: 2ZR3080195C/No: JTDKB3FU803568820

Gen. Cond: Good / Fair / Poor / Burnt

Steering: Inorder / Jammed / Leaked / Burnt or

Brake: Inorder / Jammed / Leaked / Burnt or

Mod: Nil / S/Rim / STD A/Rim or

Tyre Size: F: 195/65 R15R: 11

BS / DUN / EXNOVA / GY / FS / LIZA / MIC / OHTSU / PIR / SUMI /

TOYO / YOKO or

Front

R/Bal: S mmL/Bal: S mmD.O.A. 12/12/2022Survey held at Biggest sin Ming

Des. of Damages: Frt / Rear / O/S / N/S / U/C / Rooftop or

0/3 Rmt

The U/C / Chassis frame / Body Structure affected due to collision.

Date / Time Action / Instruction

Allianz SJA 1161M06/06/23 frank 2/S 9,000/- with 8 days of rep

Date/Time, File Pass to?

☐: Prel. Report

Days Of Repair: _____

1)

☐: Final Report

Resurvey No. of Trip: _____

Date/Time, File Return to?

2)

Add Fee: ☐: Site Insp (\$ _____)☐: Interview (\$ _____)☐: Tech. Invs (\$ _____)

Survey Fee: _____

Transportation: _____

S + RS \$ _____

Photos _____

Others _____

Report Format: _____

I certify that I am a member of the

BIFROST AUTO PTE LTD

REPAIR ESTIMATE

DATE: 13-Dec-22

MODEL: TOYOTA PRIUS

INSURANCE:

VEHICLE NO.: SHA 2702U

DESCRIPTION	QTY	LIST PRICE	AMOUNT
Rocker Panel Outer Garnish HH broken o/s	1	\$576.00	\$576.00
Rocker Panel Outer Garnish Clip HH	1	\$65.00	\$65.00
BONNET HH	1	\$1,117.93	\$1,117.93
RADIATOR GRILLE HH	1	\$438.00	\$438.00
RADIATOR GRILLE EMBLEM HH	1	\$88.00	\$88.00
FRONT BUMPER COVER torn	1	\$591.75	\$591.75
LAMP ASSY, FOG, RH destroyed	1	\$920.00	\$920.00
FRONT BUMPER SIDE RETAINER broken o/s	1	\$77.00	\$77.00
FRONT UNDER COVER HH	1	\$180.80	\$180.80
ENGINE UNDER COVER (RR) HH	1	\$457.40	\$457.40
ENGINE UNDER COVER CENTER HH	1	\$523.40	\$523.40
COVER, FRONT BUMPER HOLE, RH HH	1	\$28.38	\$28.38
UNIT ASSY, HEADLAMP, RH (LED) missing broken	1	\$3,455.00	\$3,455.00
HEAD LAMP PANEL (RH) HH	1	\$240.10	\$240.10
TOP PANEL SIDE HH	1	\$145.90	\$145.90
FENDER SUB-ASSY, FRONT RH Damaged	1	\$1,111.93	\$1,111.93
FRONT HOUSING ASSY HH	1	\$958.30	\$958.30
FRONT FENDER SHIELD torn	1	\$255.00	\$255.00
FRONT FENDER SHIELD CLIP HH	1	\$14.90	\$14.90
BRACKET, FRONT SIDE PANEL, RH HH	1	\$86.30	\$86.30
EXTENSION, FRONT FENDER, RH HH	1	\$47.20	\$47.20
PROTECTOR, FRONT FENDER SIDE PANEL, RH HH	1	\$113.90	\$113.90
SEAL, FRONT FENDER TO COWL SIDE, RH HH	1	\$15.20	\$15.20
GUSSET, FRONT FENDER APRON, LOWER RH HH	1	\$34.90	\$34.90
EXTENSION, FRONT FENDER APRON, FRONT RH HH	1	\$23.20	\$23.20
MEMBER, FRONT APRON TO COWL SIDE, UPPER RH HH	1	\$138.40	\$138.40
FRONT APRON TO COWL SIDE, LOWER FRT RH HH	1	\$82.30	\$82.30
FRONT WHEEL RIM cut / broken	1	\$1,570.55	\$1,570.55
FRONT WHEEL RIM CAP HF	1	\$189.60	\$189.60
FRONT WHEEL HUB AND BEARING Damaged o/s	1	\$763.80	\$763.80
FRONT SUSPENSION LOWER ARM (RH) destroyed	1	\$637.50	\$637.50
FRONT SHOCK ABSORBER (RH) destroyed	1	\$401.80	\$401.80
ABSORBER TOP MOUNTING HH	1	\$196.20	\$196.20
FRONT DRIVE SHAFT (RH) HH	1	\$1,764.00	\$1,764.00
RACK & PINION ASSY HH destroyed	1	\$1,634.90	\$1,634.90
BAR, STABILIZER HH	1	\$360.00	\$360.00
KNUCKLE, STEERING, RH destroyed	1	\$580.80	\$580.80
JOINT ASSY, LOWER BALL, FRONT (RH) destroyed	1	\$199.98	\$199.98
DISC, FRONT HH	1	\$1,570.00	\$1,570.00
END SUB-ASSY, TIE ROD, RH destroyed	1	\$159.30	\$159.30
SENSOR, SPEED, FRONT RH HH	1	\$446.50	\$446.50

BIFROST AUTO PTE LTD

SUPPLEMENTARY

DATE: 12-Dec-22

INSURANCE: Allianz

MODEL: TOYOTA PRIUS

VEHICLE NO.: SHA 2702 U (S)

DESCRIPTION	QTY	LIST PRICE	AMOUNT
FRONT BUMPER LOWER GRILLE <i>monny broken</i>	1	\$193.18	\$193.18
HEADLAMP ECU LH <i>monny broken</i>	1	\$682.60	\$682.60
WIPER SPARE TANK ASSY <i>defunct.</i>	1	\$486.70	\$486.70
SUB TOTAL			\$1,362.48
LESS 20% <i>25%</i>			\$272.50
DISCOUNTED TOTAL			\$1,089.98
ESTIMATE TOTAL			\$1,089.98
This is an initial estimate based on a visual inspection of the above vehicle. The final repair quantum will be prepared after the vehicle is surveyed by a motor Surveyor appointed by the insurance company. Please send your book value request to: claims_itr@bifrostauto.com			

1362.48

1021.86

ym

2kk

8

Customer:	LIM TAN	Date:	12/14/2022 5:11 PM
Company:	01-42	VIN	
License NO:	SHA 2702U	Technician:	
Odometer:		Order NO:	

VEHICLE ALIGNMENT REPORT
TOYOTA, PRIUS PHV ZVW52, 17-17 (Customized)

Primary Angles			Initial	Specifications		Final
				Min.	Max.	
Front	Caster	Left	5°09'	6°35'	8°05'	5°24'
		Right	4°55'	6°35'	8°05'	5°00'
	Camber	Left	-0°36'	-0°55'	0°35'	-0°36'
		Right	-2°30'	-0°55'	0°35'	-2°24'
	Toe	Left	-0°12'	-0°03'	0°08'	0°18'
		Right	0°06'	-0°03'	0°08'	-0°21'
Total		-0°06'	-0°05'	0°16'	-0°03'	
Rear	Camber	Left	-1°18'	-2°00'	-0°30'	-1°18'
		Right	-1°42'	-2°00'	-0°30'	-1°48'
	Toe	Left	0°18'	0°03'	0°14'	0°18'
		Right	0°03'	0°03'	0°14'	0°00'
		Total	0°21'	0°05'	0°27'	0°18'
	Thrust Angle		0°08'	----		0°09'
Secondary Angles			Initial	Specifications		Final
				Min.	Max.	
SAI		Left	11°38'	13°20'	13°20'	11°38'
		Right	12°11'	13°20'	13°20'	12°11'
Included Angle		Left	11°02'	----	----	11°02'
		Right	9°41'	----	----	9°47'
Toe Out On Turns		Left	----	----	----	----
		Right	----	----	----	----
Max Turn Inside		Left	----	----	----	----
		Right	----	----	----	----
Toe Curve Change		Left	----	----	----	----
		Right	----	----	----	----
Setback		Front	4mm	----	----	4mm
		Rear	-0mm	----	----	-0mm
Track Width Diff.			9mm			9mm
Wheel Base Diff.			4mm			4mm
Front Ride Height		Left	----	----	----	----
		Right	----	----	----	----
Rear Ride Height		Left	----	----	----	----
		Right	----	----	----	----
Frame Angle						----

ONE STOP AUTOMOTIVE SOLUTION

> Back to OneMotoring

Enquire PARF/COE Rebate for Registered Vehicle

Vehicle Owner Particulars	
Owner ID Type:	Company
Owner ID:	821R
Vehicle Details	
Vehicle No.:	SHA2702U
Vehicle to be Exported:	Yes
Intended Deregistration Date:	31 Dec 2022
Vehicle Make:	TOYOTA
Vehicle Model:	PRIUS HYBRID 1.8 CVT
Primary Colour:	Blue
Manufacturing Year:	2017
Engine No.:	2ZRS080195
Chassis No.:	JTDKB3FU803568820
Maximum Power Output:	90.0 kW (120 bhp)
Open Market Value:	\$29,007.00
Original Registration Date:	06 Oct 2017
First Registration Date:	06 Oct 2017
Transfer Count:	0
Actual ARF Paid:	\$5,000.00
Intended PARF Rebate Details	
PARF Eligibility:	Yes
PARF Eligibility Expiry Date:	05 Oct 2025
PARF Rebate Amount:	\$3,500.00
Intended COE Rebate Details	
COE Expiry Date:	05 Oct 2025
COE Category:	A - Car up to 1600cc & 97kW (130bhp)
COE Period(Years):	8
PQP Paid:	\$34,052.00
COE Rebate Amount:	\$11,762.00
Total Rebate Amount:	\$15,262.00
Message	
Please note that the 8-year COE for this vehicle cannot be further renewed. The vehicle must be de-registered upon COE expiry or when the vehicle reaches its statutory lifespan (if applicable), whichever is earlier.	

The information contained herein is correct as at 13 Dec 2022

OK