

ASS. REC. BY:

REF:

CPC/

Kenneth

ASSIGNMENT

From:

Date:

Estimated Cost:

OD / TP / WS / TP RES / OD RES / EVA / INV / MV

To Inspect Vehicle No:

at Workshop m/s

of

Insured:

Policy No.

Claims No.

Sum Insured:


Excess:

(Client's Record)

Make of Veh:

(Policy Condition)

Remark: The veh had commenced its
repair at the time of inspection.

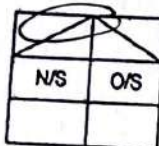

Bal. or Market Value:

\$54k

IDAC Accident Report:

Consistent? : Yes or No

GIA / PR Seen:

Consistent? : Yes or No

Est. Repairs:

09 days

Res.: Yes or No

Lum Sum:

20 %

3 Val.: Yes or No

CA / REV / REP. / 24 HRS

Date:

Person Contacted:

Vehicle: IN / OUT

Date / Time

Action / Instruction

Veh No:

SKX 1568R

Yr Regn:

11, 15

Type: M. Car / M. Cycle / Bus / Van / Lorry / Taxi / Prime Mover /

Truck / Trailer or

Make:

Audi

A3

TFSI

C.C

Colour

White

A/C:

Insured / Std / NI / NA

Sp. Reading

91058

T/Radio: Insured / Std / NI / NA

Eng/No:

C/No:

WAAU 8888VOG-A060606

Gen. Cond: Good / Fair / Poor / Burnt

Steering: In order / Jammed / Leaked / Burnt or

Brake: In order / Jammed / Leaked / Burnt or

Mod: N/A / S/Rlm / STD / Rlm or

Tyre Size:

F:

MIC 205/55R16

CONFIDENTIAL

BS / DUN / EXNOVA / GY / FS / LIZA / MTC / OHTSU / PIR / SUMI /

TOYO / YOKO or

Front

R/Bal.

8

mm

Rear

R/Bal.

7

mm

L/Bal.

8

mm

L/Bal.

7

mm

D.O.A.

10/12/22

D.O.I.

15/12/2022

Survey held at

Des. of Damages: Frt / Rear / O/S / N/S / UIC / Rooftop or

The UIC / Chassis frame / Body Structure affected due to collision.

Date/Time, File Pass to?



: Prell. Report



: Final Report

Date/Time, File Return to?

Days Of Repair:

Resurvey No. of Trip:

Survey Fee:

Transportation:

S - RS. SI

F. P. S.

Others

Add Fee:



: Site Insp (\$



: Interview (\$



: Tech Invs (\$



: Weekend (\$

TOTAL

Report Format:

mp Sum / I.B.I. (\$

Not Authored
Ex 8600

11/12/22

Sherry After Paint

9 days



The Motor Claims Department
M/s Lonpac Insurance Bhd
100 Beach Road
#19-00 Shaw Tower
Singapore 189702

File No :

SH/2022/330/12/014/OD

Date :

15-December-2022

Estimated cost of repair for vehicle no : SKX1568R Audi A3
Policy no: Z22VP05032269 Accident Date: 10.12.2022

Description	Quantity	Cost Price
Bonnet	1	\$ 1,200.00 ✓
RH Bonnet hinge	1	\$ 40.00 X
LH Bonnet hinge	1	\$ 40.00 ?
RH bonnet lock	1	\$ 90.00 ?
LH bonnet lock	1	\$ 90.00 ?
Bonnet front rubber seal	1	\$ 18.00 ?
RH head lamp	1	\$ 1,350.00 ?
LH head lamp	1	\$ 1,350.00 ✓
LH front fender	1	\$ 400.00 —
LH front fender wheel cowling	1	\$ 90.00 —
LH front fender wheel cowling clips (1 set)	1	\$ 15.00 —
Front grille	1	\$ 380.00 ✓
Front grille inner panel	1	\$ 30.00 ✓
Front bumper	1	\$ 850.00 ✓
Front bumper sponge	1	\$ 50.00 —
Front bumper reinforcement	1	\$ 380.00 ✓
Front bumper tow cover	1	\$ 30.00 X
RH Front bumper fog lamp cover with chrome	1	\$ 70.00 —
LH Front bumper fog lamp cover with chrome	1	\$ 70.00 —
Front bumper bottom dust cover	1	\$ 160.00 ✓
RH Front bumper retainer	1	\$ 45.00 X
LH Front bumper retainer	1	\$ 45.00 ✓
RH Front bumper bracket	1	\$ 70.00 X
LH Front bumper bracket	1	\$ 70.00 ✓
LH Front bumper headlamp washer jet	1	\$ 110.00 —
LH Front bumper headlamp washer jet cover	1	\$ 30.00 —
Front support panel	1	\$ 400.00 ?
Front support panel top air duct	1	\$ 45.00 ?
Front support panel top air duct upper cover	1	\$ 30.00 ?
Air con condensor	1	\$ 450.00 ?
RH Air con condensor air guide	1	\$ 20.00 X
LH Air con condensor air guide	1	\$ 20.00 ✓
Radiator	1	\$ 450.00 ?
Radiator auto fan	1	\$ 650.00 ?
Radiator auto fan cowling	1	\$ 160.00 ?
Auxiliary Radiator	1	\$ 350.00 ?

Horn	1	\$	90.00 X	
Wiper water tank	1	\$	110.00	✓
Steering wheel air bag	1	\$	1,850.00	✓
Steering wheel clock spring	1	\$	480.00	✓
RH driver knee airbag	1	\$	1,250.00	✓
LH front air bag	1	\$	1,950.00	✓
Dashboard	1	\$	2,200.00	✓
Air bag ECU	1	\$	950.00	✓
Air bag sensor x 2	2	\$	500.00	✓
RH front seat belt	1	\$	550.00	✓
LH front seat belt	1	\$	550.00	?
RH front seat belt buckle	1	\$	200.00	?
LH front seat belt buckle	1	\$	200.00	?
		\$	20,528.00	
		\$	3,079.20	
		\$	23,607.20	

Front number plate	1	S. nett	\$	45.00	✓
Engine coolant	1	S. nett	\$	30.00	?

To remove and check air con condenser, dryer, aluminium pipes, valves and reinstall components and vacuum and charge refrigerant R134a and check for leakage and full functionality

\$ 120.00 100%

To remove front damaged parts, to jack out front support panel, front body, and cut out damaged parts, to straighten out front chassis, to reweld, reshape and repair bonnet hinge panel, front fender and inner panel, head lamp inner panel, front support panel, front chassis member, to replace damaged parts and adjust body panel alignment

\$ 900.00 600%

To remove and install dashboard and centre console, including instrument panel, centre info screen, radio, climate control module. To remove & install RH/LH air bags, RH front knee iarbag, clockspring, and air bag ECU

\$ 400.00 250%

To spray paint affected front and inner damaged portion inclusive of preparatory works and material

\$ 950.00 800%

To disconnect wire harness to facilitate repairs and check for damage and reconnect wiring system and check for full functionality

\$ 50.00 20%

To reprogram air bag ECU and clear fault codes.

\$ 380.00 200%

the Repairer of the following:	\$	50.00	20%
• To resurvey before/after spray painting			
• To display damaged part(s) during resurvey	\$	380.00	200%
• Parts prices are subject to confirmation			
• Third party survey is on a "Without Prejudice" basis			
• No illegal modification(s) is allowed	\$	26,482.20	
• Supplementary item(s) must be resurveyed and is subject to final approval from Insurance Company			

Acknowledged by Repairer
Page 2 of 2

SINGAPORE ACCIDENT STATEMENT

IMPORTANT NOTICE

1. Please report correctly the details of the accident to speed up the claims process.
2. This Form must be completed by the Policyholder and/or the Actual Driver
3. Information provided must be as truthful and accurate as possible. Any wilful misrepresentation or withholding of material facts may allow insurance companies to repudiate policy liability.
4. The issue and acceptance of this Form by insurance companies is not an admission of policy liability on the part of the insurance companies.
5. Any false reporting may be referred to the Police for investigation.
6. This report will be forwarded by the insurers of the GIA Records Management Centre established by the General Insurance Association of Singapore (GIA) for archiving and that copies of this report will, for a fee, be made available upon application by interested parties.
7. By the lodgement of this report to the insurers, you hereby consent to the archiving of this report at the centre and to copies of the report being made available aforesaid.

ACCIDENT STATEMENT

Date of Submission 12/12/2022 12:02 (SGT)
Reported by Driver
Date of Accident 10/12/2022 11:25 (SGT)
Exact Location of Accident Hougang Ave 10, Singapore
Additional Location Information Hougang Ave 10 & Hougang Ave 4 junction towards Hougang Ave 2
Country/State of Loss Singapore

DETAILS OF OWN VEHICLE

Vehicle Registration Number SKX1568R

INSURED/POLICYHOLDER

Is company? No
Name Of Registered Owner Lim Cheow Tee
NRIC No SXXXX779C
Email Address tonylimzu@gmail.com
Mobile Phone No (Phone) +65-96680447
Alternative Phone No -

VEHICLE PARTICULARS

Manufacturer Audi
Model A3
Variant -
Exact purpose for which vehicle was being used at time of accident Private use
Are you claiming under your own insurance policy for repair to your vehicle? Yes
Vehicle Category Private car
Transmission Auto
CC 1400

INSURANCE COMPANY

Name of Insurance Company Lonpac Insurance Bhd
Policy Number / Cover Note Number Z22VP05032269

DRIVER

Name of Driver Lim Wen Xi Alvin
NRIC No SXXXX837F
Date Of Birth 07/12/1993

IMPORTANT NOTICE

1. Please report correctly the details of the accident to speed up the claims process.

2. This Form must be completed by the Policyholder and/or the Actual Driver.

3. Information provided must be as truthful and accurate as possible. Any wilful misrepresentation or withholding of material facts may allow insurance companies to repudiate policy liability.

4. The issue and acceptance of this Form by insurance companies is not an admission of policy liability on the part of the insurance companies.

5. Any false reporting may be referred to the Traffic Police Department for investigation.

6. This report will be forwarded by the Insurers to the GIA Records Management Centre established by the General Insurance Association of Singapore (GIA) for archiving and that copies of this report will for a fee be made available upon application by interested parties.

7. By the lodgement of this report to the insurers, you hereby consent to the archiving of this report at the centre and to copies of the report being made available aforesaid.

B. Consent under the Personal Data Protection Act (PDPA)

I understand, acknowledge, agree and consent that:

(a) My insurer, my workshop and the General Insurance Association of Singapore ("GIA") may/are permitted to collect, use, disclose and/or process my personal data/personal information set out in this form and any other personal information provided by me or possessed by my insurer (collectively the "Personal Information") and disclose and transfer such Personal Information to all insurer(s) who have insured vehicle(s) involved in this accident (all insurer(s) who have insured vehicle(s) involved in this accident shall be collectively referred to as the "Insurers"), the Insurers' lawyers/law firms, the Monetary Authority of Singapore and any relevant government agency/authority (such as the police), for the purpose(s) of:

(i) processing, handling and/or dealing with my claims including the settlement of the claims and any necessary investigations relating to the claims;

(ii) investigating the accident and/or my claims;

(iii) carrying out and/or dealing with my instructions or responding to any enquiries by me;

(iv) administering my claims (including the mailing of correspondence, statements, invoices, reports or notices to me, which could involve disclosure of certain personal data about me to bring about delivery of the same as well as on the external cover of envelopes/mail packages); and/or

(v) complying with applicable law in administering, processing, handling and/or dealing with my claims.

(collectively the "Purposes")

(b) all insurer(s) who have insured vehicle(s) involved in this accident and the Insurers' lawyers/law firms, may/are permitted to collect, use, disclose and/or process my Personal Information for one or more of the above Purposes; and


(c) my Personal Information may/can be disclosed by any of the Insurers and/or GIA to their third-party service providers or agents (including their lawyers/law firms), which may be sited outside of Singapore, for one or more of the above Purposes.

[Signature]
Policyholder's Signature / Date & Time

[Signature]
Driver's Signature (if driver is not the policyholder) / Date & Time

[Signature]
Witnessed by Reporting Centre Personnel
(Name as in NRIC/ID card)

Sketch Plan

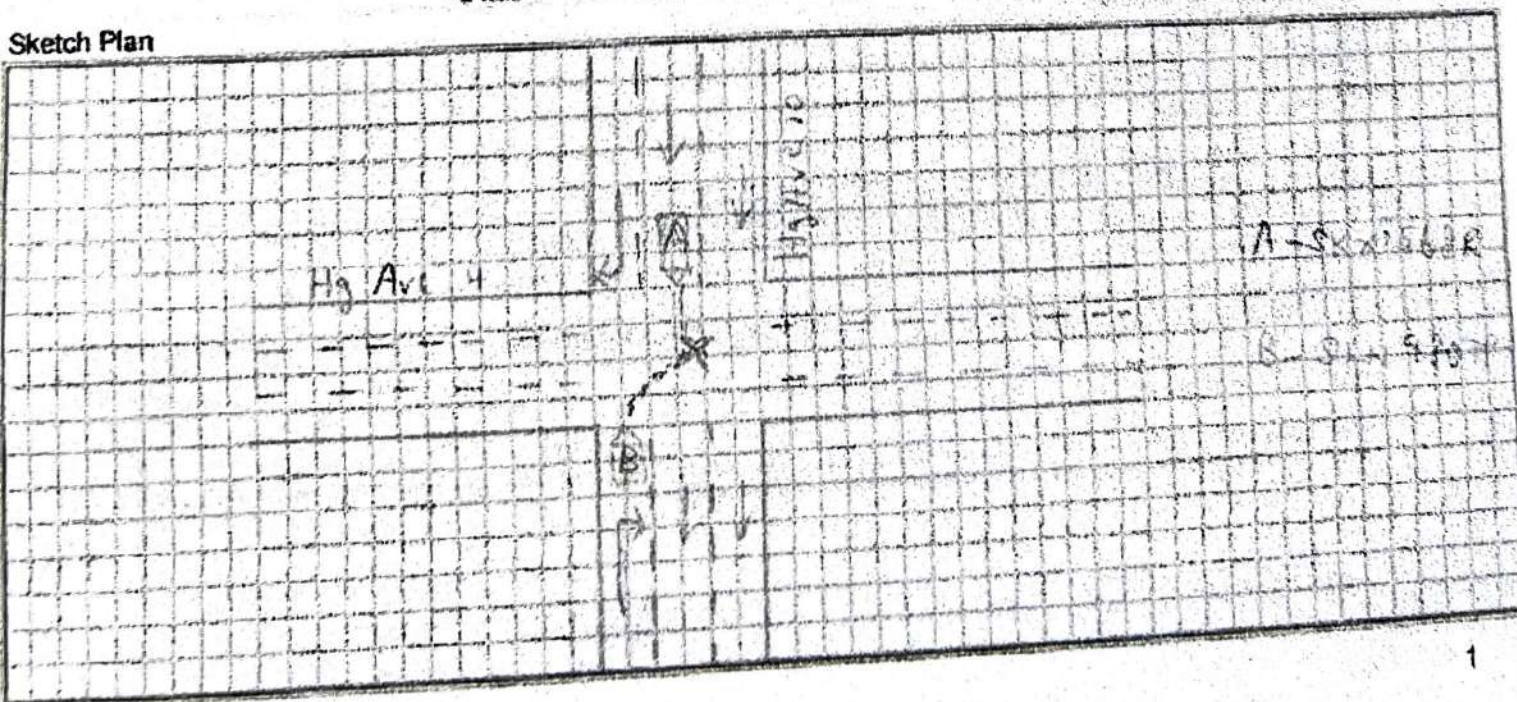

Back to OneMotoring

Enquire PARF/COE Rebate for Registered Vehicle

Vehicle Owner Particulars

Owner ID Type:

Owner ID:

Vehicle Details

Vehicle No.:

Vehicle to be Exported:

Intended Deregistration Date:

Vehicle Make:

Vehicle Model:

Primary Colour:

Manufacturing Year:

Engine No.:

Chassis No.:

Maximum Power Output:

Open Market Value:

Original Registration Date:

First Registration Date:

Transfer Count:

Actual ARF Paid:

Intended PARF Rebate Details

PARF Eligibility:

PARF Eligibility Expiry Date:

PARF Rebate Amount:

Intended COE Rebate Details

COE Expiry Date:

COE Category:

COE Period(Years):

QP Paid:

COE Rebate Amount:

Total Rebate Amount:

Singapore NRIC

779C

SKX1568R

Yes

12 Dec 2022

AUDI

A3 SB 1.4 TFSI (AMBIENTE)

White

2015

CZC298594

WAUZZZ8V0GA060606

92.0 kW (123 bhp)

\$26,944.00

27 Nov 2015

27 Nov 2015

0

\$19,722.00

Yes

26 Nov 2025

\$11,833.00

26 Nov 2025

A - Car up to 1600cc & 97kW (130bhp)

10

\$56,001.00

\$16,551.00

\$28,384.00

The information contained herein is correct as at 12 Dec 2022

OK