

ASS. REC. BY:

REF: SMO/22012867/KVKennerh

ASSIGNMENT

From: _____

Date: _____

Estimated Cost: _____

OD/TP/WS/TP RES/OD RES/EVA/INV/MV

To inspect Vehicle No: _____

at Workshop m/s _____

of _____

Insured: _____

Policy No. _____

Claims No. _____

Sum Insured: _____

Excess: _____

(Client's Record)

Make of Veh: _____

(Policy Condition)

Remark: The veh had commenced its
repair at the time of inspection.Bal. or Market Value: 8127K

IDAC Accident Report: _____

Consistent? : Yes or No

GIA / PR Seen: _____

Consistent? : Yes or No

Est. Repairs: 04 days

Res.: Yes or No

Lum Sum: 1.81 %

3 Val.: Yes or No

CA / REV / REP. / 24 HRS

Date: _____

Person Contacted: _____

Vehicle: IN / OUT

Date / Time

Action / Instruction

Veh No: SKM 1258TYr Regn: 03, 8Type: M. Car / M. Cycle / Bus / Van / Lorry / Taxi / Prime Mover /

Truck / Trailer or

Make: Lexus ES250c.c. 2494Colour: M. Grey

A/C: Insured / Std / NI / NA

Sp. Reading: 91152

T/Radio: Insured / Std / NI / NA

Eng/No: _____

C/No: JTHBJ1GG902107632Gen. Cond: Good / Fair / Poor / BurntSteering: In order / Jammed / Leaked / Burnt orBrake: In order / Jammed / Leaked / Burnt or

Modi: Nil / S/Rlm / STD / A/Rlm or

Tyre Size: F: 215/55R17

R: _____

BS / DUN / EXNOVA / GY / FS / LIZA / MIC / OHTSU / PIR / SUMI /

TOYO / YOKO or

Front

Rear

R/Bal. 5 mmR/Bal. 4 mmL/Bal. 5 mmL/Bal. 4 mmD.O.A. 22/10/22D.O.I. 29/12/2022

Survey held at _____

Des. of Damages: Front / Rear / O/S / N/S / U/C / Rooftop or

The U/C / Chassis frame / Body Structure affected due to collision.

Date/Time, File Pass to?

☐

: Prel. Report

1)

☐

: Final Report

Date/Time, File Return to?

2)

Days Of Repair: _____

Resurvey No. of Trip: _____

Survey Fee: _____

Transportation: _____

Add Fee: ☐

: Site Insp (\$ _____)

S + RS. \$ _____

☐

: Interview (\$ _____)

F. + RS. \$ _____

☐

: Tech Invs (\$ _____)

: Others \$ _____

☐

: Weekend (\$ _____)

TOTAL

Report Format :

Lump Sum / I.B.I: (\$ _____)

AH LIM MOTOR COMPANY

No. 10 Ang Mo Kio Ind. Park 2A #01-09 AMK Autopoint Singapore 568047
TEL: 6483 1244 (4 lines) FAX: 6483 6170 Email: ahlmmc@singnet.com.sg
GST:M9-0009639-E RCB NO:06470300B

SURVEYOR COPY

M/S : SOMPO INSURANCE SINGAPORE PTE LTD
50 RAFFLES PLACE
#03-03 SINGAPORE LAND TOWER
SINGAPORE 048623
TEL: 64616555
ATTN: Motor Claim Department

Estimate No: MC1903227
Date: 27 Dec 2022
Policy No: D22MTPV01002783
Veh Reg No: SKM1258T
Make/Model: LEXUS ES250
EXECUTIVE A/T

Your Ref No: SKM1258T
Claim Type: Own Damage
Accident Date: 22/12/2022

291.2

11-2 Not with air
Repair B4 pain
4 days

Estimate Repair Cost to Vehicle No : SKM1258T

Description	U/Price	Quantity	Cost	Amount
			<u>S\$</u>	<u>S\$</u>
SPARE PARTS				
1 FRONT BONNET		1 PC	75.00	X
2 RADIATOR GRILLE BASE		1 PC	460.00	—
3 RADIATOR GRILLE CLIPS		2 PC	3.00	—
4 RADIATOR GRILLE BUSH		2 PC	16.00	?
5 RADIATOR GRILLE CHROME MLDG		1 PC	165.00	—
6 RADIATOR GRILLE EMBLEM	(0.0)	1 PC	200.00	X X
7 RADIATOR GRILLE TOP RUBBER		1 PC	50.00	?
8 FRONT BUMPER		1 PC	380.00	—
9 FRONT BUMPER SIDE RETAINER LH & RH	also 1	2 PC	80.00	4
10 FRONT BUMPER LOWER GRILLE		1 PC	310.00	?
11 FRONT BUMPER LOWER GRILLE TOW COVER	nsp	1 PC	40.00	X X
12 FRONT BUMPER LOWER GRILLE HOLE COVER LH & RH	also 1	2 PC	50.00	4
13 FRONT BUMPER NO PLATE GARNISH	cm	1 PC	60.00	X
14 FRONT BUMPER SPONGE		1 PC	70.00	2
15 FRONT BUMPER REINFORCEMENT	cls mycom	1 PC	200.00	2
16 HEADLAMP ASSY LH & RH	also 7	2 PC	3,500.00	4
17 FOGLAMP LH & RH		2 PC	200.00	X
18 FOGLAMP COVER LH & RH		2 PC	120.00	X
19 FOGLAMP BKT LH & RH - CHECK PRICE		2 PC	0.0000	X
20 PARKING SENSOR CTR LH & RH		2 PC	310.00	?
21 PARKING SENSOR CTR CLIPS		2 PC	30.00	?
22 PARKING SENSOR CORNER LH & RH		2 PC	310.00	X
23 PARKING SENSOR CORNER CLIPS		2 PC	16.00	X
24 HORN LH & RH		2 PC	106.00	X
25 AIR CON CONDENSER ASSY		1 PC	770.00	?
26 RADIATOR ASSY		1 PC	750.00	?
27 RADIATOR FAN BLADE LH		1 PC	120.00	X
28 RADIATOR FAN BLADE RH		1 PC	150.00	X
29 RADIATOR FAN MOTOR LH		1 PC	180.00	X
30 RADIATOR FAN MOTOR RH		1 PC	265.00	X
31 RADIATOR FAN COWLING		1 PC	145.00	X
32 RADIATOR SPARE TANK		1 PC	105.00	X
33 RADIATOR SUPPORT PANEL		1 PC	570.00	?
34 RADIATOR SUPPORT PANEL TOP COVER		1 PC	130.00	✓
35 RADIATOR SUPPORT PANEL TOP COVER CLIPS		9 PC	13.50	✓
36 BRACE PANEL		1 PC	100.00	?
37 AIR GUIDE LH & RH		2 PC	160.00	?
38 AIR DUCT		1 PC	145.00	X
39 BATTERY TOP BKT		1 PC	50.00	X

Zila
Ah Lim Motor Company

AH LIM MOTOR COMPANY

No. 10 Ang Mo Kio Ind. Park 2A #01-09 AMK Autopoint Singapore 568047
TEL: 6483 1244 (4 lines) FAX: 6483 6170 Email: ahlimmc@singnet.com.sg
GST:M9-0009639-E RCB NO:06470300B

M/S : SOMPO INSURANCE SINGAPORE PTE LTD
50 RAFFLES PLACE
#03-03 SINGAPORE LAND TOWER
SINGAPORE 048623
TEL: 64616555
ATTN: Motor Claim Department

Your Ref No: SKM1258T
Claim Type: Own Damage
Accident Date: 22/12/2022

SURVEYOR COPY

Estimate No: MCI903227
Date: 27 Dec 2022
Policy No: D22MTPV01002783
Veh Reg No: SKM1258T
Make/Model: LEXUS ES250
EXECUTIVE A/T

Estimate Repair Cost to Vehicle No : SKM1258T

Description	U/Price	Quantity	Cost	Amount
40 FRONT FENDER COWLING LH & RH			<u>S\$</u>	<u>S\$</u>
41 FRONT FENDER COWLING CLIPS		2 PC <i>su</i>	290.00 X	
		12 PC <i>in</i>	18.00 X	
			10,712.50	
	Add 10%		1,071.25	11,783.75

Special Nett

42 NUMBER PLATE	(G.D) 1 PC <i>B</i>	35.00 X	
43 RADIATOR COOLANT	1 PC	30.00 7	
44 BATTERY - CHECK PRICE	1 PC <i>B</i>	0.0000 X	
			65.00

LABOUR

45 TO DISCONNECT AND CHECK ELECTRICAL WIRING, WIRE SOCKETS AND ETC. TO REMOVE AND REINSTALL DAMAGED ELECTRICAL UNITS, TEST AND RECTIFY FOR PROPER FUNCTIONING.	1 PC	40.00 <i>20</i>	
46 TO REMOVE AND REPLACE A/C CONDENSER AND PIPES, RADIATOR AND HOSES, VACUUM A/C SYSTEM AS WELL AS REFILL A/C GAS.	1 PC	100.00 7	
47 TO REMOVE AND REINSTALL/REPLACE FRONT/REAR BUMPER SENSORS.	1 PC	60.00 ✓	
48 TO DISMANTLE ALL DAMAGED PARTS. TO CUT & WELD RADIATOR SUPPORT PANEL. TO KNOCK & REPAIR FRONT BONNET, FRONT FENDER LH & RH INNER PANELS AND AFFECTED AREAS. TO REFIT LISTED PARTS BACK SAME.	1 PC	800.00 <i>400</i>	
49 TO SPRAY FRONT BONNET, FRONT BUMPER, RADIATOR SUPPORT PANEL, FRT FENDER LH & RH.	1 PC	1,000.00 <i>600</i>	
			2,000.00

LKK Auto Consultants hence notify the Repairer of the following:

- To resurvey before/after spray painting
- To display damaged part(s) during resurvey
- Parts prices are subject to confirmation
- Third party survey is on a "Without Prejudice" basis
- No illegal modification(s) is allowed
- Supplementary item(s) must be resurveyed and is subject to final approval from Insurance Company

Acknowledged by Repairer

Signature:

Date:

Zila
Ah Lim Motor Company

Back to OneMotoring

Inquire PARF/COE Rebate for Registered Vehicle

Vehicle Owner Particulars

Owner ID Type:

Owner ID:

Vehicle Details

Vehicle No.:

Vehicle to be Exported:

Intended Deregistration Date:

Vehicle Make:

Vehicle Model:

Primary Colour:

Manufacturing Year:

Engine No.:

Chassis No.:

Maximum Power Output:

Open Market Value:

Original Registration Date:

First Registration Date:

Transfer Count:

Actual ARF Paid:

Intended PARF Rebate Details

PARF Eligibility:

PARF Eligibility Expiry Date:

PARF Rebate Amount:

Intended COE Rebate Details

COE Expiry Date:

COE Category:

COE Period(Years):

QP Paid:

COE Rebate Amount:

Total Rebate Amount:

Singapore NRIC

627H

SKM1258T

No

23 Dec 2022

TOYOTA

LEXUS ES250 EXECUTIVE A/T S/R

Silver

2017

2ARF551663

JTHBJ1GG902107632

135.0 kW (181 bhp)

\$36,195.00

22 Mar 2018

22 Mar 2018

0

\$42,673.00

Yes

21 Mar 2028

\$32,004.00

21 Mar 2028

E - Open - all except motorcycle

10

\$38,801.00

\$20,333.00

\$52,337.00

The information contained herein is correct as at 23 Dec 2022

OK

SINGAPORE ACCIDENT STATEMENT

IMPORTANT NOTICE

1. Please report correctly the details of the accident to speed up the claims process.
2. This Form must be completed by the Policyholder and/or the Actual Driver.
3. Information provided must be as truthful and accurate as possible. Any wilful misrepresentation or withholding of material facts may allow insurance companies to repudiate policy liability.
4. The issue and acceptance of this Form by insurance companies is not an admission of policy liability on the part of the insurance companies.
5. Any false reporting may be referred to the Police for investigation.
6. This report will be forwarded by the insurers of the GIA Records Management Centre established by the General Insurance Association of Singapore (GIA) for archiving and that copies of this report will, for a fee, be made available upon application by interested parties.
7. By the lodgement of this report to the insurers, you hereby consent to the archiving of this report at the centre and to copies of the report being made available aforesaid.

ACCIDENT STATEMENT

Date of Submission	23/12/2022 17:32 (SGT)
Reported by	Both
Date of Accident	22/12/2022 15:05 (SGT)
Exact Location of Accident	Keng Lee Rd, Singapore
Additional Location Information	-
Country/State of Loss	Singapore

DETAILS OF OWN VEHICLE

Vehicle Registration Number	SKM1258T
INSURED/POLICYHOLDER	
Is company?	No
Name Of Registered Owner	SAMUEL LIM MING CHUN (LIN MINGJUN)
NRIC No	SXXXX627H
Email Address	SLIMROARLITTLE@GMAIL.COM
Mobile Phone No	(Phone) +65-96496457
Alternative Phone No	-

VEHICLE PARTICULARS

Manufacturer	Lexus
Model	Es250
Variant	LEXUS ES250 EXECUTIVE A/T S/R
Exact purpose for which vehicle was being used at time of accident	Private use
Are you claiming under your own insurance policy for repair to your vehicle?	Yes
Vehicle Category	Private car
Transmission	Auto
CC	2494

INSURANCE COMPANY

Name of Insurance Company	Sompo Insurance Singapore Pte. Ltd.
Policy Number / Cover Note Number	D22MTPV01002783

DRIVER

Name of Driver	SAMUEL LIM MING CHUN (LIN MINGJUN)
NRIC No	SXXXX627H
Date Of Birth	22/07/1972
Occupation	Indoor

Date of accident: 22/12/22

My Vehicle A: SKM12587

Time: 3:05pm


Location: Keng Lee Road

SKETCH PLAN

Vehicle B:

SLL5653C

Vehicle C:

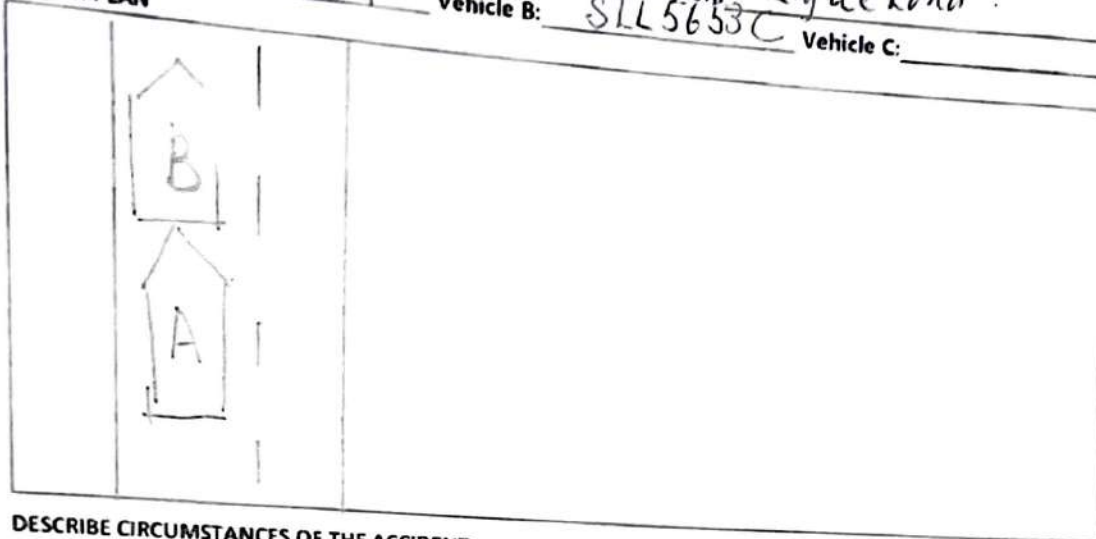

DESCRIBE CIRCUMSTANCES OF THE ACCIDENT

On 22nd Dec 2022, I was driving & at 3:09pm, as I moved my vehicle A, vehicle B jammed break due to the traffic. I tried to break in time but still hit onto vehicle B. No one was injured. We exchanged phone numbers.

☒ Claim OD/TP at Ah Lim Motor ☐ Claim OD/TP at other workshop ☐ Reporting Only

Remarks: Please forward a copy of my efile accident report to:

My workshop :

Email address :

& myself :

Email address :

Note: Please take note that your insurer have 14 days timeframe for you to submit own damage claim under you own policy. Kindly check with your own insurer for more information.

DECLARATION

I/We declare the foregoing particulars are true in every respect.

Policyholder's Signature
Date & Time:

Driver's Signature
(If driver is not the policyholder)
Date & Time:

Reporting Centre Personnel's Signature
Name:
NRIC/FIN No.:

Zila
Ah Lim Motor Company