

ASS. REC. BY:

REF:

LIP / 22013042/Kg

Kenneth

## ASSIGNMENT

From:

Date:

Estimated Cost:

OD / TP / WS / TP RES / OD RES / EVA / INV / MV

To Inspect Vehicle No:

at Workshop m/s

of

Insured:

Policy No.

Claims No.

Sum Insured:

Excess:

(Client's Record)

Make of Veh:

(Policy Condition)

Remark: The veh had commenced its  
repair at the time of inspection.

Bal. or Market Value:

IDAC Accident Report:

Consistent? : Yes or No

GIA / PR Seen:

Consistent? : Yes or No

Est. Repairs:

16 days

Res.: Yes or No

Lum Sum:

20 %

3 Val.: Yes or No

CA / REV / REP. / 24 HRS

Date:

Person Contacted:

Vehicle: IN / OUT

Date / Time

Action / Instruction

Veh No:

ED 1166T

Yr Regn:

12, 19

Type: M.Car / M.Cycle / Bus / Van / Lorry / Taxi / Prime Mover /

Truck / Trailer or

Make:

Mw GLA 180

c.c

1595

Colour

M. Grey

A/C:

Insured / Std / NI / NA

Sp. Reading

60741

T/Radio:

Insured / Std / NI / NA

Eng/No:

C/No:

WDC1569422J651449

Gen. Cond: Good / Fair / Poor / Burnt

Steering: Inorder / Jammed / Leaked / Burnt or

Brake: Inorder / Jammed / Leaked / Burnt or

Mod: NII / S/Rim / STD A/Rim or

Tyre Size:

F:

R:

235/50R18

BS / DUN / EXNOVA / GY / FS / LIZA / MIC / OHTSU / PIR / SUMI /

TOYO / YOKO or

Continental

Front

Rear

R/Bal.

6 mm

R/Bal.

6 mm

L/Bal.

6 mm

L/Bal.

6 mm

D.O.A.

23/11/22

D.O.I.

30/12/2022

Survey held at

Des. of Damages: Frt / Rear / O/S / N/S / UIC / Rooftop or

N/S Rear body

The UIC / Chassis frame / Body Structure affected due to collision.

Date/Time, File Pass to?

☐

Prell. Report

☐

Final Report

Date/Time, File Return to?

Days Of Repair:

Resurvey No. of Trip:

Survey Fee:

Add Fee:

☐

Site Insp (\$

☐

Interview (\$

☐

Tech Invs (\$

☐

Weekend (\$

Transportation

S - RS. SI

F. P. S.

Others

Report Format:

mp Sum / I.B.I: (\$

# Meng Whee Bros Motor Service

BLK 10 ANG MO KIO IND PARK 2A #05-25

AMK AUTOPOINT SINGAPORE 568047

TEL: 64846330 FAX: 64846331

Not Authorized  
11 Day &  
Manny After Paint  
16 days

M/S: \_\_\_\_\_

INVOICE NO : Q525222311

DATE : 25/11/2022

## Estimate

Vehicle No: ED1166T

QTY	DESCRIPTION		UNIT PRICE	AMOUNT	
1	Rear boot Tailgate	R	\$2,280.00	\$2,280.00	✓
1	Rear boot lamp	R	\$580.00	\$580.00	✓
1	Rear boot Tailgate emblem (GLA180)	R	\$180.00	\$180.00	✓
1	Rear boot Tailgate logo	R	\$140.00	\$140.00	✓
1	Rearboot tailgate windscreen moulding	R	\$260.00	\$260.00	✓
1	Rear boot tailgate roof spoiler	CM	\$980.00	\$980.00	✓
1	Rear boot tailgate side moulding lh	R	\$320.00	\$320.00	✓
1	collision prevention control unit		\$2,800.00	\$2,800.00	?
1	Traction control unit		\$2,650.00	\$2,650.00	?
1	Tail lamp	R	\$680.00	\$680.00	✓
1	Rear fender LH	R	\$1,220.00	\$1,220.00	✓
1	Rear inner fender LH	R	\$2,650.00	\$2,650.00	X
1	Rear inner fender garnish	R	\$590.00	\$590.00	X
1	Rear fender arc moulding	R	\$320.00	\$320.00	✓
1	Roof panel	R	\$2,800.00	\$2,800.00	X
1	Taillamp panel LH		\$220.00	\$220.00	?
1	Rear end panel	R	\$880.00	\$880.00	X
1	Rear fender glass moulding	R	\$120.00	\$120.00	X
1	Rear bumper	CM	\$1,850.00	\$1,850.00	✓
2	Rear bumper retainer	R	\$90.00	\$180.00	X
1	Rear bumper side wheel arc moulding	R	\$280.00	\$280.00	X
10	Rear bumper clips	R	\$6.00	\$60.00	✓
1	Front door	R	\$2,600.00	\$2,600.00	✓
1	Rear door	R	\$2,200.00	\$2,200.00	✓
1	Rear door board	R	\$1,200.00	\$1,200.00	X
1	Rear door outer top moulding	R	\$380.00	\$380.00	✓
1	Rear door outer moulding	R	\$320.00	\$320.00	✓
1	Rear door lock	R	\$520.00	\$520.00	X
1	Rear door sticker	R	\$60.00	\$60.00	✓
1	Rear door wheatherstrips	R	\$480.00	\$480.00	30/12
1	Rear door top wheatherstrips		\$420.00	\$420.00	?
1	Rear door lock latch	R	\$330.00	\$330.00	X
1	Rear door outer handle	R	\$480.00	\$480.00	✓
1	Rear door glass	CM	\$380.00	\$380.00	✓
1	Rear door quarter glass	CM	\$480.00	\$480.00	✓
1	Rear door quarter glass rubber moulding	R	\$380.00	\$380.00	✓



1	Rear door glass channel rubber		\$450.00	\$450.00	?
1	Rear door glass channel		\$380.00	\$380.00	?
1	Rear door regulator	PL	\$780.00	\$780.00	X
1	Run board garnish lh	PL	\$780.00	\$780.00	X
1	Rear shock absorber	PL	\$480.00	\$480.00	X
1	Rear wheel bearing	PL	\$620.00	\$620.00	X
1	Rear wheel speed sensor	PL	\$320.00	\$320.00	X
1	Rear knurler arm	PL	\$1,380.00	\$1,380.00	X
1	Fuel tank cover	CM	\$380.00	\$380.00	✓
1	Fuel tank inner garnish	CM	\$520.00	\$520.00	✓
1	Fuel tank lock		\$380.00	\$380.00	?
1	Rear fuel tank inlet pipe	PL	\$390.00	\$390.00	X
1	Roof rack	PL	\$420.00	\$420.00	✓
3	Sealant for rear windscreen glass	PL	\$75.00	\$225.00	401
	Wheel alignment 4wheel	PL		\$180.00	X
	Chassis aligner			\$400.00	?
	To remove and refix rear windscreen glass			\$140.00	1201
	To remove and refix rear door glass			\$120.00	601
	To clean up and cushion cleaning			\$300.00	501
	To remove ,refix,cut and weld rear bumper,rear end panel rear fender ,inner panel etc and straighten rear chassis frame etc.			\$2,200.00	15001
	To remove and refix fuel tank			\$400.00	801
	To remove and refix rear undercarriage,supension,axle etc	PL		\$420.00	X
	To transfer rear tailage mechanism, motor etc			\$220.00	601
	To trasfer rear door mechanism etc			\$180.00	601
	To apply putty,primer and respray damaged section			\$2,200.00	15001
	To rewire and checking and rear wiring system			\$300.00	301
	To respray antirust on affected area.			\$320.00	601
	To remove and install roof lining			\$200.00	1201
	To remove and install , programme cp unit and traction contrl unit etc			\$700.00	?

**Total : \$48,055.00**

Issue by:

Ivan Teo

**LKK Auto Consultants** hence notify the Repairer of the following:

- To resurvey before/after spray painting
- To display damaged part(s) during resurvey
- Parts prices are subject to confirmation
- Third party survey is on a "Without Prejudice" basis
- No illegal modification(s) is allowed
- Supplementary item(s) must be resurveyed and is subject to final approval from Insurance Company

Acknowledged by Repairer

Signature: \_\_\_\_\_

Date: \_\_\_\_\_

# SINGAPORE ACCIDENT STATEMENT

## IMPORTANT NOTICE

1. Please report correctly the details of the accident to speed up the claims process.
2. This Form must be completed by the Policyholder and/or the Actual Driver
3. Information provided must be as truthful and accurate as possible. Any wilful misrepresentation or withholding of material facts may allow insurance companies to repudiate policy liability.
4. The issue and acceptance of this Form by insurance companies is not an admission of policy liability on the part of the insurance companies.
5. Any false reporting may be referred to the Police for investigation.
6. This report will be forwarded by the insurers of the GIA Records Management Centre established by the General Insurance Association of Singapore (GIA) for archiving and that copies of this report will, for a fee, be made available upon application by interested parties.
7. By the lodgement of this report to the insurers, you hereby consent to the archiving of this report at the centre and to copies of the report being made available aforesaid.

## ACCIDENT STATEMENT

Date of Submission	24/11/2022 17:08 (SGT)
Reported by	Both
Date of Accident	23/11/2022 16:45 (SGT)
Exact Location of Accident	16 Tuas View Loop, Singapore 637682
Additional Location Information	16 TUAS VIEW LOOP
Country/State of Loss	Singapore

## DETAILS OF OWN VEHICLE

Vehicle Registration Number	ED1166T
-----------------------------	---------

### INSURED/POLICYHOLDER

Is company?	No
Name Of Registered Owner	LIM YONG MENG (LIN YONGMING)
NRIC No	SXXXX031C
Email Address	MENG@SPRAYTECH.SG
Mobile Phone No	(Phone) +65-94788102
Alternative Phone No	-

### VEHICLE PARTICULARS

Manufacturer	Mercedes
Model	GLA180
Variant	MERCEDES BENZ GLA180 URBAN EDITION AUTO
Exact purpose for which vehicle was being used at time of accident	Private use
Are you claiming under your own insurance policy for repair to your vehicle?	No - Claiming third party
Vehicle Category	Private car
Transmission	Auto
C	1595

### INSURANCE COMPANY

Name of Insurance Company	China Taiping Insurance (Singapore) Pte. Ltd.
Policy Number / Cover Note Number	DMPCSNW00262422100

### DRIVER

Name of Driver	LIM YONG MENG (LIN YONGMING)
C No	SXXXX031C
Date Of Birth	23/06/1976



## IMPORTANT NOTICE

## SKETCH PLAN

1. Please report correctly the details of the accident to speed up the claims process.
2. This Form must be completed by the Policyholder and/or the Actual Driver.
3. Information provided must be as truthful and accurate as possible. Any wilful misrepresentation or withholding of material facts may allow insurance companies to repudiate policy liability.
4. The issue and acceptance of this Form by insurance companies is not an admission of policy liability on the part of the insurance companies.
5. **Any false reporting may be referred to the Traffic Police Department for investigation.**
6. This report will be forwarded by the insurers to the GIA Records Management Centre established by the General Insurance Association of Singapore (GIA) for archiving and that copies of this report will for a fee be made available upon application by interested parties.
7. By the lodgement of this report to the insurers, you hereby consent to the archiving of this report at the centre and to copies of the report being made available aforesaid.


### 8. Consent under the Personal Data Protection Act (PDPA)

I understand, acknowledge, agree and consent that:

- (a) My insurer, my workshop and the General Insurance Association of Singapore ("GIA") may/are permitted to collect, use, disclose and/or process my personal data/personal information set out in this [form] and any other personal information provided by me or possessed by my insurer (collectively the "Personal Information") and disclose and transfer such Personal Information to all insurer(s) who have insured vehicle(s) involved in this accident (all insurer(s) who have insured vehicle(s) involved in this accident shall be collectively referred to as the "Insurers"), the Insurers' lawyers/law firms, the Monetary Authority of Singapore and any relevant government agency/authority (such as the police), for the purpose(s) of:
  - (i) processing, handling and/or dealing with my claims including the settlement of the claims and any necessary investigations relating to the claims;
  - (ii) investigating the accident and/or my claims;
  - (iii) carrying out and/or dealing with my instructions or responding to any enquiries by me;
  - (iv) administering my claims (including the mailing of correspondence, statements, invoices, reports or notices to me, which could involve disclosure of certain personal data about me to bring about delivery of the same as well as on the external cover of envelopes/mail packages); and/or
  - (v) complying with applicable law in administering, processing, handling and/or dealing with my claims.(collectively the "Purposes")
- (b) all insurer(s) who have insured vehicle(s) involved in this accident and the insurers' lawyers/law firms, may/are permitted to collect, use, disclose and/or process my Personal Information for one or more of the above Purposes; and
- (c) my Personal Information may/can be disclosed by any of the Insurers and/or GIA to their third-party service providers or agents (including their lawyers/law firms), which may be sited outside of Singapore, for one or more of the above Purposes.

Policyholder's Signature / Date & Time

Driver's Signature (If driver is not the policyholder) / Date & Time

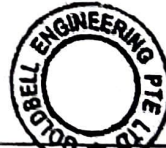

Witnessed by Reporting Centre Personnel  
(Name as in NRIC/ID card)

### Sketch Plan

TUAS VIEW LOOP

VEHICLE A: ED116GT

VEHICLE B: WD5762H

