



**Lai Huat (Meng Kee) Motor Pte Ltd**  
**160 Sin Ming Drive, #04-01, #04-02 &**  
**#07-03, Sin Ming Autocity**  
**575722**

**Insurer Reference:**  
**Repairer Reference: 73336**  
**Date calculated: 27/01/2023 5:30 PM**

**Full Report**  
**Registration: SLU 6830D**  
**Printed: 27/01/2023 5:30 PM**

### Summary Information

<b>Claim</b>			
Location:	Singapore (SG)	Work Provider:	China Taiping Insurance (Singapore) Pte Ltd
Printed by:	Jenny Lim	Currency:	SGD
Claim Reference:		Date of Incident:	23/01/23
Estimated Repair Time:	7	Hire Car Start:	
Actual Repair Days:		Hire Car End:	

### Vehicle Details

**Vehicle**  
Manufacturer: MERCEDES-BENZ  
Model: E-CLASS (W213)  
Sub Model: E 200  
Model Sheet Number: 03 FE 42  
Registration: SLU 6830D  
VIN number: WDD2130422A113718  
Odometer:

**Model Specs**  
FR PRODUCTION START INSTR PANEL LEATHER  
HEADUNIT ASIA EXCLUSIVE INTERIOR  
MIRROR PACKAGE ACTIVE BRAKE ASSIST  
ELEC FOLD DR MIRRORS REARVIEW CAMERA  
MULTIBEAM LED WIDESCREEEN COCKPIT  
MEMORY PACKAGE ASH WOOD TRIM  
KEYLESS GO ELECTRIC BOOTLID  
DIRECT INJECTION SHIFT PADDLE ON STRG  
TYRES 225/55 YR 17 WHEELS 7.5J X 17 ALU  
BODY SHELL LOAD LVL1 TWO COAT METALLIC

MEDIA INTERFACE  
MODEL 2017  
TRAFFIC SIGN RECOGN  
HIGH BEAM ASSISTANT  
NAPPA LTH UPHOLSTERY  
PARK PILOT SYSTEM  
ILLUMINAT AMBIENTE  
DYNAMIC SELECT  
EXTENDED FUEL TANK  
CLEAR COAT HARD

EXCLUSIVE EXTERIOR  
TOUCHPAD  
OUT/IN MIRR AUTO DIM  
COMAND ONLINE  
STRG WHEEL LEATHER  
ANALOG CLOCK  
ELECTRIC BOOTLID  
AUTOMATIC 9-SPEED  
SUNROOF

*Not Attached  
Patching B4 paint  
5days*

**LKK Auto Consultants** hence notify  
the Repairer of the following:

- To resurvey before/after spray painting
- To display damaged part(s) during resurvey
- Parts prices are subject to confirmation
- Third party survey is on a "Without Prejudice" basis
- No illegal modification(s) is allowed
- Supplementary item(s) must be resurveyed and is subject to final approval from Insurance Company

Acknowledged by Repairer

Signature:

Date:

## Vehicle Condition


### Vehicle Status

Pre-Accident Damage:

Date of Inspection:

### Damage Areas

All   
Underbody

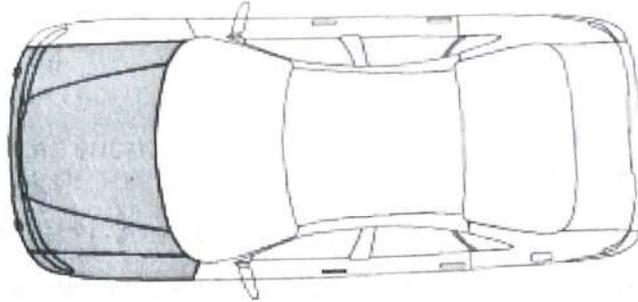

## Tyres Condition

Tyre Brand	Tread (Left Middle), Tread (Left Outer), Tread (Left Inner), Tread (Right Inner), Tread (Right Outer), Tread (Right Middle), mm					Condition
	mm	mm	mm	mm	mm	
Spare Tyre Brand	Tread (Spare), mm					

## Labour

Code	Description	Time Base 10 WU/h	Price = 42.00 SGD/h	
			WU	Price SGD
54-1011 01	SHORT TEST INCLUDES: CONNECT + DISCONNECT STAR DIAGNOSIS, PRINT DATA, DELETE ERROR MEMORY	3.0	3.0	12.60
54-7989 01	R + R BATTERY EARTH CABLE (WHEN DISCONNECTING ELECTRIC PLUG AND SOCKET CONNECTIONS)	3.0	3.0	12.60
54-0650 01	MAIN BOARD MAINTAINED (FOR CHECK AND DIAGNOSIS WORK)	1.0	1.0	4.20
61-1086 01	R + R FRONT AND CENTRE ENGINE COMPARTMENT COVERING	3.0	3.0	12.60
61-1073 01)	R + R L/F LOWER COVER	1.0	1.0	4.20
61-1074 01)	R + R R/F LOWER COVER	1.0	1.0	4.20
88-2530 01	REPAIR OF L/FRONT-END DAMAGE INCLUDES: RENEW BUMPER, BONNET, RADIATOR COVER, FRONT WING AND FRONT LAMP UNIT, CONVERT ATTACHED PARTS, RENEW IF	36.0	36.0	151.20

Code	Description	WU	Price SGD
88-1164 01	NECESSARY ADDITION FOR RENEW FRONT BUMPER (VEHICLE WITH ACTIVE BRAKE ASSIST)	1.0	4.20
88-1376 01	ADD TO RENEW FRONT BUMPER (VEHICLE WITH PARK ASSISTENT)	3.0	12.60
82-4720 01)	R + R R/HEADLAMP (BUMPER REMOVED)	3.0	12.60
82-4886 01	ADDITIONAL TO RENEW HEADLAMP (VEHICLE WITH LED HEADLAMP)	3.0	12.60
88-4702 01	R + R L/F WHEELHOUSE LINER FRONT	3.0	12.60
88-2657 01	R + R BOTH BONNET HINGE	4.0	16.80
60-1331 01	R + R ATTACHED PARTS OF THE ENGINE COMPARTMENT FOR RENEWAL OF THE FRONT MODULE INCLUDES: R + R ALL ATTACHED PARTS IN THE REPAIR SECTION	15.0	63.00
62-1266 01	R + R OR RENEW FRONT CROSSMEMBER AND COMPLETE TRUSSING BETWEEN WHEELHOUSES INCLUDES: R + R CENTRE TRUSSING, RENEW IF NECESSARY	7.0	29.40
82-1120 01	ADJUST HEADLAMPS (VEHICLE WITH LED HEADLAMP) INCLUDES: ZERO POSITION FOR LED HEADLAMP WITH STAR-DIAGNOSIS ADJUST		
<b>Labour Cost</b>		<b>Hrs</b>	<b>WU</b>
<b>Panel / Mechanical Labour</b>		10.20	102.0
<b>Total of Labour</b>			428.40

## Paint

Paint Work

SYSTEM AZT

Time Basis 10 WU/h

Code	Description - TWO COAT METALLIC	WU	Price SGD
	BONNET NEW PART PAINTING	31.0	
	L/BONNET HINGE SURFACE PAINT	4.0	
	R/BONNET HINGE SURFACE PAINT	4.0	
	L/F WING NEW PART PAINTING	11.0	
	FRONT BUMPER TRIM NEW PART PAINT K1R	10.0	
	L/F OUTER SENSOR SURFACE PAINT PLAST.	3.0	
	R/F OUTER SENSOR SURFACE PAINT PLAST.	3.0	
	L/F INNER SENSOR SURFACE PAINT PLAST.	3.0	
	R/F INNER SENSOR SURFACE PAINT PLAST.	3.0	
	LEFT FRONT DOOR SURFACE PAINT	8.0	

## Paint Material Per Part

Code	Description	Price SGD
0471	BONNET NEW PART PAINTING	107.33
0475	L/BONNET HINGE SURFACE PAINT	0.25
0476	R/BONNET HINGE SURFACE PAINT	0.25
0741	L/F WING NEW PART PAINTING	22.70
0283	FRONT BUMPER TRIM NEW PART PAINT K1R	42.31
0361	L/F OUTER SENSOR SURFACE PAINT PLAST.	0.37

**Paint Material Per Part**

Code	Description	Price SGD
0362	R/F OUTER SENSOR SURFACE PAINT PLAST.	0.37
0365	L/F INNER SENSOR SURFACE PAINT PLAST.	0.37
0366	R/F INNER SENSOR SURFACE PAINT PLAST.	0.37
1481	LEFT FRONT DOOR SURFACE PAINT	23.16

**Labour Cost - Paint**

	Hrs	WU	Price SGD
Factor			42.00 SGD/h
Time Paint		80.0	
Preparation Main Work Metal	1.10	11.0	46.20
Preparation Comp. Work Plastic	0.50	5.0	21.00
<b>Total</b>	<b>9.60</b>	<b>96.0</b>	<b>403.20</b>

**Material Cost - Paint**

	Price SGD
New Part Painting	130.03
New Part Painting - Plastic K1R	42.31
Surface-/Blend Paint	23.66
Surface Painting Plastic	1.48
Material-constant Metal	18.10
Material-constant Plastic	9.00
<b>Total</b>	<b>224.58</b>

**Spare Parts**

prices as at 2015-06-01

Code	Description	Part Number	Part Source	Price SGD
0471	BONNET	213 880 0357	Original	1,270.00
0390	CTR FRT BUMPER MLDG	213 885 0300	Original	76.00
0283	FRONT BUMPER TRIM	213 885 0138	9999 Original	870.00
0930	FRONT MODULE CPL	213 620 6300	Original	575.00
0349	FRT/CTR IMPACT DAMP	213 885 0237	Original	98.00
0305	FRT CT BUMP GRILLE	213 885 0622	Original	76.00
0335	FRT CTR BUMPER CARR	213 885 1265	Original	78.00
8779	FRT ENGINE COVER	213 520 0000	Original	153.00
1001	FRT LWR CROSSMEMBER	213 620 0130	Original	295.00
0405	GRILLE	213 880 8702	9040 Original	390.00
0475	L/BONNET HINGE	213 880 0128	Original	138.00
0343	L/F BUMPER CARRIER	213 885 0865	Original	51.00
0315	L/F BUMPER TRIM	213 885 0174	Original	45.00
0303	L/F BUMP LWR GRILLE	213 885 1122	Original	62.00
0363	L/F CTR PARKING SENS	000 905 5504	9999 Original	100.00
8775	L/F LOWER COVER	213 520 5600	Original	48.00
1187	L/F LWR BUMP FRT ABS	213 620 0400	Original	67.00
0749	L/F SPACER	213 889 0195	Original	12.00
1189	L/F STRUT	253 620 1600	Original	35.00
1191	L/F UPP BUMP FRT ABS	213 620 0195	Original	110.00
0839	L/F W-HOUSE FRT CVR	238 690 1503	Original	85.00
0741	L/F WING	213 880 0118	Original	575.00
9645	L/HORN	213 542 4400	Original	107.00
8767	L/LWR COVER BRACKET	213 524 0340	Original	22.00
1000	L/ SIDE BKRT	CROSSMEMBER	Original	35.00

PRINT DATE 27/01/2023

Code	Description	Part Number	Part Source	Price SGD
0503	L/UPP LOCK	213 880 0060	Original	28.00
0561	LEFT HEADLAMP ASSY	213 906 9504	Original	3,230.00
0476	R/BONNET HINGE	213 880 0228	Original	138.00
0354	RIVET	003 990 9497	Original	80.00
0797	SCREW	099 990 0014	Original	18.00
0935	UPP FRT PANEL COVER	213 620 1701	Original	141.00

f: OEM Parts  
n: Non-OEM Parts  
u: Used parts

<b>Savings</b>	0.00
<b>Subtotal</b>	9,008.00
<b>Fixed Sundry Parts Price</b>	100.00
<b>Addition(+10.00%)</b>	900.80
<b>Total</b>	<b>10,008.80</b>

### Extras

Code	Description	Price SGD
1002	CHK/CLR FAULT CODES DIAGNOSTIC	120.00*
<b>Total Extras</b>		<b>120.00</b>

### Final Calculation

	SGD	SGD
<b>Parts</b>		
Fixed Sundry Parts Price	9,008.00	
Addition(+10.00%)	100.00	
<b>Total Parts</b>	900.80	<b>10,008.80</b>
<b>Labour Time Base 10 WU/h</b>		
Total 102.0 WU X 42.00 SGD/h	428.40	
<b>Total of Labour</b>		<b>428.40</b>
<b>Total Of Extras</b>		<b>120.00</b>
<b>Paint Work Time Base 10 WU/h</b>		
Labour Cost 96.0 WU X 42.00 SGD/h	403.20	
Material Cost	224.58	
<b>Total Paint Including Material</b>		<b>627.78</b>
<b>Repair Cost Excludes GST</b>		<b>11,184.98</b>
GST (+8.0%)		894.80
<b>Repair Cost Included GST</b>		<b>12,079.78</b>

### Comments

\* - USER SUPPLIED DATA  
NN - NO MANUFACTURERS CODE EXISTS  
) - WU PARTIAL INCL IN OTHER POSITIONS

### Assessment Note

# SINGAPORE ACCIDENT STATEMENT

## IMPORTANT NOTICE

1. Please report correctly the details of the accident to speed up the claims process.
2. This Form must be completed by the Policyholder and/or the Actual Driver
3. Information provided must be as truthful and accurate as possible. Any wilful misrepresentation or withholding of material facts may allow insurance companies to repudiate policy liability.
4. The issue and acceptance of this Form by insurance companies is not an admission of policy liability on the part of the insurance companies.
5. Any false reporting may be referred to the Police for investigation.
6. This report will be forwarded by the insurers of the GIA Records Management Centre established by the General Insurance Association of Singapore (GIA) for archiving and that copies of this report will, for a fee, be made available upon application by interested parties.
7. By the lodgement of this report to the insurers, you hereby consent to the archiving of this report at the centre and to copies of the report being made available aforesaid.

## ACCIDENT STATEMENT

Date of Submission	25/01/2023 15:52 (SGT)
Reported by	Driver
Date of Accident	23/01/2023 14:50 (SGT)
Exact Location of Accident	Near Bedok Rd, Singapore
Additional Location Information	UPPER CHANGI RD/BEDOK RD (TRAFFIC JUNCTION)
Country/State of Loss	Singapore

## DETAILS OF OWN VEHICLE

Vehicle Registration Number	SLU6830D
INSURED/POLICYHOLDER	
Is company?	No
Name Of Registered Owner	HO WAH YAM
NRIC No	S0005595F
Email Address	SPAMMEALWAYS69@YAHOO.COM.SG
Mobile Phone No	(Phone) +65-93632419
Alternative Phone No	-

## VEHICLE PARTICULARS

Manufacturer	Mercedes
Model	E200
Variant	-
Exact purpose for which vehicle was being used at time of accident	Private use
Are you claiming under your own insurance policy for repair to your vehicle?	No - Claiming third party
Vehicle Category	Private car
Transmission	Auto
CC	1991

## INSURANCE COMPANY

Name of Insurance Company	Etiqa Insurance Pte Ltd
Policy Number / Cover Note Number	M0036994

## DRIVER

Name of Driver	DESMOND HO YU MUN
NRIC No	S8008263J
Date Of Birth	20/03/1980
Occupation	Indoor

**IMPORTANT NOTICE**

1. Please report correctly the details of the accident to speed up the claims process
2. **This Form must be completed by the Policyholder and/or the Actual Driver.**
3. Information provided must be as **truthful and accurate as possible.** Any wilful misrepresentation or withholding of material facts may allow insurance companies to **reassess policy liability**
4. The issue and acceptance of this Form by insurance companies is not an admission of policy liability on the part of the insurance companies.
5. **Any false reporting may be referred to the Traffic Police Department for investigation.**
6. This report will be forwarded by the insurers to the GIA Records Management Centre established by the General Insurance Association of Singapore (GIA) for archiving and that copies of this report will for a fee be made available upon application by interested parties.
7. By the lodging of this report to the insurers, you hereby consent to the archiving of this report at the centre and to copies of the report being made available aforesaid.

**Consent under the Personal Data Protection Act (PDPA)**

I understand, acknowledge, agree and consent that  
 (a) My insurer, my workshop and the General Insurance Association of Singapore (GIA) may be permitted to collect, use, disclose and/or process my personal data/personal information set out in this form and any other personal information provided by me or possessed by my insurer (collectively the **Personal Information**) and disclose and transfer such Personal Information to all insurer(s) who have insured vehicle(s) involved in this accident (all insurer(s) who have insured vehicle(s) involved in this accident shall be collectively referred to as the **Insurers**), the Insurers' lawyers/law firms, the Monetary Authority of Singapore and any relevant government agency/authority (such as the police), for the purpose(s) of:

- (i) processing, handling and/or dealing with my claims including the settlement of the claims and any necessary investigations relating to my claims
  - (ii) investigating the accident and/or my claims
  - (iii) carrying out and/or dealing with my instructions or responding to any enquiries by me
  - (iv) administering my claims (including the making of correspondence, statements, invoices, reports or notices to me, which could involve disclosure of certain personal data about me to bring about delivery of the same as well as on the external cover of envelopes/mail packages), and/or
  - (v) complying with applicable law in administering, processing, handling and/or dealing with my claims.
- collectively the **Purposes**.)

All insurer(s) who have insured vehicle(s) involved in this accident and the Insurers' lawyers/law firms, may be permitted to collect, disclose and/or process my Personal Information for one or more of the above Purposes, and my Personal Information may/can be disclosed by any of the Insurers and/or GIA to their third party service providers or agents (including their lawyers/law firms), which may be sited outside of Singapore, for one or more of the above Purposes.

Insurer's Signature / Date & Time

Driver's Signature (if driver is not the policyholder) / Date & Time

Witnessed by Reporter / Centre Personnel (Name as in NRIC/ID card)

