

### Vehicle Condition


#### Vehicle Status

Pre-Accident Damage:

Date of Inspection:

#### Damage Areas

All   
 Underbody

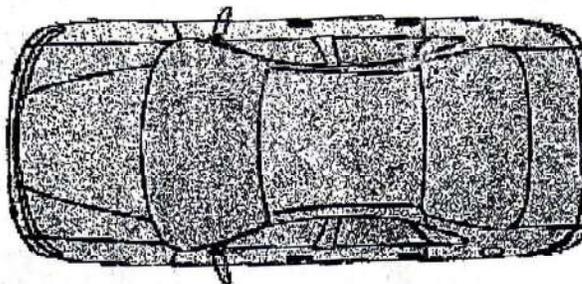

### Tyres Condition

Tyre Brand      Tread (Left Middle), Tread (Left Outer), Tread (Left Inner), Tread (Right Inner), Tread (Right Outer), Tread (Right Middle), mm      Condition

Spare Tyre Brand      Tread (Spare), mm

### Labour

Code	Description	Time Base 10 WU/h	Price = 42.00 SGD/h	
			WU	Price SGD
UA10A1)	R + R FRONT BUMPER	6.0		25.20
UA10A1)	RENEW FRONT BUMPER (REMOVED)	2.0		8.40
QA10A2	R + R STEERING WHEEL	5.0		21.00
QA12A2	R + R UPPER STEERING COLUMN TRIM	2.0		8.40
QA16A2)	R + R STEERING CONNECTOR SHAFT	5.0		21.00
QD01B1)	R + R POWER STEERING RACK	27.0		113.40
QD0221	RENEW STEERING GEAR (REMOVED)	1.0		4.20
MH62A1)	R + R FRONT AXLE BEAM	40.0		168.00
MH62A1)	DIS + ASS FRONT AXLE MEMBER (REMOVED)	56.0		235.20
PW10A1)	FIT + BALANCE L/F TYRE	2.0		8.40
MH50A1)	R + R L/F STRUT	1.0		4.20
NO NUMBER	DÉTACH + REFIT FRONT STABILIZER	2.0		8.40
CD10A2	R + R RADIATOR	31.0		130.20
AW10A1	R + R L/F ENGINE CARRIER SUPPORT	34.0		142.80
AW10A2	R + R R/F ENGINE CARRIER RUBBER BEARING	34.0		142.80
AW12A2	R + R GEARBOX SUPPORT	5.0		21.00
CC16A2	R + R AIR CONDITIONING BELT	13.0		54.60
TD18A2)	R + R AIR CONDITIONING COMPRESSOR	5.0		21.00

Code	Description	WU	Price SGD
TB7772	DRAIN/REFILL AIR CONDITIONING	6.0	25.20
NO NUMBER	BLEED POWER STEERING	3.0	12.60
1001	WHEEL ALIGNMENT REPAIR		60.00*
<b>Labour Cost</b>		<b>Hrs</b>	<b>WU</b>
Panel / Mechanical Labour		28.00	1,176.00
Fixed Rate			60.00
<b>Total of Labour</b>			<b>1,236.00</b>

**Spare Parts**

Code	Description	Part Number	Part Source	Price SGD
1000	AIR FILTER RESONATOR PARTS		Original	180.00 X
7011	FRONT AXLE BEAM	54400 MA000	Original	900.00
0281	FRONT BUMPER CPL	62010 MD81A	Original	400.00
8631	L/ENGINE MOUNTING	11220 MC00B	Original	75.00
7053	L/F LWR CONTROL ARM	54501 MA00A	Original	320.00
7123	L/F OUT WHEEL BRG	40215 MA00A	Original	120.00
7227	L/FR TYRE	195/70 R 15 .. R	Original	190.00
7201	L/FR WHEEL	40300 LC10B	Original	220.00
7081	L/F STEERING KNUCKLE	40015 MA00A	Original	550.00
8919	L/G-BOX SUPP BRACKET	11333 MA700	Original	70.00
7049	L/UPPER CONTROL ARM	54525 MA00B	Original	280.00
8632	R/ENGINE MOUNTING	11220 MC00B	Original	75.00
8920	R/G-BOX SUPP BRACKET	11332 MA700	Original	70.00
7761	RADIATOR	21400 MA01A	Original	850.00
7300	STEERING GEAR ASSY	49001 MD00A	Original	1,200.00
f: OEM Parts	<b>Savings</b>			0.00
n: Non-OEM Parts	<b>Subtotal</b>			5,500.00
u: Used parts	<b>Total</b>			<b>5,500.00</b>

**Final Calculation**

	SGD	SGD
<b>Parts</b>		
Total Parts	5,500.00	5,500.00
<b>Labour Time Base 10 WU/h</b>		
Total 280.0 WU X 42.00 SGD/h	1,176.00	
Fixed Rate	60.00	
<b>Total of Labour</b>		<b>1,236.00</b>
<b>Repair Cost Excludes GST</b>		<b>6,736.00</b>
GST (+8.0%)		538.88
<b>Repair Cost Included GST</b>		<b>7,274.88</b>

**LKK Auto Consultants** hence notify the Repairer of the following:

- To resurvey before/after spray painting
- To display damaged part(s) during resurvey
- Parts prices are subject to confirmation
- Third party survey is on a "Without Prejudice" basis
- No illegal modification(s) is allowed
- Supplementary item(s) must be covered and is subject to final approval from Insurance Company

Acknowledged by Repairer  
Signature:  
Date:

Audatex System Using Manufacturer Times

PRINT DATE 08/02/2023

GBE1520J  
09/China

**Cheng Hoe Motor Pte Ltd**  
**#01-374/382, Blk 1019, Yishun**  
**Industrial Park A**  
**768761**

**Insurer Reference: GBE1520J**  
**Repairer Reference: A0482**  
**Date calculated: 08/02/2023 2:30 PM**

**Full Report**  
**Registration: GBE1520J**  
**Printed: 08/02/2023 2:31 PM**

**Summary Information**

<b>Claim Location:</b>	Singapore (SG)	<b>Work Provider:</b>	China Taiping Insurance (Singapore) Pte Ltd
<b>Printed by:</b>	CHENG HOE	<b>Currency:</b>	SGD
<b>Claim Reference:</b>	GBE1520J	<b>Date of Incident:</b>	01/02/23
<b>Estimated Repair Time:</b>		<b>Hire Car Start:</b>	
<b>Actual Repair Days:</b>		<b>Hire Car End:</b>	

**Vehicle Details**

<b>Vehicle Manufacturer:</b>	NISSAN		
<b>Model:</b>	ATLAS F24		
<b>Sub Model:</b>	BASE MODEL		
<b>Model Sheet Number:</b>	71 94 01		
<b>Registration:</b>	GBE1520J		
<b>VIN number:</b>	JN1SC2F24Z0857565		
<b>Odometer:</b>			
<b>Model Specs</b>			
FROM 01.2015	AIR CONDITIONING	3.0 LTR 110KW	5 SPEED GEARBOX
ANTI LOCK BRAKES	TYRES 195/70 RR 15	SINGLE CAB	PRODUCTION IN JAPAN
TWO COAT METALLIC	PREPARE OFF VEHICLE		

*Not Authorized  
1/1/23 @  
Repairer After Repair  
Est @ 500.*