

Vehicle Condition


Vehicle Status

Pre-Accident Damage:

Date of Inspection:

Damage Areas

All
 Underbody

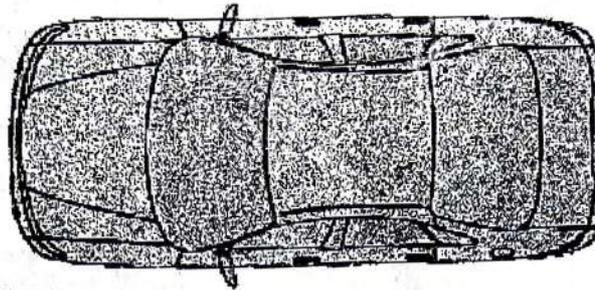

Tyres Condition

Tyre Brand	Tread (Left Middle), Tread (Left Outer), Tread (Left Inner), Tread (Right Inner), Tread (Right Outer), Tread (Right Middle), mm						Condition
	mm	mm	mm	mm	mm	mm	
Spare Tyre Brand	Tread (Spare), mm						

Labour

Code	Description	Time Base 10 WU/h	Price = 42.00 SGD/h	
			WU	Price SGD
UA10A1)	R + R FRONT BUMPER		6.0	25.20
UA10A1)	RENEW FRONT BUMPER (REMOVED)		2.0	8.40
QA10A2	R + R STEERING WHEEL		5.0	21.00
QA12A2	R + R UPPER STEERING COLUMN TRIM		2.0	8.40
QA16A2)	R + R STEERING CONNECTOR SHAFT		5.0	21.00
QD01B1)	R + R POWER STEERING RACK		27.0	113.40
QD0221	RENEW STEERING GEAR (REMOVED)		1.0	4.20
MH62A1)	R + R FRONT AXLE BEAM		40.0	168.00
MH62A1)	DIS + ASS FRONT AXLE MEMBER (REMOVED)		56.0	235.20
PW10A1)	FIT + BALANCE L/F TYRE		2.0	8.40
MH50A1)	R + R L/F STRUT		1.0	4.20
NO NUMBER	DETACH + REFIT FRONT STABILIZER		2.0	8.40
CD10A2	R + R RADIATOR		31.0	130.20
AW10A1	R + R L/F ENGINE CARRIER SUPPORT		34.0	142.80
AW10A2	R + R R/F ENGINE CARRIER RUBBER BEARING		34.0	142.80
AW12A2	R + R GEARBOX SUPPORT		5.0	21.00
CC16A2	R + R AIR CONDITIONING BELT		13.0	54.60
TD18A2)	R + R AIR CONDITIONING COMPRESSOR		5.0	21.00

Code	Description	WU	Price SGD
TB7772	DRAIN/REFILL AIR CONDITIONING	6.0	25.20
NO NUMBER	BLEED POWER STEERING	3.0	12.60
1001	WHEEL ALIGNMENT REPAIR		60.00*
Labour Cost			
	Panel / Mechanical Labour	Hrs 28.00	WU 280.0
	Fixed Rate		1,176.00
			60.00
Total of Labour			1,236.00

Spare Parts

Code	Description	Part Number	Part Source	Price SGD
1000	AIR FILTER RESONATOR PARTS		Original	180.00 X
7011	FRONT AXLE BEAM	54400 MA000	Original	900.00
0281	FRONT BUMPER CPL	62010 MD81A	Original	400.00
8631	L/ENGINE MOUNTING	11220 MC00B	Original	75.00
7053	L/F LWR CONTROL ARM	54501 MA00A	Original	320.00
7123	L/F OUT WHEEL BRG	40215 MA00A	Original	120.00
7227	L/FR TYRE	195/70 R 15 R	Original	190.00
7201	L/FR WHEEL	40300 LC10B	Original	220.00
7081	L/F STEERING KNUCKLE	40015 MA00A	Original	550.00
8919	L/G-BOX SUPP BRACKET	11333 MA700	Original	70.00
7049	L/UPPER CONTROL ARM	54525 MA00B	Original	280.00
8632	R/ENGINE MOUNTING	11220 MC00B	Original	75.00
8920	R/G-BOX SUPP BRACKET	11332 MA700	Original	70.00
7761	RADIATOR	21400 MA01A	Original	850.00
7300	STEERING GEAR ASSY	49001 MD00A	Original	1,200.00
f: OEM Parts	Savings			0.00
n: Non-OEM Parts	Subtotal			5,500.00
u: Used parts	Total			5,500.00

Final Calculation

	SGD	SGD
Parts		
Total Parts	5,500.00	5,500.00
Labour Time Base 10 WU/h		
Total 280.0 WU X 42.00 SGD/h	1,176.00	
Fixed Rate	60.00	
Total of Labour		1,236.00
Repair Cost Excludes GST		6,736.00
GST (+8.0%)		538.88
Repair Cost Included GST		7,274.88

LKK Auto Consultants hence notify the Repairer of the following:

- To resurvey before/after spray painting
- To display damaged part(s) during resurvey
- Parts prices are subject to confirmation
- Third party survey is on a "Without Prejudice" basis
- No illegal modification(s) is allowed
- Supplementary item(s) made reserved and is subject to final approval from Insurance Company

Acknowledged by Repairer
Signature:
Date:

Audatex System Using Manufacturer Times

PRINT DATE: 08/02/2023

GBE1520J
09/china

Cheng Hoe Motor Pte Ltd
#01-374/382, Blk 1019, Yishun
Industrial Park A
768761

Insurer Reference: GBE1520J
Repairer Reference: A0482
Date calculated: 08/02/2023 2:30 PM

Full Report
Registration: GBE1520J
Printed: 08/02/2023 2:31 PM

Summary Information

Claim			
Location:	Singapore (SG)	Work Provider:	China Taiping Insurance (Singapore) Pte Ltd
Printed by:	CHENG HOE	Currency:	SGD
Claim Reference:	GBE1520J	Date of Incident:	01/02/23
Estimated Repair Time:		Hire Car Start:	
Actual Repair Days:		Hire Car End:	

Vehicle Details

Vehicle			
Manufacturer:	NISSAN		
Model:	ATLAS F24		
Sub Model:	BASE MODEL		
Model Sheet Number:	71 94 01		
Registration:	GBE1520J		
VIN number:	JN1SC2F24Z0857565		
Odometer:			
Model Specs			
FROM 01.2015	AIR CONDITIONING	3.0 LTR 110KW	5 SPEED GEARBOX
ANTI LOCK BRAKES	TYRES 195/70 RR 15	SINGLE CAB	PRODUCTION IN JAPAN
TWO COAT METALLIC	PREPARE OFF VEHICLE		

*Not withstanding
1/1/23 @
Penny After Payment
Ex @ 500/-*

> Back to OneMotoring

Enquire PARF/COE Rebate for Registered Vehicle

Vehicle Owner Particulars	
Owner ID Type:	Company
Owner ID:	040E
Vehicle Details	
Vehicle No.:	GBE1520J
Vehicle to be Exported:	No
Intended Deregistration Date:	03 Feb 2023
Vehicle Make:	NISSAN
Vehicle Model:	CABSTAR 3.0 5M/T ABS 2DR 2WD EURO 5
Primary Colour:	Gold
Manufacturing Year:	2015
Engine No.:	ZD30001401N
Chassis No.:	JN15C2F24Z0857565
Maximum Power Output:	-
Open Market Value:	\$25,089.00
Original Registration Date:	19 Sep 2015
First Registration Date:	19 Sep 2015
Transfer Count:	0
Actual ARF Paid:	\$1,255.00
Intended PARF Rebate Details	
PARF Eligibility:	No
PARF Eligibility Expiry Date:	-
PARF Rebate Amount:	\$0.00
Intended COE Rebate Details	
COE Expiry Date:	18 Sep 2025
COE Category:	C - Goods Vehicle & Bus
COE Period(Years):	10
PQP Paid:	\$44,435.00
COE Rebate Amount:	\$11,664.00
Total Rebate Amount:	\$11,664.00

Information contained herein is correct as at 03 Feb 2023

OK

SINGAPORE ACCIDENT STATEMENT

IMPORTANT NOTICE

1. Please report correctly the details of the accident to speed up the claims process.
2. This Form must be completed by the Policyholder and/or the Actual Driver
3. Information provided must be as truthful and accurate as possible. Any willful misrepresentation or withholding of material facts may allow insurance companies to repudiate policy liability.
4. The issue and acceptance of this Form by insurance companies is not an admission of policy liability on the part of the insurance companies.
5. Any false reporting may be referred to the Police for investigation.
6. This report will be forwarded by the Insurers of the GIA Records Management Centre established by the General Insurance Association of Singapore (GIA) for archiving and that copies of this report will, for a fee, be made available upon application by interested parties.
7. By the lodgement of this report to the insurers, you hereby consent to the archiving of this report at the centre and to copies of the report being made available aforesaid.

ACCIDENT STATEMENT

Date of Submission 03/02/2023 19:33 (SGT)
Reported by Driver
Date of Accident 01/02/2023 15:20 (SGT)
Exact Location of Accident Singapore
Additional Location Information BEDOK NORTH AVE 4
Country/State of Loss Singapore

DETAILS OF OWN VEHICLE

Vehicle Registration Number GBE1520J
INSURED/POLICYHOLDER
Is company? Yes
Name Of Registered Owner GTS ENGINEERING PTE LTD
Company Reg No 1XXXXX040E
Email Address generalthermal@gtsengrg.com
Mobile Phone No (Phone) +65-68925211
Alternative Phone No

VEHICLE PARTICULARS

Manufacturer Nissan
Model CABSTAR 3.0 5MT ABS 2DR 2WD EURO 5
Variant
Exact purpose for which vehicle was being used at time of accident
Are you claiming under your own insurance policy for repair to your vehicle? Employment
Vehicle Category Yes
Transmission Commercial vehicle
CC Manual
2853

INSURANCE COMPANY

Name of Insurance Company China Taiping Insurance (Singapore) Pte. Ltd.
Policy Number / Cover Note Number DMCVSNW00107052202

DRIVER


Name of Driver MASUD
Passport No/FIN GX00X618R
Date Of Birth 12/04/1993
Occupation Outdoor

Describe Circumstance of the Accident

NOTE : PLEASE TAKE NOTE THAT YOUR INSURER HAVE 14DAYS TIME FRAME for you to submit OWN DAMAGE Claim under your Own Comprehensive policy. Pls check your policy for more information.

() Claim Own Policy () Claim Third party () Reporting Only
() Claim OD/ TP at other workshop ()


Sketch Plan

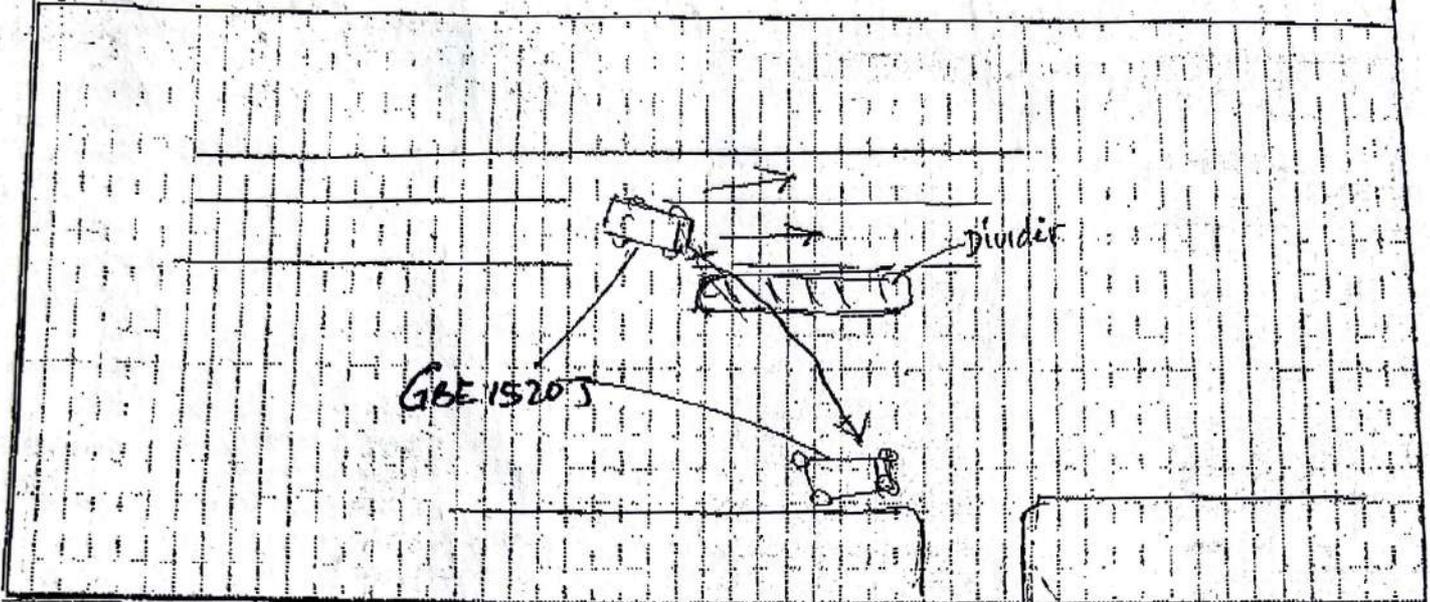

- Driving along Bidadari North Ave 4 at 35 km/h to 40 km/h.
- Not raining during time of accident.
- Lorry left front tyre puncture causing lorry to lose control.
- Lorry lose control swerve to right side, mount the divider and cross to opposite road.
- No incoming traffic on opposite road during time of accident.
- No injury to any personnel onboard or in public.
- No damage to property or vehicles of the public.

Declaration

I/We declare the foregoing particulars are true in every respect.

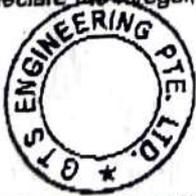

Policyholder's Signature / Date & Time

MASUD

Driver's Signature (if driver is not the policyholder) / Date & Time

02/02/23

[Handwritten Signature] 3/2/23

Witnessed by Reporting Centre Personnel (Name as in NRIC/ID card)

[Handwritten Signature]

CW