

REGISTRY

REF:

as/CTI 23 001630/Tup 3

ASSIGNMENT

From: _____ Date: _____
 Estimated cost: _____
 To inspect Vehicle No: _____
 at Workshop no: _____
 of _____
 Insured: _____
 Policy No: _____
 Claims No: _____
 Sum Insured: _____ Excess: 9500
 (Client's Record)
 Make of Veh: _____

(Policy Condition)
 Remark: The veh had commenced its repair at the time of inspection.
 Bel. or Market Value: 956K.
 IDAC Accident Report _____ Consistent? : Yes or No
 GIA / PR Seat: _____ Consistent? : Yes or No
 Est. Repairs: _____ days Res.: Yes or No
 Turn Sum: _____ % 3 Val.: Yes or No
 CA / REV / REP. / 24 HRS
 Date: _____ Person Contacted: _____ Vehicle: IN / OUT
MAIN.

Date / Time	Action / Instruction

Veh No: SJV 2019A Yr Regn: 2016 / Jan.
 Type: Car / M.Cycle / Bus / Van / Lorry / Taxi / Prime Mover /
 Truck / Trailer or _____
 Make: Volvo S60 Cross Country c.c. 1969.
 Colour _____ A/C: Insured / Std / NI / NA
 Sp. Reading 107891 T/Radio: Insured / Std / NI / NA
 Eng/No: _____
 C/No: SVI FH61166 2000499.
 Gen. Cond: Good / Fair / Poor / Burnt
 Steering: In order / Jammed / Leaked / Burnt or _____
 Brakes: In order / Jammed / Leaked / Burnt or _____
 Modl: Nil / S/S rim / STD A/Rim or _____
 Tyre Size: F: 235 / 40 R 20
 R: ~ ~
EX / DUN / EXNOVA / GY / FS / LIZA / MIC / DHTSU / PIR / SUMI /
 TOYO / YOKO, or _____
 Front _____ Rear _____
 R/Bal. 6 mm R/Bal. 6 mm
 L/Bal. 6 mm L/Bal. 6 mm
 D.O.A. _____ D.O.L. 14/2/23
 Survey held at Century Motor
 Des. of Damages: FR / Rear / O/S / N/S / U/C / Rooftop or _____

The U/C / Chassis frame / Body Structure affected due to collision.

Date/Time, File Pass to? ☐ : Preli. Report
☐ : Final Report

1) _____
 Date/Time, File Return to?
 2) _____

Days Of Repair: _____
 Resurvey No. of Trip: _____

Add Fee: ☐ : Site Insp (\$)
☐ : Interview (\$)
☐ : Tech. Insp (\$)

Survey Fee: _____
 Transportation: _____
 S + RS. \$
 Price

Printed Report at: _____
 Long & Short / L & S

CENTURY MOTORS PRIVATE LIMITED
INCHCAPE CENTRE
SINGAPORE 128462

Insurer Reference: SJV2019A

Repairer Reference: CM128/SJV2019A

Date calculated: 11/02/2023 10:50 AM

Full Report
Registration: SJV2019A
Printed: 11/02/2023 10:50 AM

Summary Information

Claim

Location:	Singapore (SG)	Work Provider:	China Taiping Insurance (Singapore) Pte Ltd
Printed by:	Eddy Ramli	Currency:	SGD
Claim Reference:	SJV2019A	Date of Incident:	25/01/23
Estimated Repair Time:	7	Hire Car Start:	
Actual Repair Days:	7	Hire Car End:	

Vehicle Details

Vehicle

Manufacturer:	VOLVO
Model:	S 60 (F)
Sub Model:	CROSS COUNTRY
Model Sheet Number:	41 42 06
Registration:	SJV2019A
VIN number:	YV1FH61C6G2000499
Odometer:	

Model Specs

2.5 LTR 187KW	TWO COAT METALLIC	PREPARE OFF VEHICLE
---------------	-------------------	---------------------

Taufik 97495749 / 67583561
Not Advised

14/2/23 @ 420 pm

Ex \$500

taufik@lkhant.com

7-8 days

p/p Resurvey before paint.

LKK Auto Consultants hence notify the Repairer of the following:

- To resurvey before/after spray painting
- To display damaged part(s) during resurvey
- Parts prices are subject to confirmation
- Third party survey is on a "Without Prejudice" basis
- No illegal modification(s) is allowed
- Supplementary item(s) must be resurveyed and is subject to final approval from Insurance Company

Acknowledged by Repairer

Signature:

Date:

Vehicle Condition


Vehicle Status

Pre-Accident Damage:

Date of Inspection:

Damage Areas

All ☐
Underbody ☐

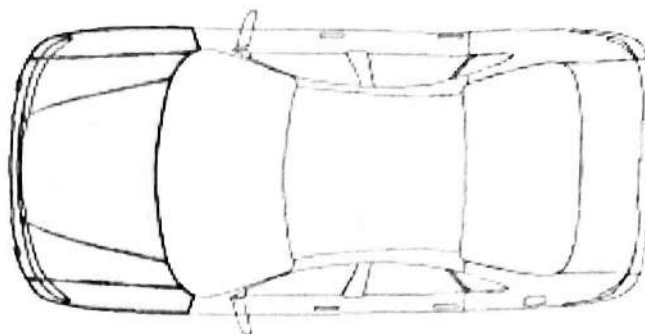

Tyres Condition

Tyre Brand	Tread (Left Middle), mm	Tread (Left Outer), mm	Tread (Left Inner), mm	Tread (Right Inner), mm	Tread (Right Outer), mm	Tread (Right Middle), mm	Condition
------------	-------------------------	------------------------	------------------------	-------------------------	-------------------------	--------------------------	-----------

Spare Tyre Brand	Tread (Spare), mm
------------------	-------------------

Labour

Code	Description	Time Base 10 WU/h	Price = 42.00 SGD/h	
			WU	Price SGD
80203-0	R + R FRONT PANEL		17.0	71.40
86170-2)	R + R FR/BUMPER ATTACHED PARTS		9.0	37.80
81110-3 ZAX	R + R FRONT LOWER CROSSMEMBER		3.0	12.60
35202-2	ADJUST HEADLAMPS		1.0	4.20
82311-3)	RENEW RADIATOR GRILLE		2.0	8.40
82151-2	RENEW BONNET		6.0	25.20
	INCLUDES: R + R BONNET, CONVERT ATTACHED PARTS, RENEW IF NECESSARY			
82131-2	ADJUST BONNET		3.0	12.60
82111-2)	REMOVE AND REFIT L/BONNET LOCK		2.0	8.40
82112-2)	REMOVE AND REFIT R/BONNET LOCK		2.0	8.40
82125-2)	RENEW BONNET HOOK		1.0	4.20
82114-2)	R + R LEFT BONNET HINGE		1.0	4.20
82114-2)	R + R RIGHT BONNET HINGE		1.0	4.20
80201-0)	R + R LEFT FRONT WING (L/HEADLAMP AND FRONT BUMPER REMOVED) INCLUDES: WHEELHOUSE LINER AND COVER		6.0	25.20

Code	Description	WU	Price SGD
80201-0)	LEFT A-PILLAR REMOVE AND REFIT R + R RIGHT FRONT WING (R/HEADLAMP AND FRONT BUMPER REMOVED) INCLUDES: WHEELHOUSE LINER AND COVER	6.0	25.20
87003-2	RIGHT A-PILLAR REMOVE AND REFIT	8.0	33.60
26118-2	DRAIN + REFILL AIR CONDITIONING	2.0	8.40
26104-2)	R + R OVERFLOW TANK	16.0	67.20
26121-3	R + R RADIATOR	1.0	4.20
26121-3	R + R L/RADIATOR BRACKET	1.0	4.20
87408-2)	R + R R/RADIATOR BRACKET	2.0	8.40
26111-3	R + R CONDENSER	3.0	12.60
NO NUMBER	R + R LOWER RADIATOR HOSE	2.0	8.40
NO NUMBER	R + R EXPANSION TANK HOSES	3.0	12.60
25102-2	R + R RADIATOR FILLER HOSE	15.0	63.00
25101-2)	R + R INTAKE MANIFOLD	5.0	21.00
	R + R LOWER INTAKE MANIFOLD		
Labour Cost		Hrs	WU
Panel / Mechanical Labour		11.80	118.0
Total of Labour			495.60

Paint

Paint Work	SYSTEM AZT	Time Basis 10 WU/h
Code	Description - TWO COAT METALLIC	WU Price SGD
	BONNET NEW PART PAINTING	27.0
	L/F WING NEW PART PAINTING	9.0
	R/F WING NEW PART PAINTING	9.0
	FRT LWR CROSSMEMBER SURFACE PAINT	4.0
	FRONT BUMPER NEW PART PAINT K1R	14.0
	FRT TOWING EYE COVER NEW PART PAINT K1R	3.0

Paint Material Per Part

Code	Description	Price SGD
0471	BONNET NEW PART PAINTING	89.78
0741	L/F WING NEW PART PAINTING	16.00
0742	R/F WING NEW PART PAINTING	16.00
1001	FRT LWR CROSSMEMBER SURFACE PAINT	2.99
0283	FRONT BUMPER NEW PART PAINT K1R	72.32
0303	FRT TOWING EYE COVER NEW PART PAINT K1R	0.49

Labour Cost - Paint

Factor	42.00 SGD/h	Hrs	WU	Price SGD
Time Paint			66.0	
Preparation Main Work Metal		2.50	25.0	105.00
Preparation Comp. Work Plastic		0.50	5.0	21.00
Total	10 WU/h	9.60	96.0	403.20

Material Cost - Paint

New Part Painting	
New Part Painting - Plastic K1R	
Surface-/Blend Paint	
Material-constant Metal Preparation	
Material-constant Plastic	
Total	

Price SGD
121.78
72.81
2.99
28.60
9.00
235.18

Spare Parts

					prices as at 2001-01-01	
Code	Description	Part Number	Part Source		Price SGD	
0283	FRONT BUMPER	39844037	dl ✓	Original	dl ✓	2,730.00
0303	FRT TOWING EYE COVER	39820294	mis ✓	Original		55.00
0317	L/OUT BUMPER BRACKET	31425463	?	Original		75.00
0318	R/OUT BUMPER BRACKET	31425464	?	Original		75.00
0325	L/F BUMPER BRACKET	31323840	?	Original		80.00
0326	R/F BUMPER BRACKET	31323841	?	Original		80.00
0340	FRT BUMPER ABSORBER	31323835	?	Original		130.00
0341	FRT PROTECTIVE COVER	31463379	?	Original		150.00
0347	LWR PROTECTION PLATE	31323860	?	Original		330.00
0349	FRT WIND DEFLECTOR	31353303	?	Original		55.00
0351	L/F LOWER AIR GUIDE	30796086	?	Original		55.00
0352	R/F LOWER AIR GUIDE	30796087	?	Original		55.00
0369	FRONT AIR CHANNEL	31455704	?	Original		710.00
0371	FRT LOWER AIR GUIDE	31386719	?	Original		140.00
0377	L/F BUMPER COVER	31323846	?	Original		55.00
0378	R/F BUMPER COVER	31323847	dl ✓	Original		55.00
0379	FRONT LWR AIR GRILLE	31323858	cu ✓	Original		100.00
0393	L/F SPOILER	31353654	?	Original		140.00
0394	R/F SPOILER	31353655	dl ✓	Original		140.00
0410	GRILLE	31425492	cu ✓	Original		720.00
0441	L/AIR FUNNEL	31353295	?	Original		45.00
0442	R/AIR FUNNEL	31383123	?	Original		45.00
0443	L/F AIR DUCT	31353046	?	Original		55.00
0444	R/F AIR DUCT	31353047	?	Original		55.00
0445	L/F WIND DEFLECTOR	31323558	?	Original		110.00
0446	R/F WIND DEFLECTOR	31323559	?	Original		110.00
0447	L/AIR DUCT	30796474	?	Original		45.00
0449	R/LWR AIR CHANNEL	31353296	?	Original		45.00
0451	L/LWR AIR CHANNEL	30796474	?	Original		45.00
0471	BONNET	31335883	bt ✓	Original		2,970.00
0475	L/BONNET HINGE	31385812	bt ✓	Original		150.00
0476	R/BONNET HINGE	31385813	bt ✓	Original		150.00
0481	BONNET INSULATION	31402486	dl ✓	Original		340.00
0494	SAFETY LATCH	31425791	dl ✓	Original		150.00
0503	L/BONNET LOCK	31425974	bt ✓	Original		180.00
0504	R/BONNET LOCK	31425974	bt ✓	Original		180.00
0561	LEFT HEADLAMP ASSY	31420117	cu ✓	Original		1,360.00
0562	RIGHT HEADLAMP ASSY	31420118	cu ✓	Original		1,360.00
0695	L/DAYT RUNNING LAMP	31420395	?	Original		520.00
0696	R/DAYT RUNNING LAMP	31420396	?	Original		520.00
0741	L/F WING	31416822	Rx	Original		990.00
0742	R/F WING	31416823	bt ✓	Original		990.00
1001	FRT LWR CROSSMEMBER	31349058	?	Original		900.00
1017	FRONT PANEL	31416114	bt ✓	Original		2,340.00

Code	Description	Part Number	Part Source	Price SGD
4465	CONDENSER	31332027	Original	1,480.00
7743	L/LWR RADIATOR BRKT	30636949	Original	20.00
7744	R/LWR RADIATOR BRKT	30636949	Original	20.00
7751	UPPER RADIATOR SEAL	30794579	Original	55.00
7755	L/UPP RADIATOR BRKT	30723366	Original	20.00
7756	R/UPP RADIATOR BRKT	30723367	Original	20.00
7760	RADIATOR EXCH	31368082	Original	910.00
7769	L/RADIATOR BRACKET	31261931	Original	100.00
7770	R/RADIATOR BRACKET	31261932	Original	100.00
7772	RADIATOR SUPPORT	31368100	Original	100.00
7773	LWR RADIATOR HOSE	32249278	Original	170.00
7774	EXPANSION TANK HOSE	31261523	Original	100.00
7775	AIR OUTLET HOSE	31368663	Original	70.00
7776	UPPER RADIATOR HOSE	32249282	Original	130.00
7787	EXPANSION TANK	31200320	Original	120.00
7789	ELECTRIC FAN	31686806	Original	910.00
8142	AIR FLOW METER	31380619	Original	870.00
8149	THROTTLE VALVE HSG	31331277	Original	840.00
8221	INTAKE MANIFOLD	31319804	Original	1,060.00
8222	LWR INTAKE MANIFOLD	31338645	Original	1,020.00
8391	AIR FILTER ASSY	30677718	Original	440.00
8741	INTERCOOLER	31338476	Original	940.00
8743	L/LWR AIR HOSE	31319748	Original	385.00
8744	R/LWR AIR HOSE	31370211	Original	385.00
8746	R/CTR AIR HOSE	31319578	Original	295.00
8748	R/UPP AIR HOSE	30636785	Original	180.00

f: OEM Parts
n: Non-OEM Parts
u: Used parts

Savings
Subtotal

0.00
30,325.00

Total

30,325.00

Extras

Code	Description	Price SGD
1000	NUM PLATE AND HOLDER FRONT	35.00*
1001	AIRCON GAS FRONT	60.00*
1002	RADIATOR COOLANT FRONT	30.00*
1003	SUNDRY FRONT	85.00*
Total Extras		210.00

Final Calculation

	SGD	SGD
Parts	30,325.00	
Total Parts		30,325.00
Labour Time Base 10 WU/h		
Total 118.0 WU X 42.00 SGD/h	495.60	
Total of Labour		495.60
Total Of Extras		210.00
Paint Work Time Base 10 WU/h		
Labour Cost 96.0 WU X 42.00 SGD/h	403.20	
Material Cost	235.18	
Total Paint Including Material		638.38
Repair Cost Excludes GST		31,668.98
GST (+8.0%)		2,533.52
Repair Cost Included GST		34,202.50

Comments

* - USER SUPPLIED DATA
NN - NO MANUFACTURERS CODE EXISTS
) - WU PARTIAL INCL IN OTHER POSITIONS

Assessment Note

No assessment notes entered.

> Back to OneMotoring

Enquire PARF/COE Rebate for Registered Vehicle

Vehicle Owner Particulars

Owner ID Type: Singapore NRIC
Owner ID: 873G

Vehicle Details

Vehicle No.: SJV2019A
Vehicle to be Exported: No
Intended Deregistration Date: 11 Feb 2023
Vehicle Make: VOLVO
Vehicle Model: S60 CROSS COUNTRY T5 (A)
Primary Colour: Black
Manufacturing Year: 2015
Engine No.: B5254T124795635
Chassis No.: YV1FH61C6G2000499
Maximum Power Output: 187.0 kW (250 bhp)
Open Market Value: \$28,261.00
Original Registration Date: 07 Jan 2016
First Registration Date: 07 Jan 2016
Transfer Count: 1
Actual ARF Paid: \$31,566.00

Intended PARF Rebate Details

PARF Eligibility: Yes
PARF Eligibility Expiry Date: 06 Jan 2026
PARF Rebate Amount: \$18,939.00

Intended COE Rebate Details

COE Expiry Date: 06 Jan 2026
COE Category: B - Car above 1600cc or 97kW (130bhp)
COE Period(Years): 10
QP Paid: \$55,001.00
COE Rebate Amount: \$15,968.00
Total Rebate Amount: \$34,907.00

The information contained herein is correct as at 11 Feb 2023

OK