

ASS. RE BY

REF:

CC3/MS23004154/Rya3


795A

ASSIGNMENT

From: _____ Date: _____
Estimate Cost: _____
OD / TP / WS / TP RES / OD RES / EVA / INV / MV
To Inspect Vehicle No: SKG 5686X
at Workshop m/s Volkswagen
of 247, Maxima 1.0
Insured: AMS
Policy No. _____
Claims No. _____
Sum Insured: _____ Excess: _____
(Client's Record)
Make of Veh: _____

(Policy Condition)

Remark: The veh had commenced its
repair at the time of inspection.

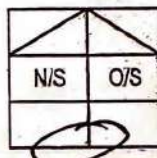

Bal. or Market Value: 150K
IDAC Accident Report: Consistent? : Yes or No
GIA / PR Seen: Consistent? : Yes or No
Est. Repairs: _____ days Res.: Yes or No
Turn Sum: _____ % 3 Val.: Yes or No

CA / REV / REP. / 24 HRS

Date: _____ Person Contacted: _____

Vehicle: IN / OUT

Veh No: SKG 5686X Yr Regn: 2010 SEP
Type: Car / M. Cycle / Bus / Van / Lorry / Taxi / Prime Mover /
Truck / Trailer or
Make: SKODA SUPRE 2.0 LK 1984
Colour: Grey A/C: Insured / Std / Nil / NA
Sp. Reading: 40476 T/Radio: Insured / Std / Nil / NA
Eng/No: _____
C/No: TMB BM 7NP 2L 706 2944
Gen. Cond: Good / Fair / Poor / Burnt
Steering: In order / Jammed / Leaked / Burnt or
Brake: In order / Jammed / Leaked / Burnt or
Modi: Nil / SRim / STD A/Rim or
Tyre Size: F: 235/40 R19
R: _____
BS / DUN / EXNOVA / GY / FS / LIZA / MIC / OHTSU / PIR / SUMI /
TOYO / YOKO or

Front	Rear
R/Bal. <u>6</u> mm	R/Bal. <u>6</u> mm
L/Bal. <u>6</u> mm	L/Bal. <u>6</u> mm
D.O.A. <u>14/04/23</u>	D.O.I. <u>28/04/23</u>
Survey held at <u>Volkswagen</u>	
Des. of Damages: Fnt / <u>Rear</u> / O/S / N/S / U/C / Rooftop or	

The U/C / Chassis frame / Body Structure affected due to collision.

Date / Time : Action / Instruction

REPAIR LIMIT - 93K

Date/Time, File Pass to?

☐ : Prel. Report

1)

☐ : Final Report

Date/Time, File Return to?

2)

Days Of Repair: _____

Resurvey No. of Trip: _____

Survey Fee: _____

Transportation: _____

Report Format : _____

Lump Sum / I.B.I: (\$) _____

Add Fee: ☐ : Site Insp (\$ _____)

☐ : Interview (\$ _____)

☐ : Tech. Invs (\$ _____)

☐ : Weekend (\$ _____)

Photos

Others

TOTAL

ODA Centre Singapore

Leng Kee Rd
Singapore 159104
Z. Reg. No.: 199101494Z
ST No.: M200985052



28/4/2023 - 4p.m.
(LKK)

Quotation

Non binding - Preview

Page

1/2

Company
ALLIANZ
INSURANCE SINGAPORE PTE. LTD.
79 ROBINSON ROAD
#09-01
SINGAPORE 068897

Customer Details:
Mr
KOH
KAR BOON
(XU JIAWEN)
BLK 70 JALAN MATA AYER
#05-24
SINGAPORE 757488

Document no.
Document date 21-04-2023
Customer no. 5211052769
Customer GST-ID 201903913C
Dealer 30001
Job order number 2023010635/ 1
Job order date 20-04-2023
Service Advisor SHU SHI TANG

License plate	Model code	First registration	VIN	Model	Mileage
SKG5686X	3V35RDL0	04-09-2020	TMBBM7NP2L7062944	Superb L&K 2.0 I TSI 140kW DSG MY20	26,974

Position no.	Description	Quantity	Unit	Unit price excl. GST	Tax code	Total amount excl. GST	Total amount incl. GST
9801B004	B&P CHECK SHORT CIRCUIT/HARNESS REPAIR				#6	280.00	302.40
9801B005	B&P DIAGNOSIS AND PROGRAMMING				#6	480.00	518.40
3V5853098B 2ZZ	Unbekannt	1	pcs.	403.84	10.00% #6	363.46	392.54
	BOOT LID MLDG CHROM						
566827566B	Button For	1	pcs.	1,420.70	10.00% #6	1,278.63	1,380.92
	PUSH BUTTON WITH CAMERA						
3V5807421	Cover For	1	pcs.	2,395.78	10.00% #6	2,156.20	2,328.70
	REAR BUMPER						
3V5807441	Cover For	1	pcs.	32.33	10.00% #6	29.10	31.43
	TOWING COVER						
3V5919487	Sensor Bracket	1	pcs.	37.33	10.00% #6	33.60	36.29
3V5919488	Sensor Bracket	1	pcs.	37.33	10.00% #6	33.60	36.29
3V5807521H 9B9	Spoiler	1	pcs.	428.85	10.00% #6	385.97	416.85
3V5919485A	Sensor Bracket	1	pcs.	47.92	10.00% #6	43.13	46.58
3V5919485	Sensor Bracket	1	pcs.	47.92	10.00% #6	43.13	46.58
3V5919486	Sensor Bracket	1	pcs.	47.92	10.00% #6	43.13	46.58
3V5919486A	Sensor Bracket	1	pcs.	47.92	10.00% #6	43.13	46.58
3V5807863	Retaining	1	pcs.	97.81	10.00% #6	88.03	95.07
	BUMPER CTR BRACKET						
3V5807393A	Guide Piec	1	pcs.	59.92	10.00% #6	53.93	58.24
	LHR BUMPER BRACKET (UPPER)						
3V5807394A	Guide Piec	1	pcs.	59.92	10.00% #6	53.93	58.24
	RHR BUMPER BRACKET (UPPER)						
3V5807393	Guide Piec	1	pcs.	59.92	10.00% #6	53.93	58.24
	LHR BUMPER BRACKET (SIDE)						
3V5807394	Guide Piec	1	pcs.	59.92	10.00% #6	53.93	58.24
	RHR BUMPER BRACKET (SIDE)						
3V5061197	Protective	1	pcs.	141.70	10.00% #6	127.53	137.73
	BUMPER FILM						
	LABOUR	3	pcs.	720.00	#6	2,160.00	2,332.80
	SPRAY PAINT	3	pcs.	680.00	#6	2,040.00	2,203.20
	ALLIANZ DIRECT SETTLEMENT						
	DOA: 14/4/2023						
	TP VEH: GBL8039A						
	SURVEY BY:						

Quotation valid till 27-04-2023

Tax Code	Labour	Material	Material Discount	GST %	GST	Total Discount	Total amount excl. GST	Total amount incl. GST
#6	760.00	9,084.36	542.67	8%	787.55	542.67	9,844.36	10,631.91
Total	760.00	9,084.36	542.67		787.55	542.67	9,844.36	10,631.91

KODA Centre Singapore

Leng Kee Rd
Singapore 159104
Biz. Reg. No.: 199101494Z
GST No.: M200985052



Quotation

Non binding - Preview

Page

2/2

Company
ALLIANZ
INSURANCE SINGAPORE PTE. LTD.
79 ROBINSON ROAD
#09-01
SINGAPORE 068897

Customer Details:
Mr
KOH
KAR BOON
(XU JIAWEN)
BLK 70 JALAN MATA AYER
#05-24
SINGAPORE 757488

Document no.
Document date
Customer no.
Customer GST-ID
Dealer
Job order number
Job order date
Service Advisor

21-04-2023
5211052769
201903913C
30001
2023010635/ 1
20-04-2023
SHU SHI TANG

License plate	Model code	First registration	VIN	Model	Mileage
SKG5686X	3V35RDL0	04-09-2020	TMBBM7NP2L7062944	Superb L&K 2.0 TSI 140kW DSG MY20	26,974

Customer

Service Advisor

—VISIT OUR WEBSITE: aftersales.vw.com.sg (for online service appointments) and volkswagen.com.sg and www.skoda.com.sg (for additional services, products and promotions).—

All invoices are denominated in SGD, unless otherwise stated.

LKK Auto Consultants hence notify
the Repairer of the following:

- To resurvey before/after spray painting
- To display damaged part(s) during resurvey
- Parts prices are subject to confirmation
- Third party survey is on a "Without Prejudice" basis
- No illegal modification(s) is allowed
- Supplementary item(s) must be resurveyed and is subject to final approval from Insurance Company

Acknowledged by Repairer

Signature:

Date:

Rame
Hp 90010068
3 days
28/04/23 @ 1620
Resy before paint
booth lid to be advised

Enquire PARF/COE Rebate for Registered Vehicle

Vehicle Owner Particulars

Owner ID Type: Singapore NRIC
Owner ID: 795A

Vehicle Details

Vehicle No.: SKG5686X
Vehicle to be Exported: No
Intended Deregistration Date: 01 May 2023
Vehicle Make: SKODA
Vehicle Model: SUPERB 2.0 L&K
Primary Colour: Grey
Manufacturing Year: 2020
Engine No.: CZP241639
Chassis No.: TMBBM7NP2L7062944
Maximum Power Output: 140.0 kW (187 bhp)
Open Market Value: \$32,130.00
Original Registration Date: 04 Sep 2020
First Registration Date: 04 Sep 2020
Transfer Count: 0
Actual ARF Paid: \$36,982.00

Intended PARF Rebate Details

PARF Eligibility: Yes
PARF Eligibility Expiry Date: 03 Sep 2030
PARF Rebate Amount: \$27,736.00

Intended COE Rebate Details

COE Expiry Date: 03 Sep 2030
COE Category: B - Car above 1600cc or 97kW (130bhp)
COE Period(Years): 10
QP Paid: \$38,802.00
COE Rebate Amount: \$28,476.00
Total Rebate Amount: \$56,212.00

Skoda Superb 2.0A TSI Laurin & Klement

Overview

[Financial](#)[Insurance](#)[Accessories](#)[Similar](#)[Research](#)[Photos](#)**Price****\$158,000****Depreciation** ⓘ

\$17,730 /yr

[View models with similar depre](#)**Reg Date**

25-Feb-2021

(7yrs 9mths 24days COE left)

Mileage

26,000 km (11.9k /yr)

Manufactured ⓘ

2020

Road Tax ⓘ

\$1,194 /yr

Transmission

Auto

Dereg Value ⓘ\$68,074 as of today ([change](#))**OMV** ⓘ

\$33,211

COE ⓘ

\$50,100

ARF ⓘ

\$38,496

Engine Cap

1,984 cc

Power

140.0 kW (187 bhp)

Curb Weight ⓘ

1,535 kg

No. of Owners ⓘ

1

Type of Vehicle[Luxury Sedan](#)