

ASS. REC. BY:

REF: 6721

Kenneth

ASSIGNMENT

From:

Date:

Estimated Cost:

OD / TP / WS / TP RES / QD RES / EVA / INV / MV

To Inspect Vehicle No:

at Workshop m/s

of

Insured:

Policy No.

Claims No.

Sum Insured:

Excess:

(Client's Record)

Make of Veh:

(Policy Condition)

Remark: The veh had commenced its repair at the time of inspection.

Bal. or Market Value:

IDAC Accident Report:

GIA / PR Seen:

Est. Repairs:

Lum Sum:

CA / REV / REP. / 24 HRS

Date:

Person Contacted:

Vehicle: IN / OUT

Date / Time

Action / Instruction

FR bumper modified

Date/Time, File Pass to?

☐

: Prell. Report

☐

: Final Report

Date/Time, File Return to?

Days Of Repair:

Resurvey No. of Trip:

Add Fee:

☐

: Site Insp (\$

☐

: Interview (\$

☐

: Tech Invs (\$

☐

: Weekend (\$

Survey Fee:

Transportation:

S + RS. SI

F. 100%

Others

TOTAL

Report Format:

Lump Sum / I.B.I. (\$

Veh No:

S48 30T Yr Regn: 10. 14

Type: M.Car / M.Cycle / Bus / Van / Lorry / Taxi / Prime Mover /

Truck / Trailer or

Make:

M. E250

c.c

1991

Colour

M. Red

A/C:

Insured / Std / NI / NA

Sp. Reading

196521

T/Radio:

Insured / Std / NI / NA

Eng/No:

C/No:

WDD 2120362 A 9 65843

Gen. Cohd: Good / Fair / Poor / Burnt

Steering: Inorder / Jammed / Leaked / Burnt or

Brake: Inorder / Jammed / Leaked / Burnt or

Mod: Nil / SRM / STD A/Rlm or

Tyre Size:

F:

235/35 ZR19

R:

275/30 ZR19

BS / DUN / EXNOVA / GY / FS / LIZA / MIC / OHTSU / PIR / SUMI /

TOYO / YOKO or

Front

R/Bal.

7

mm

L/Bal.

7

mm

D.O.A.

27/4/23

Survey held at

Des. of Damages: Frt / Rear / OIS / N/S / UIC / Rooftop or

The U/C / Chassis frame / Body Structure affected due to collision.

A314-32
11ac
Giga
Eth
Insured
EngNo:

SGZ30T
00/china

Cheng Hoe Motor Pte Ltd
#01-374/382, Blk 1019, Yishun
Industrial Park A
768761

Insurer Reference: SGZ30T
Repairer Reference: A0494
Date calculated: 05/05/2023 12:43 PM

Full Report
Registration: SGZ30T
Printed: 05/05/2023 12:43 PM

Summary Information

Claim

Location:	Singapore (SG)	Work Provider:	China Taiping Insurance (Singapore) Pte Ltd
Printed by:	CHENG HOE	Currency:	SGD
Claim Reference:	SGZ30T	Date of Incident:	27/04/23
Estimated Repair Time:		Hire Car Start:	
Actual Repair Days:		Hire Car End:	

Vehicle Details

Vehicle

Manufacturer:	MERCEDES-BENZ
Model:	E-CLASS (W212)
Sub Model:	E 250
Model Sheet Number:	03 EE 47
Registration:	SGZ30T
VIN number:	WDD2120362A965843
Odometer:	

Model Specs

FR PRODUCTION START	8.5-/9 J X 18 ALLOY	MOD PACK 13/2	MODIFICAT PACK 13/3
MODEL 2014	FRT COLLISION ALARM	RADIATOR SHROUD	EL DRIVE POS SELECT
PARKTRONIC	LOAD COMPARTMENT BOX	AUDIO 20 CD CHANGER	MULTIMEDIA INTERFACE
GRILLE WITH STAR	SMART LIGHT SYSTEM	LAMINATED GLASS	ELECTRIC BOOTLID REL
HEATED WASHER UNIT	LEATHER TRIM	SUNBLIND TWO-PIECE	EQUIPMENT AVANTGARDE
MEMORY PACKAGE	DIPPING MIRROR	S-WDW ROLLER BLIND	WOOD TRIM ASH TREE
REM RELEASE FUEL CAP	KEYLESS GO	PELVIS BAG	RR SCREEN SUN BLIND
ECO START/STOP	STRG COLUMN SHIFT	EMISSION STD EURO 6	7 SPEED AUTOMATIC
DIRECT CONTROL SUSP	245/40-/265/35 YR 18	SPARE WHEEL	FUEL TANK 80 LTR
HD COOLING	TWO COAT METALLIC	COMPRESSOR VARIABLE	PREPARE OFF VEHICLE
CLEAR COAT HARD			

NOT Withheld
6/1 Rmp &
Recovery After Pain
Ex @ 3750k

7 days

LKK Auto Consultants hence notify
the Repairer of the following:

- To resurvey before/after spray painting
- To display damaged part(s) during resurvey
- Parts prices are subject to confirmation
- Third party survey is on a "Without Prejudice" basis
- No illegal modification(s) is allowed
- Supplementary item(s) must be resurveyed and is subject to final approval from Insurance Company

Acknowledged by Repairer
Signature:
Date:


Vehicle Condition

Vehicle Status

Pre-Accident Damage:
Date of Inspection:

Damage Areas

All ☒
Underbody ☐

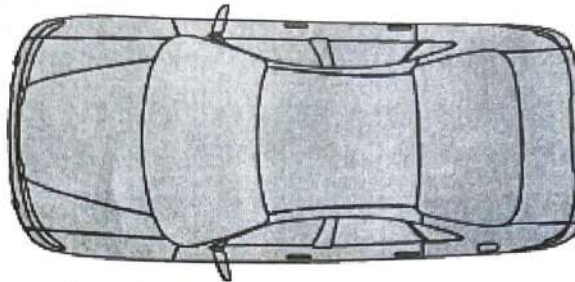

Tyres Condition

Tyre Brand	Tread (Left Middle), mm	Tread (Left Outer), mm	Tread (Left Inner), mm	Tread (Right Inner), mm	Tread (Right Outer), mm	Tread (Right Middle), mm	Condition
------------	----------------------------	---------------------------	---------------------------	----------------------------	----------------------------	-----------------------------	-----------

Spare Tyre Brand	Tread (Spare), mm
------------------	-------------------

Labour

Code	Description	Time Base 10 WU/h	Price = 42.00 SGD/h	
			WU	Price SGD
54-1011 01	SHORT TEST INCLUDES: CONNECT + DISCONNECT STAR DIAGNOSIS, PRINT DATA, DELETE ERROR MEMORY		3.0	12.60
54-7989 03	R + R BATTERY EARTH CABLE (WHEN DISCONNECTING ELECTRIC PLUG AND SOCKET CONNECTIONS)		2.0	8.40
61-1069 02	R + R COMPL LWR ENGINE COMPARTMENT COVER		3.0	12.60
88-2534 02	REPAIR OF R/Front-END DAMAGE INCLUDES: RENEW BUMPER, BONNET, RADIATOR COVER, FRONT WING AND FRONT LAMP UNIT, CONVERT ATTACHED PARTS, RENEW IF NECESSARY		34.0	142.80
88-1348 02	ADDITIONAL FOR RENEW FRONT BUMPER (VEHICLE WITH PARK ASSISTENT)		2.0	8.40
88-2647 02	R + R L/BONNET HINGE		4.0	16.80
88-2652 02	R + R R/BONNET HINGE		4.0	16.80

	Description	WU	Price SGD
8-2620 02	R + R FRONT BONNET CABLE		
80-1331 01	R + R ATTACHED PARTS OF THE ENGINE COMPARTMENT FOR RENEWAL OF THE FRONT MODULE	3.0	12.60
	INCLUDES: R + R ALL ATTACHED PARTS IN THE REPAIR SECTION	11.0	46.20
62-1269 01	R + R OR RENEW FRONT CROSSMEMBER AND R/TRUSSING BETWEEN WHEELHOUSES		
	INCLUDES: R + R CENTRE TRUSSING, RENEW IF NECESSARY	12.0	50.40
82-7200 02)	R + R WASHER RESERVOIR		
	INCLUDES: CONVERT FILLER PIPE AND PUMP	5.0	21.00
82-7215 02	ADDITION TO R + R FRONT SCREEN WASHER RESERVOIR	1.0	4.20
	(VEHICLE WITH HEATED WASHER SYSTEM)		
	INCLUDES: R + R HEAT EXCHANGER		
97-2500 ZAX	CAVITY PROTECTION (ADD/WORK)	2.0	8.40
97-2500 ZAX	APPLY RUST PROOFING ON R/F SIDE MEMBER	2.0	8.40
97-2500 ZAX	R/F UPPER SIDEMEMBER CAVITY PROTECTION	2.0	8.40
09-8200 02	RENEW FRONT INTAKE AIR CHANNEL	2.0	8.40
20-3865 01	R + R RADIATOR		
	INCLUDES: R + R CENTRE STIFFENING, FAN UNIT AND CHARGE AIR COOLER	19.0	79.80
20-4302 01	ADDITION TO R + R RADIATOR		
	(VEHICLE WITH INTEGRATED RAD GRILLE)	8.0	33.60
20-5410 01	R + R OVERFLOW TANK	6.0	25.20
83-6543 01)	R + R AIR CONDITIONING CONDENSER	9.0	37.80
20-1140 01	DRAIN + REFILL COOLANT, LEAKAGE TEST	5.0	21.00
83-1762 02	AIR-CONDITIONING SYSTEM DRAIN FLUID, EXHAUST, REFILL, PRESSURE TEST		
	(FOR ALL WORK ON THE SYSTEM)	9.0	37.80
20-1190 01	ADDITION TO COOLING SYSTEM DRAIN /REFILL		
	(VEHICLE WITH SEPARATE LOW TEMPERATURE-WATER CYCLE)	3.0	12.60
1112	R/F WHEELHOUSE ASSY REPAIR	20	30.0* 126.00
1156	R/UPP W-HOUSE S-MEMB REPAIR		30.0* 7 126.00
1004	CHECK WIRING REPAIR		20.0* ✓ 84.00
1112	R/F WHEELHOUSE ASSY CAVITY PROTECTION		
1156	R/UPP W-HOUSE S-MEMB CAVITY PROTECTION		

Labour Cost

Panel / Mechanical Labour

Hrs 22.50 WU 225.0

945.00

Total of Labour

945.00

Paint

Paint Work

Code	Description - CLEAR COAT HARD	Time Basis 10 WU/h	WU	Price SGD
98-1731 01	FRONT BUMPER COVER PAINTING		11.0	46.20
98-1710 ZAX	L/F OUTER SENSOR PAINTING		1.0	4.20
98-1710 ZAX	R/F OUTER SENSOR PAINTING		1.0	4.20
98-2805 01	BONNET PAINTING STAGE I-M		26.0	109.20
98-2615 01	R/F WING PAINTING STAGE I-M		6.0	25.20

Work
de

Description - CLEAR COAT HARD

LE 0930
LE 1001
98-3095 01
98-4316 01
98-2005 01
98-1340 01
98-1356 01

		Time Basis 10 WU/h	
		WU	Price SGD
CTR FRT REINF PAINTING STAGE I-J		3.0	12.60
FRT LWR CROSSMEMBER PAINTING STAGE I-J		1.0	4.20
R/F WHEELHOUSE ASSY PAINTING STAGE I-J		3.0	12.60
RIGHT FRONT DOOR PAINTING STAGE II		11.0	46.20
PAINT REMOVED SMALL PARTS		3.0	12.60
PREPARATION WORK FOR TWO COAT PAINTING OF FITTED BODY PARTS		15.0	63.00
ADD/WORK FOR PLASTIC PARTS		3.0	12.60

Total Paint

Hrs 8.40 WU 84.0 Price SGD 352.80

Material Cost - Paint

	Price SGD
Surface-/Blend Paint	21.60
Inner Part Painting	55.35
New Part Painting (Bold)	175.50
Material-constant Metal	13.47
Total	265.92

Spare Parts

				prices as at 2015-06-01
Code	Description	Part Number	Part Source	Price SGD
4465	AIR CON CONDENSER	204 500 0654	Original	Per 745.00 ✓
7753	AIR GUIDE	212 505 2930	Original	CM 40.00 ✓
8385	AIR INTAKE HOSE	274 090 0400	Original	De 116.00 ✓
0430	BADGE BRACKET	218 888 0060	Original	R 50.00 ✓
0289	BLIND RIVET	003 990 9497		0.00 ✓
0471	BONNET	212 880 0357	Original	Bu 1,295.00 ✓
0500	BONNET CABLE	212 880 0559	Original	60.00 ✓
0494	BONNET CATCH	212 880 0064	Original	Di 48.00 ✓
0432	BONNET EMBLEM	212 817 0316	Original	De 42.00 ✓
0481	CTR BONNET INSULAT	212 682 0126	Original	Deform 175.00 ✓
0930	CTR FRT REINF	212 620 1100	Original	R 105.00 ✓
7787	EXPANSION TANK	204 500 0749	Original	85.00 ✓
7788	EXPANSION TANK PIPE	212 501 5782	Original	43.00 ✓
7789	FAN UNIT	204 500 0393	Original	980.00 ✓
1033	FRONT BONNET SEAL	212 887 0298	Original	35.00 ✓
0283	FRONT BUMPER COVER	212 880	Original	CM 790.00 ✓
		3000649999		
0305	FRONT BUMPER GRILLE	212 885 0522	Original	Di 65.00 ✓
0989	FRONT CTR RETAINER	212 898 0232	Original	CM 45.00 ✓
8779	FRONT GRILLE PANEL	212 520 3923	Original	175.00 ✓
0431	FRONT STAR EMBLEM	000 817 1016	Original	Di 80.00 ✓
0377	FRT BUMPER W/ HARNESS	212 540 2700	Original	135.00 ✓
0340	FRT CTR BUMPER REINF	212 885 4265	Original	R 68.00 ✓
1001	FRT LWR CROSSMEMBER	212 620 1500	Original	345.00 ✓
0347	FRT LWR IMPACT DAMP	212 885 4065	Original	96.00 ✓
0260	FRT NO PLATE BACKG	212 885 1181	Original	R 134.00 ✓
0415	GRILLE TRIM FRAME	212 885 2574	Original	CM 235.00 ✓

	Description	Part Number	Part Source	Price SGD
1002	H/LAMP ECU 1	PARTS	Original	650.00 ?
1003	H/LAMP ECU 2	PARTS	Original	510.00 ?
0497	L/F BONNET STRUT	204 880 0029	Original	80.00 ?
1191	L/F BUMPER ABSORBER	212 620 0995	Original	188.00 ?
0361	L/F OUTER SENSOR	000 905 5604 9999	Original	105.00 ?
0515	L/LOWER LATCH	204 880 0260	Original	28.00 ?
0413	L/LWR GRILLE MLDG	212 885 2521	Original	28.00 ?
7776	L/RADIATOR HOSE	204 501 8782	Original	82.00 ?
0507	L/SPRING ELEMENT	204 880 0127	Original	15.00 ?
7781	L/UPPER BEARING	169 504 0114	Original	13.00 ?
0503	L/UPPER LATCH	212 880 0060	Original	53.00 ?
0411	L/UPP GRILLE MLDG	212 885 2321	Original	28.00 ?
0475	LEFT BONNET HINGE	204 880 0128	Original	98.00 ?
0561	LEFT HEADLAMP ASSY	212 820 2539	Original	2,600.00 ?
7752	LOWER AIR GUIDE	212 505 3230	Original	65.00 ?
9643	LOW TONE HORN	007 542 7020	Original	130.00 ?
0498	R/F BONNET STRUT	204 880 0029	Original	80.00 ?
0344	R/F BUMPER CARRIER	212 885 3865	Original	65.00 ?
0836	R/F BUMPER COVER	212 885 2822	Original	30.00 ?
0312	R/F COVER STRIPE	212 885 3021	Original	70.00 ?
0304	R/F OUT BUMP GRILLE	212 885 2022	Original	38.00 ?
0362	R/F OUTER SENSOR	000 905 5604 9999	Original	105.00 ?
1188	R/F UPP REINF	212 620 4700	Original	195.00 ?
0840	R/F WHEELHOUSE COVER	212 690 6230	Original	120.00 ?
0842	R/F W-HOUSE CVR REAR	212 690 6530	Original	130.00 ?
0742	R/F WING	212 880 1218	Original	545.00 ?
0516	R/LOWER LATCH	204 880 0260	Original	28.00 ?
0414	R/LWR GRILLE MLDG	212 885 2621	Original	28.00 ?
0288	R/OUTER GUIDE RAIL	212 881 0206	Original	20.00 ?
7773	R/RADIATOR HOSE	204 501 9482	Original	50.00 ?
1180	R/REINFORCEMENT	212 620 0285	Original	38.00 ?
0508	R/SPRING ELEMENT	204 880 0127	Original	15.00 ?
7782	R/UPPER BEARING	169 504 0114	Original	13.00 ?
0504	R/UPPER LATCH	212 880 0060	Original	53.00 ?
0412	R/UPP GRILLE MLDG	212 885 2421	Original	28.00 ?
0406	RAD GRILLE BRACKET	212 880 1403	Original	180.00 ?
0437	RAD GRILLE COVER	212 885 0622	Original	125.00 ?
7761	RADIATOR	099 500 6203	Original	780.00 ?
0405	RADIATOR GRILLE SUPP	212 885 1400	Original	105.00 ?
0476	RIGHT BONNET HINGE	204 880 0228	Original	98.00 ?
0562	RIGHT HEADLAMP ASSY	212 820 2639	Original	2,600.00 ?
0299	TOWING EYE COVER	212 885 0526 9999	Original	48.00 X
7751	UPPER AIR GUIDE	212 500 0455	Original	90.00 ?

f: OEM Parts
n: Non-OEM Parts
u: Used parts

Savings
Subtotal
Fixed Sundry Parts Price
Total

0.00
16,337.00
100.00
16,437.00

Extras

Code	Description	Price SGD
1000	FRT NO.PLATE	35.00*
1001	1UNIT COOLANT	30.00*

**Description
Total Extras**

**Price SGD
65.00**

Final Calculation

	SGD	SGD
parts		
Fixed Sundry Parts Price	16,337.00	
Total Parts	100.00	16,437.00
Labour Time Base 10 WU/h		
Total 225.0 WU X 42.00 SGD/h	945.00	
Total of Labour		945.00
Additional Costs		
Rustproofing		
Rate 6.0 WU X 42.00 SGD/h	25.20	
Total Of Additional Costs		25.20
Total Of Extras		65.00
Paint Work Time Base 10 WU/h		
Labour Cost 84.0 WU X 42.00 SGD/h	352.80	
Material Cost	265.92	
Total Paint Including Material		618.72
Repair Cost Excludes GST		18,090.92
GST (+8.0%)		1,447.27
Repair Cost Included GST		19,538.19

Comments

* - USER SUPPLIED DATA
 NN - NO MANUFACTURERS CODE EXISTS
) - WU PARTIAL INCL IN OTHER POSITIONS

Assessment Note

No assessment notes entered.

to OneMotoring

PARF/COE Rebate for Registered Vehicle

Vehicle Owner Particulars

Owner ID Type:
Owner ID:
Vehicle Details
Vehicle No.:
Vehicle to be Exported:
Intended Deregistration Date:
Vehicle Make:
Vehicle Model:
Primary Colour:
Manufacturing Year:
Engine No.:
Chassis No.:
Maximum Power Output:
Open Market Value:
Original Registration Date:
First Registration Date:
Transfer Count:
Actual ARF Paid:
Intended PARF Rebate Details
PARF Eligibility:
PARF Eligibility Expiry Date:
PARF Rebate Amount:
Intended COE Rebate Details
COE Expiry Date:
COE Category:
COE Period(Years):
QP Paid:
COE Rebate Amount:
Total Rebate Amount:

Singapore NRIC
190I

SGZ30T

No

27 Apr 2023

MERCEDES BENZ

E250 SEDAN (R18)

Red

2014

27492030144920

WDD2120362A965843

155.0 kW (207 bhp)

\$49,580.00

01 Oct 2014

01 Oct 2014

1

\$56,412.00

Yes

30 Sep 2024

\$31,026.00

30 Sep 2024

B - Car above 1600cc or 97kW (130bhp)

10

\$73,010.00

\$10,403.00

\$41,429.00

The information contained herein is correct as at 27 Apr 2023

OK

CHENG HOE MOTOR PTE LTD[768761]
TIME: 27/04/2023 18:20 (SGT)
BY: CHIONG BENG CHOON
27/04/2023 18:20 (SGT)

SINGAPORE ACCIDENT STATEMENT

IMPORTANT NOTICE

1. Please report correctly the details of the accident to speed up the claims process.
2. This Form must be completed by the Policyholder and/or the Actual Driver.
3. Information provided must be as truthful and accurate as possible. Any wilful misrepresentation or withholding of material facts may allow insurance companies to repudiate policy liability.
4. The issue and acceptance of this Form by insurance companies is not an admission of policy liability on the part of the insurance companies.
5. Any false reporting may be referred to the Police for investigation.
6. This report will be forwarded by the insurers of the GIA Records Management Centre established by the General Insurance Association of Singapore (GIA) for archiving and that copies of this report will, for a fee, be made available upon application by interested parties.
7. By the lodgement of this report to the insurers, you hereby consent to the archiving of this report at the centre and to copies of the report being made available aforesaid.

ACCIDENT STATEMENT

Date of Submission 27/04/2023 18:20 (SGT)
Reported by Both Policyholder and Actual Driver
Date of Accident 27/04/2023 09:32 (SGT)
Exact Location of Accident Singapore
Additional Location Information PIE
Country/State of Loss Singapore

DETAILS OF OWN VEHICLE

Vehicle Registration Number SGZ30T

INSURED/POLICYHOLDER

Is company? No
Name Of Registered Owner KWEK MEOW LANG
NRIC No SXXXX190I
Email Address kwekmis@gmail.com
Mobile Phone No (Phone) +65-97391983
Alternative Phone No 1 +65-97846662
Alternative Phone No 2 +65-90671111

VEHICLE PARTICULARS

Manufacturer Mercedes
Model E250
Variant -
Exact purpose for which vehicle was being used at time of accident Private use
Are you claiming under your own insurance policy for repair to your vehicle? Yes
Vehicle Category Private car
Transmission Auto
CC 1991

INSURANCE COMPANY

Name of Insurance Company China Taiping Insurance (Singapore) Pte. Ltd.
Policy Number / Cover Note Number DMPCSNW00052762302

DRIVER

Name of Driver TAN PEI SHYAN FELICIA
NRIC No SXXXX722C
Date Of Birth 11/05/1996

circumstance of the Accident

NOTE: PLEASE TAKE NOTE THAT YOUR INSURER HAVE 14 DAYS TIME FRAME for you to submit OWN DAMAGE

Claim under your Own Comprehensive policy. Pls check your policy for more information.

☒ Claim Own Policy

() Claim Third party

() Reporting Only

☒ Claim OD/ TP at other workshop ()

Sketch Plan

A: SGZ 30T
(alone)

B: SE 8088T
(alone)

PE

Vehicle No: SGZ 30T (China)

Date & Time: 27/04/2023 @ 0932

(clear/dry)

I was checking out for traffic on the left, intend to filter to the left lane. When I turn back to the front, was shocked to realise m/car SE8088T stop in front, tried to e-brake but couldn't in time. The front RH portion of my vehicle have collided onto the rear LH portion of SE8088T. No one was injured.

Declaration

I/We declare the foregoing particulars are true in every respect.

Policyholder's Signature / Date & Time

Driver's Signature (If driver is not the policyholder) / Date & Time

Witnessed by Reporting Centre Personnel
(Name as in NRIC/ID card) (YS)