

ASS. REC. BY:

REF: CTZ1

Kenneth

ASSIGNMENT

From: _____ Date: _____

Estimated Cost: _____

OD / TP / WS / TP RES / OD RES / EVA / INV / MY

To Inspect Vehicle No: _____

at Workshop m/s _____

of _____

Insured: _____

Policy No. _____

Claims No. _____

Sum Insured: _____

Excess: _____

(Client's Record)

Make of Veh: _____

(Policy Condition)

Remark: The veh had commenced its repair at the time of inspection.

Bal. or Market Value: 879K

IDAC Accident Rpt: _____

Consistent? : Yes or No

GIA / PR Seen: _____

Consistent? : Yes or No

Est. Repairs: 36 days

Res.: Yes or No

Lum Sum: 20 %

3 Val.: Yes or No

CA / REV / REP. / 24 HRS

Date: _____

Person Contacted: _____

Vehicle: IN / OUT

Veh No: SD E 284Yr Regn: 04, 18

Type: M.Car / M.Cycle / Bus / Van / Lorry / Taxi / Prime Mover /

Truck / Trailer or

Make: Toy Estimoc.c. 2362Colour: M.P. White

A/C: Insured / Std / NI / NA

Sp. Reading: _____

T/Radio: Insured / Std / NI / NA

Eng/No: _____

C/No: _____

Gen. Cohd: Good / Fair / Poor / BurntSteering: Inorder / Jammed / Leaked / Burnt orBrake: Inorder / Jammed / Leaked / Burnt orModi: Nil / S/Rim / STOAR/Rim or

Tyre Size: F: _____

R: _____

BS / DUN / EXNOVA / GY / FS / LIZA / MIC / OHTSU / PIR / SUMI /

TOYO / YOKO or

Front

Rear

R/Bal. 8 mmR/Bal. 8 mmL/Bal. 8 mmL/Bal. 8 mmD.O.A. 5/5/23D.O.I. 31/5/2023

Survey held at _____

Des. of Damages: Frt / Rear / O/S / N/S / UIC / Rooftop or

FR & O/S body

The UIC / Chassis frame & Body Structure affected due to collision. ✓

Date / Time

Action / Instruction

Date/Time, File Pass to?

☐

: Prell. Report

1)

☐

: Final Report

Date/Time, File Return to?

2)

Days Of Repair: _____

Resurvey No. of Trip: _____

Survey Fee: _____

Transportation: _____

Add Fee: ☐

: Site Insp (\$ _____)

☐

: Interview (\$ _____)

☐

: Tech Invs (\$ _____)

☐

: Weekend (\$ _____)

: Fuel

: Others

Report Format :

Lump Sum / I.B.I. (\$ _____)

TOTAL

Lai Huat (Meng Kee) Motor Pte Ltd
160 Sin Ming Drive, #04-01, #04-02 &
#07-03, Sin Ming Autocity
575722

Insurer Reference:

Repairer Reference: 73584

Date calculated: 31/05/2023 10:30 AM

Full Report

Registration: SDE 28Y

Printed: 31/05/2023 10:31 AM

Summary Information

Claim

Location:	Singapore (SG)	Work Provider:	China Taiping Insurance (Singapore) Pte Ltd
Printed by:	Jenny Lim	Currency:	SGD
Claim Reference:		Date of Incident:	05/05/23
Estimated Repair Time:		Hire Car Start:	
Actual Repair Days:		Hire Car End:	

Vehicle Details

Vehicle

Manufacturer:	TOYOTA
Model:	ESTIMA
Sub Model:	BASE MODEL
Model Sheet Number:	70 M2 01
Registration:	SDE 28Y
VIN number:	
Odometer:	

Model Specs

FROM 07.2015	XENON HEADLAMPS	ELECT SLIDING DOORS	2.4 LTR 117/125 KW
GEARBOX CVT	ELECT GLASS SUNROOF	TRIM AERAS	TWO COAT METALLIC
PREPARE OFF VEHICLE			

Not Authorised
1/1/23 @
Permy After Paint
Ex @ 500k
36 days

LKK Auto Consultants hence notify
the Repairer of the following:

- To resurvey before/after spray painting
- To display damaged part(s) during resurvey
- Parts prices are subject to confirmation
- Third party survey is on a "Without Prejudice" basis
- No illegal modification(s) is allowed
- Supplementary item(s) must be resurveyed and
is subject to final approval from Insurance Company

Acknowledged by Repairer

Signature:

Date:


Vehicle Condition

Vehicle Status

Pre-Accident Damage:
Date of Inspection:

Damage Areas

All ☐
Underbody ☐

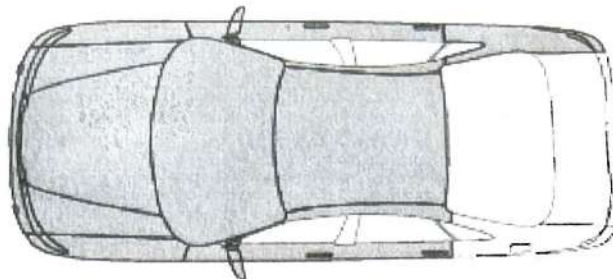

Tyres Condition

Type Brand	Tread (Left Middle), mm	Tread (Left Outer), mm	Tread (Left Inner), mm	Tread (Right Inner), mm	Tread (Right Outer), mm	Tread (Right Middle), mm	Condition
------------	----------------------------	---------------------------	---------------------------	----------------------------	----------------------------	-----------------------------	-----------

Spare Tyre Brand Tread (Spare), mm

Labour

Code	Description	Time Base 10 WU/h	Price = 42.00 SGD/h	
			WU	Price SGD
NO NUMBER	ADJUST HEADLAMPS		2.0	8.40
043273C ZAX	ADJUST FRONT TOE		1.0	4.20
043283E ZAX	ADJUST FRONT CAMBER (COMPOSITE WORK)		3.0	12.60
B100 ZAX	R + R LEFT FRONT WING (FRT BUMPER AND L/HEADLAMP ASSY REMOVED)		4.0	16.80
B100 ZAX	R + R RIGHT FRONT WING (FRT BUMPER AND R/HEADLAMP ASSY REMOVED)		4.0	16.80
B110) ZAX	RENEW LEFT FRONT WING (REMOVED)		2.0	8.40
B110) ZAX	RENEW RIGHT FRONT WING (REMOVED)		2.0	8.40
NO NUMBER	RENEW FRONT CROSSMEMBER INCLUDES: R + R FRONT BUMPER, HEADLAMPS, RADIATOR AND ALL ATTACHED PARTS IN THE REPAIR SECTION		87.0	365.40
B125 ZAX	RENEW FRONT LOCK CARRIER		6.0	25.20
B131) ZAX	RENEW R/HEADLAMP PANEL		3.0	12.60
NO NUMBER	RENEW R/F SIDEMEMBER (COMP-WORK)		23.0	96.60
NO NUMBER	R + R L/R SILL MOULDING		2.0	8.40
NO NUMBER	RENEW L/F SIDEMEMBER SECTION (COMP WORK)		9.0	37.80

	Description	WU	Price SGD
B020) ZAX	RENEW FRONT BUMPER (REMOVED) INCLUDES: REQUIRED ATTACHED PARTS. REMOVE AND REFIT	6.0	25.20
NO NUMBER	R + R FRONT BUMPER ATTACHED PARTS	2.0	8.40
B010) ZAX	R + R FRONT BUMPER REINFORCEMENT	2.0	8.40
B030 ZAX	R + R RADIATOR GRILLE	2.0	8.40
B020) ZAX	RENEW FRONT BUMPER REINFORCEMENT	1.0	4.20
B040) ZAX	R + R HEADLAMPS	1.0	4.20
B070 ZAX	RENEW BONNET	4.0	16.80
B080 ZAX	R + R L/BONNET HINGE	1.0	4.20
B080 ZAX	R + R R/BONNET HINGE	1.0	4.20
NO NUMBER	R + R FUSE BOX	2.0	8.40
B085) ZAX	R + R SCUTTLE PANEL GRILLE INCLUDES: R + R BOTH WIPER ARMS	4.0	16.80
NO NUMBER	R + R LOWER COWL COVER (WATER BOX COVER REMOVED) INCLUDES: MOTOR AND WIPER LINKAGE REMOVE AND REFIT	4.0	16.80
G010 ZAX	R + R WINDSCREEN	36.0	151.20
B085) ZAX	R + R COWL PANEL TRIM	2.0	8.40
B191 ZAX	RENEW L/A-PILLAR CPL	82.0	344.40
B191 ZAX	RENEW R/A-PILLAR CPL	82.0	344.40
NO NUMBER	RENEW LEFT FRONT INNER DOOR PILLAR	9.0	37.80
NO NUMBER	RENEW RIGHT FRONT INNER DOOR PILLAR	9.0	37.80
B230 ZAX	R + R L/B-PILLAR INCLUDES: SEAT BELT AND ALL TRIMS IN REPAIR AREA REMOVE AND REFIT	77.0	323.40
B230 ZAX	R + R R/B-PILLAR INCLUDES: SEAT BELT AND ALL TRIMS IN REPAIR AREA REMOVE AND REFIT	77.0	323.40
NO NUMBER	R + R LEFT FRONT QTR WINDOW GLASS	7.0	29.40
NO NUMBER	R + R RIGHT FRONT QTR WINDOW GLASS	7.0	29.40
B210 ZAX	RENEW LEFT FRONT DOOR INCLUDES: R + R AND ALIGN LEFT FRONT DOOR, CONVERT ATTACHED PARTS, RENEW IF NECESSARY	29.0	121.80
B210 ZAX	RENEW RIGHT FRONT DOOR INCLUDES: R + R AND ALIGN RIGHT FRONT DOOR, CONVERT ATTACHED PARTS, RENEW IF NECESSARY	29.0	121.80
B215 ZAX	R + R LEFT REAR DOOR	6.0	25.20
B216 ZAX	RENEW RIGHT REAR DOOR INCLUDES: R + R AND ALIGN RIGHT REAR DOOR, CONVERT ATTACHED PARTS, RENEW IF NECESSARY	34.0	142.80
NO NUMBER	RENEW L/UPPER SIDE PANEL	30.0	126.00
B270) ZAX	REPLACE R/R LOWER WING	72.0	302.40
B380 ZAX	R + R TAILGATE INCLUDES: ALIGN TAILGATE	12.0	50.40
B400 ZAX	R + R L/TAILGATE HINGE	1.0	4.20

	Description	WU	Price SGD
B400 ZAX	R + R RIGHT TAILGATE HINGE	1.0	4.20
NO NUMBER	R + R TAILGATE TRIM/S	1.0	4.20
B410) ZAX	R + R REAR BUMPER	4.0	16.80
B420) ZAX	RENEW REAR BUMPER (REMOVED)	1.0	4.20
	INCLUDES: R + R NECESSARY ATTACHED PARTS		
751351 ZAX	R + R LEFT ROOF MOULDING	4.0	16.80
751351 ZAX	R + R RIGHT ROOF MOULDING	4.0	16.80
G030 ZAX	R + R LEFT REAR SIDE WINDOW GLASS	18.0	75.60
G030 ZAX	R + R RIGHT REAR SIDE WINDOW GLASS	18.0	75.60
NO NUMBER	RENEW LEFT INNER UPPER SIDE PANEL	16.0	67.20
NO NUMBER	RENEW RIGHT INNER UPPER SIDE PANEL	16.0	67.20
B260 ZAX	RENEW ROOF CPL	47.0	197.40
B430 ZAX	R + R HEADLINING	9.0	37.80
614511) ZAX	R + R FRONT TILT SUNROOF	6.0	25.20
NO NUMBER	R + R SUNROOF FRAME (HEADLINING REMOVED)	11.0	46.20
NO NUMBER	RENEW FRT ROOF CROSS MEMBER (COMP-WORK)	5.0	21.00
NO NUMBER	RENEW RR CTR ROOF CROSSMEMBER (ADD/WORK)	4.0	16.80
M230 ZAX	R + R INSTRUMENT PANEL	22.0	92.40
	INCLUDES: R + R STEERING WHEEL, AIRBAG, COMBINATION SWITCH, INSTRUMENTS, CENTRE CONSOLE AND NECESSARY ATTACHED PARTS AND TRIMS		
883401) ZAX	R + R AIR CONDITIONING COMPRESSOR ADD	5.0	21.00
NO NUMBER	RENEW CONDENSER / COMPRESSOR PIPE	4.0	16.80
M010 ZAX	DRAIN + REFILL AIR CONDITIONING	4.0	16.80
NO NUMBER	R + R CONDENSER/EVAPORATOR PIPE	4.0	16.80
160101) ZAX	R + R UPPER RADIATOR HOSE	1.0	4.20
160111) ZAX	R + R LOWER RADIATOR HOSE	1.0	4.20
M010 ZAX	RENEW RADIATOR AND CONDENSER	25.0	105.00
171021 ZAX	R + R AIR FILTER CPL	7.0	29.40
160251 ZAX	R + R DRIVE BELT	6.0	25.20
170031 ZAX	R + R HEAT SHIELD PANEL	3.0	12.60
271011) ZAX	R + R ALTERNATOR	3.0	12.60
111261) ZAX	R + R REAR ENGINE SUPPORT	4.0	16.80
NO NUMBER	DISS/ASS GEARBOX MOUNTING	2.0	8.40
M170 ZAX	R + R STEERING COLUMN ASSY	16.0	67.20
450251) ZAX	R + R LEFT TIE ROD END	4.0	16.80
450251) ZAX	R + R RIGHT TIE ROD END	4.0	16.80
895131) ZAX	R + R UPPER LAMBDA PROBE	4.0	16.80
420018) ZAX	R + R LEFT FRONT WHEEL	1.0	4.20
420018) ZAX	R + R RIGHT FRONT WHEEL	1.0	4.20
420018) ZAX	R + R FRONT WHEEL	1.0	4.20
420091A ZAX	R + R L/F WHEEL/TYRE	3.0	12.60
420091A ZAX	R + R R/F WHEEL/TYRE	3.0	12.60
473101) ZAX	DETACH + REFIT FRONT BRAKE CALIPER	3.0	12.60
431451) ZAX	DISS/ASS L/F UPPER SUSPENSION STRUT	1.0	4.20
431451) ZAX	DISS/ASS R/F UPPER SUSPENSION STRUT	1.0	4.20
431151A) ZAX	DISS/ASS FRONT LOWER SUSPENSION STRUT	3.0	12.60
431151A) ZAX	RENEW FRONT SHOCK ABSORBER (ADD/WORK)	6.0	25.20
431451A) ZAX	R + R SPRING STRUT (ADD/WORK)	1.0	4.20
431151) ZAX	RENEW LEFT FRONT SHOCK ABSORBER	3.0	12.60
	DOES NOT INCLUDE: VEHICLE ALIGNMENT		
431151) ZAX	RENEW RIGHT FRONT SHOCK ABSORBER	3.0	12.60

Description

WU Price SGD

NO NUMBER	DOES NOT INCLUDE: VEHICLE ALIGNMENT R + R FRONT AXLE CARRIER (FRONT WHEELS REMOVED)	22.0	92.40
	INCLUDES: R + R FRONT EXHAUST, POWER STEERING, FRONT STABILIZER, FRONT TRAILING ARMS AND BRACKETS, BLEED POWER STEERING		
431401) ZAX	DOES NOT INCLUDE: ALIGN FRONT DETACH + REFIT L/TIE ROD END	3.0	12.60
431401) ZAX	DETACH + REFIT R/TIE ROD END	3.0	12.60
434211) ZAX	RENEW LEFT FRONT STEERING KNUCKLE DOES NOT INCLUDE: VEHICLE ALIGNMENT	6.0	25.20
434021) ZAX	R + R RIGHT FRONT WHEEL HUB	5.0	21.00
431401) ZAX	R + R RIGHT CONTROL ARM BALL JOINT	3.0	12.60
NN	L/SILL MLDG R&R / NEW PARTS	5.0*	21.00
NN	R/SILL MLDG R&R / NEW PARTS	5.0*	21.00
1201	L/F SIDE MEMBER CPL REPAIR	30.0*	126.00
2287	L/B-PILLAR REINF REPAIR	20.0*	84.00
2288	R/B-PILLAR REINF REPAIR	20.0*	84.00
2413	R/F ROOF RAIL CAP REPAIR	10.0*	42.00
2414	R/F ROOF RAIL CAP REPAIR	10.0*	42.00
Labour Cost		Hrs	WU
Panel / Mechanical Labour		123.10	1,231.0
Alignment			
Measuring Work		0.40	4.0
Total of Labour			5,187.00

Paint

Paint Work

SYSTEM AZT

Time Basis 10 WU/h

Code	Description - TWO COAT METALLIC	WU	Price SGD
	BONNET NEW PART PAINTING	15.0	
	L/F WING NEW PART PAINTING	10.0	
	R/F WING NEW PART PAINTING	10.0	
	FRT LWR COVER PANEL SURFACE PAINT	5.0	
	FRT UPP END PANEL SURFACE PAINT	4.0	
	L/F PANEL SURFACE PAINT	4.0	
	R/F PANEL SURFACE PAINT	4.0	
	R/F SIDE MEMBER CPL SURFACE PAINT	4.0	
	FRONT PANEL SURFACE PAINT	4.0	
	LEFT FRONT DOOR NEW PART PAINTING	18.0	
	RIGHT FRONT DOOR NEW PART PAINTING	18.0	
	R/R DOOR NEW PART PAINTING	20.0	
	LEFT A-PILLAR NEW PART PAINTING	10.0	
	RIGHT A-PILLAR NEW PART PAINTING	10.0	
	L/INNER DOOR PILLAR SURFACE PAINT	4.0	
	R/INNER DOOR PILLAR SURFACE PAINT	4.0	
	LEFT B-PILLAR NEW PART PAINTING	19.0	
	RIGHT B-PILLAR NEW PART PAINTING	19.0	
	ROOF NEW PART PAINTING	41.0	
	FRT ROOF CROSSMEMBER SURFACE PAINT	4.0	
	L/R UPPER SIDE PANEL NEW PART PAINTING	22.0	
	R/R UPPER SIDE PANEL NEW PART PAINTING	22.0	

Paint Work
Code

SYSTEM AZT

Description - TWO COAT METALLIC

Time Basis 10 WU/h
WU Price SGD

R/R LOWER SIDE PANEL NEW PART PAINTING	22.0
L/SIDE PANEL/ROOF SURFACE PAINT	4.0
R/S-PANEL/BOOT LID SURFACE PAINT	4.0
FRONT BUMPER NEW PART PAINT K1R	13.0
REAR BUMPER NEW PART PAINT K1R	11.0
L/F SIDE MEMBER CPL SURFACE PAINT	4.0
L/B-PILLAR REINF SURFACE PAINT	4.0
R/B-PILLAR REINF SURFACE PAINT	4.0
R/R CORNER PILLAR SURFACE PAINT	4.0
L/R BUMPER PANEL SURFACE PAINT PLAST.	3.0
R/R BUMPER PANEL SURFACE PAINT PLAST.	3.0
L/R LOWER SIDE PANEL SURFACE PAINT	6.0

Paint Material Per Part

Code	Description	Price SGD
0471	BONNET NEW PART PAINTING	42.83
0741	L/F WING NEW PART PAINTING	21.67
0742	R/F WING NEW PART PAINTING	21.67
1001	FRT LWR COVER PANEL SURFACE PAINT	5.23
1017	FRT UPP END PANEL SURFACE PAINT	1.74
1187	L/F PANEL SURFACE PAINT	1.49
1188	R/F PANEL SURFACE PAINT	1.49
1202	R/F SIDE MEMBER CPL SURFACE PAINT	2.24
1442	FRONT PANEL SURFACE PAINT	3.24
1481	LEFT FRONT DOOR NEW PART PAINTING	52.63
1482	RIGHT FRONT DOOR NEW PART PAINTING	52.63
1782	R/R DOOR NEW PART PAINTING	63.47
2237	LEFT A-PILLAR NEW PART PAINTING	4.95
2238	RIGHT A-PILLAR NEW PART PAINTING	4.95
2247	L/INNER DOOR PILLAR SURFACE PAINT	2.49
2248	R/INNER DOOR PILLAR SURFACE PAINT	2.49
2279	LEFT B-PILLAR NEW PART PAINTING	22.00
2280	RIGHT B-PILLAR NEW PART PAINTING	22.00
2351	ROOF NEW PART PAINTING	62.70
2385	FRT ROOF CROSSMEMBER SURFACE PAINT	2.74
3481	L/R UPPER SIDE PANEL NEW PART PAINTING	27.50
3482	R/R UPPER SIDE PANEL NEW PART PAINTING	27.50
3486	R/R LOWER SIDE PANEL NEW PART PAINTING	28.05
4107	L/SIDE PANEL/ROOF SURFACE PAINT	2.99
4108	R/S-PANEL/BOOT LID SURFACE PAINT	2.99
0283	FRONT BUMPER NEW PART PAINT K1R	62.98
2583	REAR BUMPER NEW PART PAINT K1R	52.15
1201	L/F SIDE MEMBER CPL SURFACE PAINT	2.24
2287	L/B-PILLAR REINF SURFACE PAINT	2.49
2288	R/B-PILLAR REINF SURFACE PAINT	2.49
2346	R/R CORNER PILLAR SURFACE PAINT	1.49
3417	L/R BUMPER PANEL SURFACE PAINT PLAST.	0.37
3418	R/R BUMPER PANEL SURFACE PAINT PLAST.	0.37
3485	L/R LOWER SIDE PANEL SURFACE PAINT	12.70

Labour Cost - Paint

Factor	42.00 SGD/h	Hrs	WU	Price SGD
Time Paint			353.0	
Preparation Main Work Metal		2.50	25.0	105.00
Preparation Comp. Work Plastic		0.50	5.0	21.00
Total	10 WU/h	38.30	383.0	1,608.60

Material Cost - Paint

	Price SGD
New Part Painting	454.55
New Part Painting - Plastic K1R	115.13
Surface-/Blend Paint	50.54
Surface Painting Plastic	0.74
Material-constant Metal Preparation	28.60
Material-constant Plastic	9.00
Total	658.56

Spare Parts

prices as at 2015-06-01/01

Code	Description	Part Number	Part Source	Price SGD
1414	ABSORBER	56115 30100		0.00
1415	ABSORBER	56116 22050		0.00
9986	AIR CON COOLANT	NO NUMBER	Original	50.00
8391	AIR FILTER ASSY	17700 28312	Original	350.00
1430	AIR GUIDE TRIM	55708 28160	Original	250.00
8411	ALTERNATOR	27060 28341	OEM	450.00
1336	BATTERY BRACKET	74451 52010	Original	10.00
1332	BATTERY TRAY	74410 28010	Original	35.00
0471	BONNET	53301 28110	Original	220.00
0493	BONNET LOCK	53510 28090	Original	50.00
1007	BRACE PANEL	SUPPORT	Original	50.00
4456	COMPRESSOR CPL	88310 28610	OEM	380.00
4465	CONDENSER	88460 42100	Original	550.00
9987	COOLANT/ANTIFREEZE	NO NUMBER	Original	22.00
2384	CTR ROOF	63142 28090	Original	250.00
	CROSSMEMBER			
7835	DRIVE BELT TENSIONER	16620 0H021	Original	170.00
7011	ENG SUPPORTING	51201 28281	Original	1,400.00
	FRAME			
4482	EVAPORATOR TUBE	88710 2X240	Original	350.00
7787	EXPANSION TANK	16470 28140	Original	150.00
0283	FRONT BUMPER	52119 28957	Original	280.00
1030	FRONT CROSSMEMBER	57104 12270	Original	400.00
8657	FRONT ENG BRACKET	12311 28330	Original	85.00
1442	FRONT PANEL	55700 28040	Original	450.00
2310	FRONT ROOF FRAME	63203 28191	Original	2,500.00
4481	FRONT TUBE PIPE	88711 2J340	Original	210.00
1437	FRONT WASH/WIPE	85330 21010	Original	75.00
	PUMP			
0333	FRT BUMPER ABSORBER	52611 28081	Original	38.00
0420	FRT BUMPER SUPPORT	52021 28230	Original	150.00
8665	FRT ENG RUBBER MNTG	12361 28280	Original	55.00
1001	FRT LWR COVER PANEL	53028 28050	Original	120.00
2385	FRT ROOF	63102 28040	Original	250.00
	CROSSMEMBER			

4355
0431
0410
4957
1000
8804
1001
1005
7793
0475
7065
1737
1735
2433
8632
7789
0285
7077
1655
1509
1711
1519
2427
0647
0299
0319
1661
1187
1645
7227
1453
1221
7007
7269
7271
7081
7053
1647
7131
0741
1457
2247
7759
1653
0293
3803
3481
4107
1003
8631
3861
7311
4941
7095

Description	Part Number	Part Source
FRT UPP END PANEL	53205 28170	Original
FUSE BOX	82741 28020	Original
GLOVEBOX	55550 28080C0	Original
GRILLE BADGE	75311 28330	Original
GRILLE MOULDING	53101 28381A0	Original
HEADLINING	63310 28F81E0	Original
HEAD LINING	MOONROOF	Original
HEAT SHIELD	17167 28060	Original
L/AIR GUIDE	AIRCON	Original
L/BKRT	WING	Original
L/BLOWER FAN	16361 28370	Original
L/BONNET HINGE	53420 28130	Original
L/CARRIER JOINT	43330 49215	Original
L/DOOR MIRROR	87940 28C10	Original
L/DOOR MIRROR COVER	87945 28060A1	Original
L/DRIP RAIL	76004 28010	Original
L/ENGINE SUPPORT	12304 28130	Original
L/FAN MOTOR	16363 28300	Original
L/F BUMPER COVER	52128 28430A0	Original
L/F CPL SPRING STRUT	48520 80483	Original
L/F DOOR REAR STRIP	75958 28030	Original
L/F DOOR SEAL	67862 28082	Original
L/F DOOR TRIM	67620 28D31E1	Original
L/F DOOR WINDOW	68102 28242	Original
L/F DRIP RAIL MLDG	75556 28070	Original
L/F FOG LAMP	81220 47010	Original
L/FOG LAMP COVER	52040 28010	Original
L/F OUT BUMPER BRKT	52116 28170	Original
L/F OUT WINDOW MLDG	68162 28060	Original
L/F PANEL	53203 28140	Original
L/F PROT MLDG STRIPE	75939 28020	Original
L/FR TYRE	205/65 R 16 .. H	Original
L/FR WIPER ARM	85221 28141	Original
L/F SIDE MEMBER END	57032 02010	Original
L/F S-MEMB RR REINF	51108 28040	Original
L/F STABILISER BUSH	48815 28180	Original
L/F STABI ROD	48820 02070	Original
L/F STEERING KNUCKLE	43212 78010	Original
L/F TRACK CONT ARM	48069 28140	Original
L/F UPP DOOR STRIPE	75956 28030	Original
L/F WHEEL HUB	43550 28010	Original
L/F WING	53812 28091	Original
L/F WIPER BLADE	85222 28160	Original
L/INNER DOOR PILLAR	61014 28021	Original
L/LWR RADIATOR BRKT	16535 20030	Original
L/MOULDING	75969 28020	Original
L/RAD-GRILLE BRACKET	52128 28440	Original
L/R SIDE WINDOW	62720 28321	Original
L/R UPPER SIDE PANEL	61226 28010	Original
L/SIDE PANEL/ROOF	61732 28070	Original
L/SILL MLDG	WING	Original
L/SUPPORT BRACKET	12372 28390	Original
L/S WINDOW BOND KIT	PZ491 00C1131	
L/TIE ROD BALL JOINT	45047 29195	Original
L/UPP A-PILLAR TRIM	62220 28102B0	Original
L/UPP SPRING SEAT	48471 42010	Original

	Price SGD
B1 ✓	90.00
CMA ✓	220.00
mit ✓	580.00
mit ✓	50.00
Reform ✓	220.00
✓	2,000.00
✓	700.00
Ref ✓	95.00
mit ✓	35.00
B1 ✓	45.00
mit ✓	85.00
B1 ✓	35.00
?	70.00
B1 ✓	420.00
Ref ✓	45.00
Ref ✓	50.00
?	85.00
mit ✓	180.00
mit ✓	25.00
?	175.00
Gr ✓	30.00
Na ✓	85.00
CMA ✓	850.00
Ref ✓	250.00
Ref ✓	95.00
mit ✓	90.00
mit ✓	65.00
mit ✓	35.00
Ref ✓	45.00
B1 ✓	110.00
?	25.00
Ref ✓	160.00
?	75.00
?	140.00
?	110.00
?	15.00
?	50.00
?	200.00
?	160.00
Gr ✓	30.00
?	210.00
B1 ✓	210.00
Gr ✓	45.00
B1 ✓	190.00
mit ✓	18.00
Ref ✓	25.00
mit ✓	35.00
Ref ✓	300.00
B1 ✓	450.00
B1 ✓	230.00
?	110.00
mit ✓	120.00
?	0.00
?	50.00
B1 ✓	350.00
?	16.00

	Description	Part Number	Part Source	Price SGD
91	L/UPP SUPP MOUNTING	48609 28040	Original	mi ✓ 60.00
237	LEFT A-PILLAR	61107 28040	Original	At ✓ 200.00
279	LEFT B-PILLAR	61312 28130	Original	At ✓ 200.00
4989	LEFT D-PILLAR TRIM	62472 28190EO		At ✓ 0.00
1481	LEFT FRONT DOOR	67002 28260	Original	Br ✓ 650.00
0561	LEFT HEADLAMP ASSY	81150 28F40	Original	Br ✓ 1,300.00
1523	LEFT QUARTER GLASS	62120 28182	Original	Br ✓ 220.00
8780	LOWER ENGINE	51451 28020	Original	? 55.00
	PROTECT			
9663	LOWER FUSE BOX	82663 28050	Original	CD ✓ 105.00
	COVER			
8805	LOWER HEAT SHIELD	25586 28090	Original	? 80.00
0297	LWR RADIATOR GRILLE	53112 28210	Original	mi ✓ 150.00
7773	LWR RADIATOR HOSE	16571 28060	Original	Cr ✓ 28.00
7300	POWER STEERING	45500 28170	Original	? 550.00
1527	QTR WINDOW REP KIT	08851 00020		0.00
1002	R/AIR GUIDE	AIRCON	Original	mi ✓ 35.00
1006	R/BKRT	WING	Original	At ✓ 45.00
7794	R/BLOWER FAN	16361 28380	Original	mi ✓ 85.00
0476	R/BONNET HINGE	53410 28130	Original	ni ✓ 35.00
7066	R/CARRIER JOINT	43330 49215	Original	BT ✓ 70.00
1738	R/DOOR MIRROR	87910 28C10	Original	CD ✓ 420.00
1736	R/DOOR MIRROR COVER	87915 28060A1	Original	mi ✓ 45.00
1950	R/DOOR STRIPE	75951 28031	Original	ni ✓ 23.00
2434	R/DRIP RAIL	76003 28010	Original	? 50.00
8641	R/ENGINE MOUNTING	12305 28231	Original	? 130.00
7790	R/FAN MOTOR	16363 28370	Original	mi ✓ 180.00
0286	R/F BUMPER COVER	52128 28430A0	Original	su ✓ 25.00X
7078	R/F CPL SPRING STRUT	48510 80807	Original	? 175.00
1510	R/F DOOR SEAL	67861 28082	Original	At ✓ 85.00
1520	R/F DOOR WINDOW	68101 28242	Original	At ✓ 250.00
2428	R/F DRIP RAIL MLDG	75555 28070	Original	Red ✓ 95.00
0648	R/F FOG LAMP	81210 47010	Original	mi ✓ 90.00
0300	R/FOG LAMP COVER	52030 28010	Original	mi ✓ 65.00
0320	R/F OUT BUMPER BRKT	52115 28070	Original	mi ✓ 35.00
1662	R/F OUT WINDOW MLDG	68161 28060	Original	Red ✓ 45.00
1188	R/F PANEL	53202 28140	Original	At ✓ 110.00
1646	R/F PROT MLDG STRIPE	75929 28020	Original	Red ✓ 25.00
7228	R/FR TYRE	205/65 R 16 .. H	Original	? 160.00
7202	R/FR WHEEL	42611 58021	Original	? 950.00
1454	R/FR WIPER ARM	85211 28181	Original	Red ✓ 75.00
1202	R/F SIDE MEMBER CPL	57101 28872	Original	? 450.00
2220	R/F SILL MOULDING	76903 28100A0	Original	mi ✓ 450.00
7008	R/F S-MEMB RR REINF	51107 28020	Original	? 110.00
7270	R/F STABILISER BUSH	48815 28190	Original	? 15.00
7272	R/F STABI ROD	48820 02070	Original	? 50.00
7054	R/F TRACK CONT ARM	48068 28140	Original	? 160.00
1648	R/F UPP DOOR STRIPE	75955 28030	Original	Cr ✓ 30.00
7132	R/F WHEEL HUB	43550 28010	Original	? 210.00
0742	R/F WING	53811 28091	Original	? 210.00
1458	R/F WIPER BLADE	85212 28160	Original	Cr ✓ 55.00
2248	R/INNER DOOR PILLAR	61013 28051	Original	At ✓ 190.00
7760	R/LWR RADIATOR BRKT	16535 20030	Original	mi ✓ 18.00
1654	R/MOULDING	75968 28020	Original	Red ✓ 25.00
1962	R/OUT WINDOW MLDG	68163 28040	Original	Red ✓ 50.00
0294	R/RAD-GRILLE BRACKET	52127 28440	Original	mi ✓ 35.00

Description	Part Number	Part Source	Price SGD
R/R BUMPER BRACKET	52155 28080	Original	30.00
R/R DOOR	67003 28600	Original	650.00
R/R DOOR FRAME MLDG	75765 28010	Original	20.00
R/R DOOR FRONT STRIP	75933 28030	Original	20.00
R/R DOOR REAR STRIP	75953 28031	Original	25.00
R/R DOOR STRIPE	75931 28030	Original	20.00
R/R DOOR WINDOW	68104 28281	Original	250.00
R/R INN BUMPER BRKT	52155 28090	Original	22.00
R/R LOWER SIDE PANEL	61601 28A71	Original	480.00
R/R SILL MOULDING	76905 28130A0	Original	420.00
R/R UPP DOOR STRIPE	75937 28021	Original	27.00
R/R UPPER SIDE PANEL	61225 28010	Original	450.00
R/SILL MLDG	WING	Original	110.00
R/S-PANEL/BOOT LID	61731 28050	Original	230.00
R/S WINDOW BOND KIT	PZ49I 00C1131		0.00
R/TIE ROD BALL JOINT	45046 29515	Original	50.00
R/UPP A-PILLAR TRIM	62210 28102B0	Original	350.00
R/UPP SPRING SEAT	48471 42010	Original	16.00
R/UPP SUPP MOUNTING	48609 28040	Original	60.00
RADIATOR	16400 28560	Original	550.00
RADIATOR SHROUD	16711 28430	Original	100.00
REAR BUMPER	52159 28915	Original	220.00
REAR ENG BRACKET	12321 28190	Original	55.00
REAR WASHER PUMP	85330 60160	Original	70.00
RIGHT A-PILLAR	61106 28040	Original	200.00
RIGHT B-PILLAR	61311 28130	Original	200.00
RIGHT FRONT DOOR	67001 28240	Original	650.00
RIGHT HEADLAMP ASSY	81110 28F40	Original	1,300.00
ROOF	63111 28270	Original	900.00
ROOF CARCASS	63203 28181	Original	1,600.00
RR ENGINE SUPPORT	12371 28220	Original	75.00
SUNROOF	63201 28371	Original	1,300.00
TRIM FRAME	52711 28150	Original	95.00
UPP AIR FILTER HOSE	17751 28071	Original	50.00
UPP BATTERY BRACKET	74404 28190	Original	35.00
UPPER FUSE BOX COVER	82662 28170	Original	50.00
UPPER RADIATOR HOSE	16572 28220	Original	30.00
UPP INSTR PANEL TRIM	55302 28190C0	Original	550.00
UPP RADIATOR COVER	53292 28071	Original	90.00
V-BELT	90916 02652	Original	40.00
WASHER CONTAINER	85315 28230	Original	55.00
WATER HOSE	16267 28070	Original	25.00
WINDSCREEN	56101 28550	Original	650.00

f: OEM Parts
n: Non-OEM Parts
u: Used parts

Savings
Subtotal
Fixed Sundry Parts Price

0.00
40,613.00
100.00

Total

40,713.00

Extras

Code	Description	Price SGD
1009	CHK/CLR FAULT CODES DIAGNOSTIC	80.00*
1010	IU BRACKET	12.00*
1011	BATTERY CAR	140.00*

Description
SEALANT QTR GLASS/W/S
[E]: GLOVEBOX: UPPER
Total Extras

Mr ✓ **Price SGD**
160.00*
0.00*
392.00

Final Calculation

	SGD	SGD
Parts	40,613.00	
Fixed Sundry Parts Price	100.00	
Total Parts		40,713.00
Labour Time Base 10 WU/h		
Total 1,231.0 WU X 42.00 SGD/h	5,170.20	
Alignment	16.80	
Measuring Work		5,187.00
Total of Labour		392.00
Total Of Extras		
Paint Work Time Base 10 WU/h		
Labour Cost 383.0 WU X 42.00 SGD/h	1,608.60	
Material Cost	658.56	
Total Paint Including Material		2,267.16
		48,559.16
Repair Cost Excludes GST		3,884.73
GST (+8.0%)		52,443.89
Repair Cost Included GST		

Comments

* - USER SUPPLIED DATA
NN - NO MANUFACTURERS CODE EXISTS
) - WU PARTIAL INCL IN OTHER POSITIONS

Assessment Note

No assessment notes entered.

SINGAPORE ACCIDENT STATEMENT

IMPORTANT NOTICE

1. Please report correctly the details of the accident to speed up the claims process.
2. This Form must be completed by the Policyholder and/or the Actual Driver.
3. Information provided must be as truthful and accurate as possible. Any wilful misrepresentation or withholding of material facts may allow insurance companies to repudiate policy liability.
4. The issue and acceptance of this Form by insurance companies is not an admission of policy liability on the part of the insurance companies.
5. Any false reporting may be referred to the Police for investigation.
6. This report will be forwarded by the insurers of the GIA Records Management Centre established by the General Insurance Association of Singapore (GIA) for archiving and that copies of this report will, for a fee, be made available upon application by interested parties.
7. By the lodgement of this report to the insurers, you hereby consent to the archiving of this report at the centre and to copies of the report being made available aforesaid.

ACCIDENT STATEMENT

Date of Submission	08/05/2023 15:45 (SGT)
Reported by	Actual Driver
Date of Accident	05/05/2023 06:30 (SGT)
Exact Location of Accident	Jalan Utem, Melaka, Malaysia
Additional Location Information	North South Expressway (Toll Road) towards Jalan Utem near 765 Jln Gestari 5
Country/State of Loss	Malaysia

DETAILS OF OWN VEHICLE

Vehicle Registration Number	SDE28Y
INSURED/POLICYHOLDER	
Is company?	Yes
Name Of Registered Owner	City Garden Pte Ltd
Company Reg No	1XXXXX196N
Email Address	citygdn@singnet.com.sg
Mobile Phone No	(Phone) +65-97538776
Alternative Phone No	-

VEHICLE PARTICULARS

Manufacturer	Toyota
Model	Estima
Variant	-
Exact purpose for which vehicle was being used at time of accident	Private use
Are you claiming under your own insurance policy for repair to your vehicle?	Yes
Vehicle Category	Private car
Transmission	Auto
CC	2400

INSURANCE COMPANY

Name of Insurance Company	China Taiping Insurance (Singapore) Pte. Ltd.
Policy Number / Cover Note Number	DMPCSNA00244152203

DRIVER

Name of Driver	Lim Beng Keong
NRIC No	SXXXX881H
Date Of Birth	25/08/1966

IMPORTANT NOTICE**SKETCH PLAN**

1. Please report correctly the details of the accident to speed up the claims process.
2. This Form must be completed by the Policyholder and/or the Actual Driver.
3. Information provided must be as truthful and accurate as possible. Any wilful misrepresentation or withholding of material facts may allow insurance companies to repudiate policy liability.
4. The issue and acceptance of this Form by insurance companies is not an admission of policy liability on the part of the insurance companies.
5. **Any false reporting may be referred to the Traffic Police Department for investigation.**
6. This report will be forwarded by the insurers to the GIA Records Management Centre established by the General Insurance Association of Singapore (GIA) for archiving and that copies of this report will for a fee be made available upon application by interested parties.
7. By the lodgement of this report to the insurers, you hereby consent to the archiving of this report at the centre and to copies of the report being made available aforesaid.
8. **Consent under the Personal Data Protection Act (PDPA)**

I understand, acknowledge, agree and consent that:

- (a) My insurer, my workshop and the General Insurance Association of Singapore ("GIA") may/are permitted to collect, use, disclose and/or process my personal data/personal information set out in this [form] and any other personal information provided by me or possessed by my insurer (collectively the "Personal Information") and disclose and transfer such Personal Information to all insurer(s) who have insured vehicle(s) involved in this accident (all insurer(s) who have insured vehicle(s) involved in this accident shall be collectively referred to as the "Insurers"), the Insurers' lawyers/law firms, the Monetary Authority of Singapore and any relevant government agency/authority (such as the police), for the purpose(s) of
- (i) processing, handling and/or dealing with my claims including the settlement of the claims and any necessary investigations relating to the claims;
- (ii) investigating the accident and/or my claims;
- (iii) carrying out and/or dealing with my instructions or responding to any enquiries by me;
- (iv) administering my claims (including the mailing of correspondence, statements, invoices, reports or notices to me, which could involve disclosure of certain personal data about me to bring about delivery of the same as well as on the external cover of envelopes/mail packages); and/or
- (v) complying with applicable law in administering, processing, handling and/or dealing with my claims.
- (collectively the "Purposes")
- (b) all insurer(s) who have insured vehicle(s) involved in this accident and the Insurers' lawyers/law firms, may/are permitted to collect, use, disclose and/or process my Personal Information for one or more of the above Purposes; and
- (c) my Personal Information may/can be disclosed by any of the Insurers and/or GIA to their third-party service providers or agents (including their lawyers/law firms), which may be sited outside of Singapore, for one or more of the above Purposes.




Policyholder's Signature / Date & Time

Actual Driver's Signature (if driver is not the policyholder) / Date & Time

Witnessed by Reporting Centre Personnel
(Name as in NRIC/ID card)

Jenny Lim

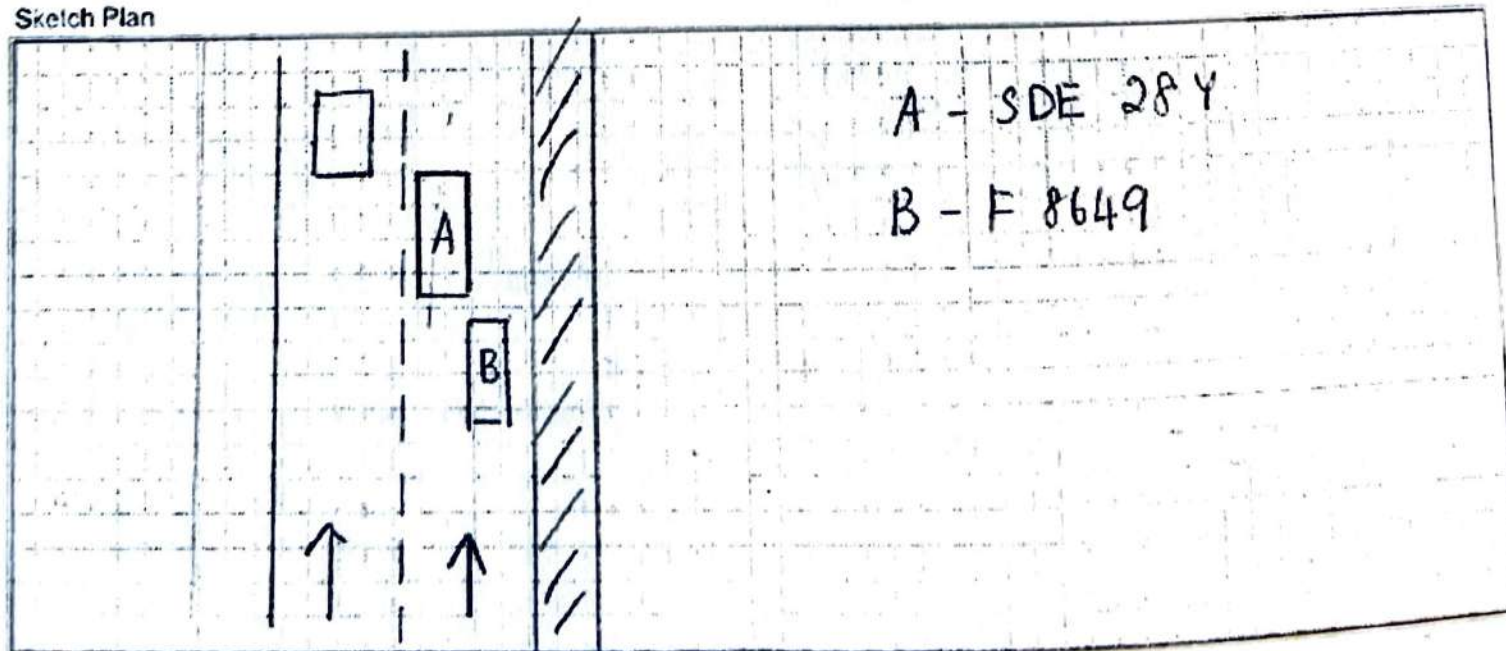Sketch Plan



POLICE REPORT (NP299)

CONTINUATION OF REPORT

Report No. A/20230507/2048

there is a distance between my vehicle and the front vehicle.

I checked for an incoming vehicle on my right for a blind spot before I filtered to lane 1. When I entered lane 1, my vehicle was suddenly collided from behind by a Malaysian vehicle bearing registration plate number 'F8649' which caused my vehicle to slide and my vehicle's front area dragging along the highway barrier before overturning in the middle of the road. I do not know how many times my vehicle flipped before overturning.

My vehicle was heavily damaged; the top of the vehicle was crushed; there was a broken front mirror; a dent on the left side; the front of the vehicle was crushed, broken water tank; a broken radiator; broken left and right front tires; a broken airbag; and other kinds of damages about which I am uncertain.

A total of four people were injured, including myself, when the accident occurred, and all four of us were conveyed by Malaysian ambulance to Melaka Hospital for treatment.

I am lodging this police report for record purpose for my insurance.

Signature Of Officer Recording The Report:
A / SGT 3 CAI JINQUAN

Signature Of Interpreter:
Not applicable

Officer In-Charge Of Case:
A / Central Police Divisional Investigation Branch /
SGT 3 LIM TING AN
Contact No.: 65575327

Signature Of Informant:

Date/Time:
07/05/2023 15:32

Classification Of Case:

> Back to OneMotoring

Inquire PARF/COE Rebate for Registered Vehicle

Vehicle Owner Particulars

Owner ID Type:

Company

Owner ID:

196N

Vehicle Details

Vehicle No.:

SDE28Y

Vehicle to be Exported:

Yes

Intended Deregistration Date:

31 May 2023

Vehicle Make:

TOYOTA

Vehicle Model:

ESTIMA AERAS PREMIUM 2.4 A

Primary Colour:

White

Manufacturing Year:

2015

Engine No.:

2AZJ150583

Chassis No.:

ACR500190795

Maximum Power Output:

125.0 kW (167 bhp)

Open Market Value:

\$29,412.00

Original Registration Date:

21 Apr 2016

First Registration Date:

21 Apr 2016

Transfer Count:

1

Actual ARF Paid:

\$33,177.00

Intended PARF Rebate Details

PARF Eligibility:

Yes

PARF Eligibility Expiry Date:

20 Apr 2026

PARF Rebate Amount:

\$19,906.00

Intended COE Rebate Details

COE Expiry Date:

20 Apr 2026

COE Category:

B - Car above 1600cc or 97kW (130bhp)

COE Period(Years):

10

QP Paid:

\$49,602.00

COE Rebate Amount:

\$14,329.00

Total Rebate Amount:

\$34,235.00

The information contained herein is correct as at 31 May 2023

OK