

ASS. REC. BY:

REF: 105/2300-7318/KV

Kenneth

ASSIGNMENT

From: _____ Date: _____

Estimated Cost: _____

OD/TP/WS/TP RES/OD RES/EVA/INV/IVY

To Inspect Vehicle No: _____

at Workshop m/s _____

of _____

Insured: SLT 9994A

Policy No. _____

Claims No. DMPC2300591H/02/ST

Sum Insured: _____


Excess: _____

(Client's Record)

Make of Veh: _____

(Policy Condition)

Remark: The veh had commenced its repair at the time of inspection.

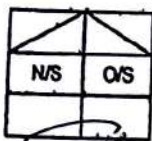

Bal. or Market Value: \$76k

IDAC Accident Report: _____

Consistent?: Yes or No

GIA / PR Seen: _____

Consistent?: Yes or No

Est. Repairs: 8-10 days

Res.: Yes or No

Lum Sum: 20 %

3 Val.: Yes or No

CA / REV / REP. / 24 HRS

Date: _____

Person Contacted: _____

Vehicle: IN / OUT

Veh No: SLX 3419M

Yr Regn: 03, 18

Type: M/Car / M/Cycle / Bus / Van / Lorry / Taxi / Prime Mover /

Truck / Trailer or _____

Make: Hyundai

Kong C.C. 998

Colour: M. Orange

A/C: Insured / Std / NI / NA

Sp. Reading: 66499

T/Radio: Insured / Std / NI / NA

Eng/No: _____

C/No: KM14K 3811 LJ01 094207

Gen. Cond: Good / Fair / Poor / Burnt

Steering: Inorder / Jammed / Leaked / Burnt or

Brake: Inorder / Jammed / Leaked / Burnt or

Mod: Nil / S/Rim / STD A/Rim or

Tyre Size: F: 215/55R17

R: _____

BS / DUN / EXNOVA / GY / FS / LIZA / MIC / OHTSU / PIR / SUMI / TOYO / YOKO or

Front

Rear

R/Bal. 9 mm

R/Bal. 9 mm

L/Bal. 9 mm

L/Bal. 9 mm

D.O.A. 17/7/23

D.O.I. 20/7/2023

Survey held at _____

Des. of Damages: Frt / Rear / O/S / N/S / UIC / Rooftop or

The UIC / Chassis frame / Body Structure affected due to collision.

Date / Time

Action / Instruction

27/7/23 Submit preli report-revised fig \$6129.96 check items \$6136.16

Date/Time, File Pass to?



Preli. Report

1)



Final Report

Date/Time, File Return to?

2) 27/7/23-typist

Days Of Repair: 10

Resurvey No. of Trip: _____

Survey Fee: _____

Transportation: _____

S - RS - SI

Fees

Others

TOTAL

Add Fee:



Site Insp (\$



Interview (\$



Tech Invs (\$



Weekend (\$

Report Format:

Lump Sum / I.B.I. (\$

源摩哆廠

GUAN MOTOR WORKS

Business Regn. No. 08102600E

176 Sin Ming Drive #02-03 Sin Ming Autocare Singapore 575721 Tel: 6453 6111 Fax: 6453 8292 H/P: 9742 6003

REPAIR ESTIMATE FOR SLX3419M

NOT Notified
L1 Rep &
Achieve After Paint
8-10 days

No.	Qty	List Items	
1	1	Rear bumper top	\$ <i>By</i> 516.90 <i>—</i>
2	1	Rear bumper bottom	\$ <i>CM</i> 185.00 <i>—</i>
3	2	Rear bumper reverse sensor	\$ <i>Shen</i> 390.00 <i>—</i>
4	2	Rear bumper side lamp	\$ 283.60 <i>?</i>
5	2	Rear bumper side retainer	\$ <i>DI</i> 36.00 <i>—</i>
6	1 set	Rear bumper clips	\$ <i>na</i> 50.00 <i>—</i>
7	1	Rear bumper inner reinforcement	\$ <i>CM</i> 370.80 <i>—</i>
8	1	Rear tailgate	\$ <i>By</i> 1,628.60 <i>—</i>
9	1	Rear tailgate centre "H" logo	\$ <i>na</i> 30.70 <i>—</i>
10	2	Rear tailgate side lamp	\$ <i>na</i> 886.00 <i>4</i>
11	1	Rear tailgate outer handle/garnish	\$ <i>na</i> 226.00 <i>—</i>
12	2	Rear tailgate number plate lamp	\$ <i>na</i> 60.60 <i>X</i>
13	1	Rear tailgate reverse camera	\$ 573.90 <i>?</i>
14	1	Rear wiper motor	\$ 263.90 <i>?</i>
15	1	Rear tailgate inner trim board	\$ 253.00 <i>?</i>
16	1 set	Rear tailgate inner trim board clips	\$ 60.00 <i>?</i>
17	2	Rear tailgate damper	\$ <i>na</i> 364.00 <i>X</i>
18	1	Rear tailgate top lock	\$ <i>na</i> 208.00 <i>—</i>
19	1	Rear tailgate lower lock catch	\$ <i>na</i> 28.80 <i>X</i>
20	1	Rear tailgate weatherstrip	\$ <i>DI</i> 112.20 <i>—</i>
21	1	Rear end panel	\$ <i>By</i> 739.10 <i>—</i>
22	1	Rear end panel top garnish	\$ <i>na</i> 157.50 <i>—</i>
23	1	Rear spare tyre panel	\$ 695.00 <i>?</i>
24	1	Rear spare tyre top board	\$ 495.00 <i>?</i>
25	1	RH taillamp	\$ <i>na</i> 462.40 <i>—</i>
26	1	Rear RH fender	\$ <i>na</i> 1,842.40 <i>X</i>
27	1	Rear RH fender 1/4 glass moulding	\$ <i>na</i> 208.70 <i>X</i>
28	1	Rear RH fender lower wheel arch garnish	\$ <i>na</i> 164.00 <i>X</i>
29	1 set	Rear RH fender lower wheel arch garnish clips	\$ <i>na</i> 40.00 <i>X</i>
30	1	Rear RH fender under splash shield	\$ 164.00 <i>?</i>
31	1 set	Rear fender under splash shield clips	\$ 40.00 <i>?</i>
32	2	Rear fender inner side trim board	\$ 667.80 <i>?</i>
33	1 set	Rear fender inner side trim board clips	\$ 80.00 <i>?</i>
34	1	Roof panel RH side moulding	\$ <i>na</i> 31.00 <i>X</i>
35	1	Rear RH lower exhaust silencer	\$ 1,286.00 <i>?</i>
36	1	Rear RH lower exhaust silencer top heat shield	\$ 283.00 <i>?</i>
			\$ 13,883.90
Less 20%			\$ 2,776.78
Total :			\$ 11,107.12

Special Nett Items

37	1 set	Rear windscreen/rear RH fender 1/4 glass sealant	\$ <i>na</i> 120.00 <i>X</i>
38	1	Rear number plate	\$ <i>na</i> 50.00 <i>455m</i>

1 set Rear end panel/spare tyre panel sealant

	\$	120.00	7
Total :	\$	290.00	

Labour

1	Labour Charges for remove/refit, panel beat and replacement of damages.	\$	1,800.00	7
2	To putty and spray Spray Paintings charges.	\$	1,400.00	1200
3	To remove, refit rear windscreen.	\$	140.00	1200
4	To remove, refit rear RH fender 1/4 glass.	\$	100.00	x
5	To check wirings and lightings.	\$	40.00	200
6	To transfer rear tailgate fittings.	\$	80.00	600
7	To remove, refit & reset reverse sensors & reverse camera	\$	140.00	800
8	To remove, refit roof lining, rear seats assy & upholstery, inorder to facilitate repair	\$	180.00	1000
9	To remove, refit rear RH lower exhaust silencer.	\$	80.00	600
10	To supply and apply anti rust treatment	\$	100.00	7
	Total :	\$	4,060.00	

Total Parts and Labour : \$ 15,457.12

LKK Auto Consultants hence notify
the Repairer of the following:

- To resurvey before/after spray painting
- To display damaged part(s) during resurvey
- Parts prices are subject to confirmation
- Third party survey is on a "Without Prejudice" basis
- No illegal modification(s) is allowed
- Supplementary item(s) must be resurveyed and is subject to final approval from Insurance Company

Acknowledged by Repairer

Signature:

Date:

SINGAPORE ACCIDENT STATEMENT

IMPORTANT NOTICE

1. Please report correctly the details of the accident to speed up the claims process.
2. This Form must be completed by the Policyholder and/or the Actual Driver.
3. Information provided must be as truthful and accurate as possible. Any wilful misrepresentation or withholding of material facts may allow insurance companies to repudiate policy liability.
4. The issue and acceptance of this Form by insurance companies is not an admission of policy liability on the part of the insurance companies.
5. Any false reporting may be referred to the Police for investigation.
6. This report will be forwarded by the insurers of the GIA Records Management Centre established by the General Insurance Association of Singapore (GIA) for archiving and that copies of this report will, for a fee, be made available upon application by interested parties.
7. By the lodgement of this report to the insurers, you hereby consent to the archiving of this report at the centre and to copies of the report being made available aforesaid.

ACCIDENT STATEMENT

Date of Submission	17/07/2023 09:59 (SGT)
Reported by	Actual Driver
Date of Accident	15/07/2023 14:15 (SGT)
Exact Location of Accident	Near 47 Merryn Rd, Singapore 298496
Additional Location Information	ALONG PIE TO CHANGI
Country/State of Loss	Singapore

DETAILS OF OWN VEHICLE

Vehicle Registration Number	SLX3419M
-----------------------------	----------

INSURED/POLICYHOLDER

Is company?	No
Name Of Registered Owner	Teo Chan Hiong
NRIC No	S1447726H
Email Address	teochanhiong@gmail.com
Mobile Phone No	(Phone) +65-96780313
Alternative Phone No	-

VEHICLE PARTICULARS

Manufacturer	Hyundai
Model	KONA
Variant	-
Exact purpose for which vehicle was being used at time of accident	-
Are you claiming under your own insurance policy for repair to your vehicle?	No - Claiming third party
Vehicle Category	Private car
Transmission	Auto
CC	1000

INSURANCE COMPANY

Name of Insurance Company	Auto & General Insurance (Singapore) Pte. Limited.
Policy Number / Cover Note Number	P10707888R01

DRIVER

Name of Driver	TEO TE WEI
NRIC No	S9044386J
Date Of Birth	23/11/1990
Occupation	Indoor

IMPORTANT NOTICE

SKETCH PLAN

1. Please report correctly the details of the accident to speed up the claims process.
2. This Form must be completed by the Policyholder and/or the Actual Driver.
3. Information provided must be as truthful and accurate as possible. Any wilful misrepresentation or withholding of material facts may allow insurance companies to repudiate policy liability.
4. The issue and acceptance of this Form by insurance companies is not an admission of policy liability on the part of the insurance companies.
5. Any false reporting may be referred to the Traffic Police Department for investigation.
6. This report will be forwarded by the insurers to the GIA Records Management Centre established by the General Insurance Association of Singapore (GIA) for archiving and that copies of this report will for a fee be made available upon application by interested parties.
7. By the lodgement of this report to the insurers, you hereby consent to the archiving of this report at the centre and to copies of the report being made available aforesaid.
8. Consent under the Personal Data Protection Act (PDPA)
I understand, acknowledge, agree and consent that:
(a) My insurer, my workshop and the General Insurance Association of Singapore ("GIA") may/are permitted to collect, use, disclose and/or process my personal data/personal information set out in this [form] and any other personal information provided by me or possessed by my insurer (collectively the "Personal Information") and disclose and transfer such Personal Information to all insurer(s) who have insured vehicle(s) involved in this accident (all insurer(s) who have insured vehicle(s) involved in this accident shall be collectively referred to as the "Insurers"), the Insurers' lawyers/law firms, the Monetary Authority of Singapore and any relevant government agency/authority (such as the police), for the purpose(s) of:
(i) processing, handling and/or dealing with my claims including the settlement of the claims and any necessary investigations relating to the claims;
(ii) investigating the accident and/or my claims;
(iii) carrying out and/or dealing with my instructions or responding to any enquiries by me;
(iv) administering my claims (including the mailing of correspondence, statements, invoices, reports or notices to me, which could involve disclosure of certain personal data about me to bring about delivery of the same as well as on the external cover of envelopes/mail packages); and/or
(v) complying with applicable law in administering, processing, handling and/or dealing with my claims.
(collectively the "Purposes")
(b) all insurer(s) who have insured vehicle(s) involved in this accident and the Insurers' lawyers/law firms, may/are permitted to collect, use, disclose and/or process my Personal Information for one or more of the above Purposes; and
(c) my Personal Information may/can be disclosed by any of the Insurers and/or GIA to their third-party service providers or agents (including their lawyers/law firms), which may be sited outside of Singapore, for one or more of the above Purposes.

Policyholder's Signature / Date & Time

WCM
16/7/23

Driver's Signature (if driver is not the policyholder) / Date & Time

WCM
16/7/23

Witnessed by Reporting Centre Personnel
(Name as in NRIC/ND card)

Ng Keng Guan

Sketch Plan

